

PROCEDIMENTOS DE SERVIÇOS DE MANUTENÇÃO

Nº CEDOC	TÍTULO
33.890	PROCEDIMENTO PARA CONFIGURAR MEDIDOR DE VAZÃO ENDRESS + HAUSER PROMASS 80

PROMASS 80


Este procedimento foi elaborado para realizar a configuração dos parâmetros do medidor de vazão PROMASS 80, ecoresinador FA1 e FA2

- 1- Para acessar a tela do supervísório com os medidores deve-se seguir o passo abaixo como mostram as imagens.

Acesso menu principal → Tensão de Comando

The first screenshot shows the 'Válvulas de regulagem' (Regulating Valves) menu. A red arrow points to the 'Acesso Menu Principal' (Access Main Menu) button. The second screenshot shows the 'Tensão de comando' (Command Voltage) setting. A red arrow points to the 'Tensão de comando' button, with a note: 'Acessar Tensão de comando, onde irá mostrar todos os medidores' (Access Command Voltage, where it will show all meters). The third screenshot shows the 'Sistema - PLC' (PLC System) configuration screen, displaying the PLC system architecture and the 'Eco Resinador' (Eco Resinator) configuration.

- 2- Deve-se verificar qual medidor de vazão está apresentando problema ou obstrução, na imagem abaixo mostra o exemplo de um medidor com problema no 68.

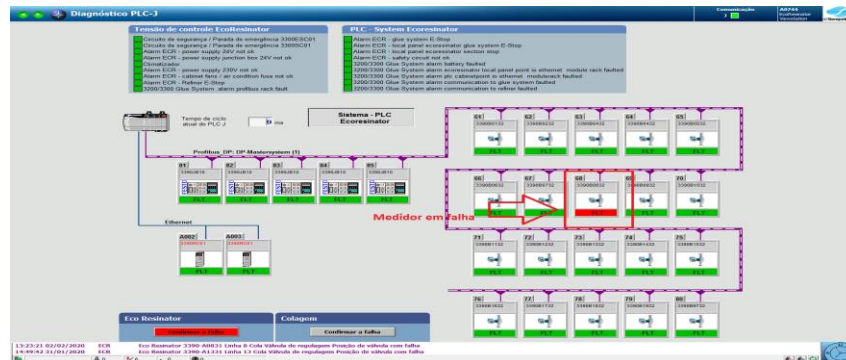

- 3- Após identificado qual medidor está em falha e realizar a substituição, será necessário parametrizá-lo com parâmetros das tabelas da última página.
- 4- Para alterar o endereçamento "Nó" seguir os passos mostrados nas imagens abaixo.

Imagem Inicial do medidor



Acessar o menu Communication



Dentro do menu Communication acessar FieldBus Address e alterar o endereçamento necessário



Ao tentar alterar o endereçamento, será necessário digitar a senha 0080



Ao finalizar a alteração, selecionar com a tecla E, até aparecer a mensagem Back to group selection, finalizando a alteração do endereçamento.



- 5- Tabelas com os parâmetros/unidades de medidas, para serem alterados no medidor de vazão novo, podendo ser colocados em bancada com maior comodidade.

Cod. Sap. Medidor de vazão novo 109461 REDB13.22

Measuring Values	
Mass Flow	Variável
Volume Flow	Variável
Cor. Volume Flow	Variável
Density	Variável
Ref. Density	Variável
Temperature	Variável

System Units	
Unit Mass Flow	Kg/m
Unit Mass	Kg
Unit Volume Flow	L/m
Unit Volume	L
Unit Cor. Vol. FL	Nm ³ /h
Unit Cor. Volume	Nm ³
Unit Density	Kg/l
Unit Ref. Density	Kg/NL
Unit Temperature	°C (celsius)
Unit Lenght	millimeter
Unit Pressur	Bar G
Format Date/Time	DD.MM.YY 24H

Quick Setup	
Qs-comission	No
Qs-comunication	No

Operation	
Language	English/Português
Acess Code	80
Def. Private Code	80
Status Acess	acess customer
Acess Code Cntr	8

User Interface	
Assign Line 1	mass flow

Communication	
Tag Name	Tag medidor
FieldBus Address	77(ex. Nó)
Writ Protect	Off
Selection GSD	Manufact. Spec
Unit to Bus	Off
Profile Version	3.00
Actual Baudrate	31.250
Devid Id	0x1528
Check Config.	Accepted
Block Selection	Analog Input 1
Out Value	Variável
Channel	Volume Flow

Process Parameter	
Assign Lf-Cut Off	mass flow
On-Val.Lf-Cut Off	0.200kg/min
OffVal.Lf-Cut Off	50%
Empty Pipe Det.	On
Epd Volume low	0.200kg/l
Epd Value High	6.000kg/l
Epd Response Time	1.0s
Fix. Ref. Density	100.00mA
Zero Point Adjust	1.0000kg/Nl
Density Set Val 1	Cancel
Restore Original	1.1257kg/l
Pressure mode	Off

System Parameter	
Instl. Dir. Sensor	Normal (Forward)
Measuring mode	Unidirectional
Pos. Zero Return	Off
Density Damping	0s
Flow Damping	0s

Assign Line 2	TOT. 2 out value
Format	X.XXXX
Display Damping	15
Contrast LCD	50%
BackLight	50%
Test Display	Off

Totalizer	
Select Totalizer	Totalizer 1
Tot.1 Out Value	Variável
Overflow	
Channel	Volume Flow
Unit Totalizer	L
Set Tot	Totalize
Preset Tot	0
Totalizer mode	Balance
Cycl. Calc. Tot	On

Supervision	
Actual Sys. Cond	System Ok
Prev Sys. Cond	Fluid Inhom
Alarm Delay	0s
System Reset	No
Operation Hours	Variável
Permanent Storag	On

Simulat. System	
Sim. Failsafemode	Off
Sim. Measurend	Off