


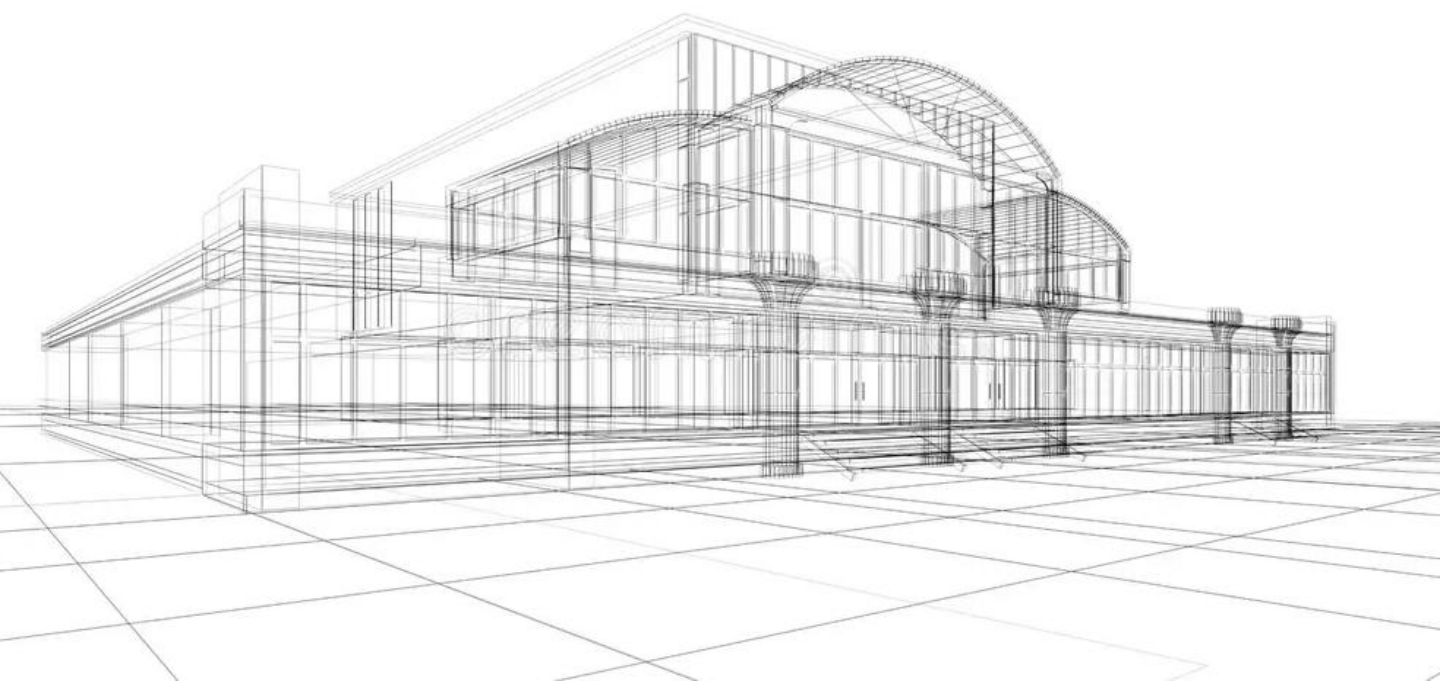

# Inspection Report

Client:

Our Happy Client

Property Location:

03501, Benidorm, Your Dream House Location, Alicante, Spain

Дата:

26.01.2025



# Purpose, scope and limitations of inspection

A home inspection is intended to assist in evaluating the overall condition of the dwelling. The inspection is based on observation of the visible, readily accessible and apparent condition of the structure and its components on this day. The results of this inspection are not intended to make any representation regarding the presence or absence of concealed defects that are not reasonably ascertainable or readily accessible in a competently performed inspection. No warranty, guarantee or insurance is expressed or implied by this report.

No destructive testing or dismantling of components is performed. Not all defects will be identified during this inspection. Unexpected repairs should be anticipated. The person conducting your inspection is not a Structural Engineer or other professional whose license authorizes the rendering of an opinion as to the structural integrity of a building or its other component parts.

In accordance with industry standards, the inspection is limited to only those surfaces that are exposed and readily accessible. The Inspector does not move furniture, lift floor-covering materials, or remove or rearrange items within closets or on shelving. On your final walk through, or at some point after furniture and personal belongings have been removed, it is important that you inspect the interior portions of the residence that were concealed or otherwise inaccessible at the time of the inspection.

This report has been produced in accordance with the AGREEMENT and is subject to the terms and conditions agreed upon therein.

Home inspectors are not required to report on the following:

- Life expectancy of any component or system;
- The causes of the need for a repair;
- The methods, materials, and costs of corrections;
- The suitability of the property for any specialized use;
- Compliance or non-compliance with codes, ordinances, statutes, regulatory requirements or restrictions;
- The market value of the property or its marketability;
- The advisability or inadvisability of purchase of the property;
- Any component or system that was not observed;
- The presence or absence of pests such as wood damaging organisms, rodents, or insects; or Cosmetic items, underground
- items, or items not permanently installed.
- Home inspectors are not required to:
- Offer warranties or guarantees of any kind;
- Calculate the strength, adequacy, or efficiency of any system or component;
- Enter any area or perform any procedure that may damage the property or its components or be dangerous to the home
- inspector or other persons;
- Operate any system or component that is shut down or otherwise inoperable;
- Operate any system or component that does not respond to normal operating controls;
- Disturb insulation, move personal items, panels, furniture, equipment, plant life, soil, snow, ice, or debris that obstructs
- access or visibility;
- Determine the presence or absence of any suspected adverse environmental condition or hazardous substance, including
- but not limited to mold, toxins, carcinogens, noise, contaminants in the building or in soil, water, and air;
- Determine the effectiveness of any system installed to control or remove suspected hazardous substances;
- Predict future condition, including but not limited to failure of components.

# Contents

|                                              |           |
|----------------------------------------------|-----------|
| <b>Executive summary</b>                     | <b>10</b> |
| Property information & inspection conditions | 12        |
| Site                                         | 13        |
| Structural integrity and exterior            | 15        |
| Roof                                         | 20        |
| Interior floor area & finishes               | 20        |
| Moisture & water intrusion                   | 30        |
| Thermal insulation                           | 30        |
| Electrical system                            | 30        |
| Water supply & drainage                      | 30        |
| Ventilation & air conditioning               | 30        |
| Heating                                      | 40        |
| Environmental health & safety                | 40        |
| Swimming pool                                | 40        |
| Garage                                       | 50        |
| Other                                        | 50        |



# Executive Summary

## Overall Property Condition



good

~ €1 000

### Critical

- Reinforce balustrade columns

- The property is in good overall condition considering its age, with both the exterior and interior finishes well maintained
- No critical structural defects were identified. The remaining deficiencies are minor and can be remedied at relatively low cost
- The most significant repair costs are associated with the terrace and patio finishes, requiring reconstruction of the substrate and improvements to the waterproofing system
- The roof is in satisfactory condition. Replenishment of the ballast layer on the flat roof section is strongly recommended to maintain proper thermal insulation and waterproofing performance.

## Estimated Repair Cost

~ €13 000

### Important

- Terrace waterproofing, repair of terrace substrate and ceramic tiling
- Repair cracking in the north retaining wall
- Replace damaged roof tiles and restore the flat roof ballast covering and waterproofing system
- Repair the foundation apron and improve basement waterproofing

## Inspection Results by Category

| Category                                                                                                                     | Condition                                                                                   | Defects                                                                                                                                                                                                                                                                                                    | Others                                                                                                                                                                                           |
|------------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
|  <b>Site &amp; Surrounding Area</b>          |  bad      | <b>Critical and important</b> <ul style="list-style-type: none"><li>Terrace balustrade columns are not secured properly, risk of collapse</li><li>Ceramic floor tiles of terrace are debonding and deteriorating</li><li>Horizontal crack in the north retaining wall (approximately 2 mm wide).</li></ul> | <ul style="list-style-type: none"><li>No proper rainwater drainage, rainwater may enter swimming pool</li><li>Cracks in the southern retaining wall will require repair in the future.</li></ul> |
|  <b>Structural Integrity &amp; Exterior</b> |  good    |                                                                                                                                                                                                                                                                                                            | <ul style="list-style-type: none"><li>Southern perimeter paving is heavily damaged and requires repair</li></ul>                                                                                 |
|  <b>Roof</b>                                |  average | <ul style="list-style-type: none"><li>Cracked roof tiles and deterioration of the ballast layer on the flat roof.</li></ul>                                                                                                                                                                                |                                                                                                                                                                                                  |
|  <b>Interior Floor Area &amp; Finishes</b>  |  good    | <ul style="list-style-type: none"><li>Measured internal floor area (~220 m<sup>2</sup>) differs from the owner's declared area.</li></ul>                                                                                                                                                                  | <ul style="list-style-type: none"><li>Partial tile debonding observed in the basement</li></ul>                                                                                                  |
|  <b>Moisture &amp; Water Intrusion</b>      |  average | <ul style="list-style-type: none"><li>Elevated moisture levels in the basement.</li><li>Water leakage traces observed in the garage caused by water infiltration from the terrace.</li></ul>                                                                                                               |                                                                                                                                                                                                  |
|  <b>Thermal Insulation</b>                  |  average | <ul style="list-style-type: none"><li>High heat loss on the eastern side due to lack of roof insulation and single-glazed windows</li></ul>                                                                                                                                                                |                                                                                                                                                                                                  |
|  <b>Electrical System</b>                   |  good    | <ul style="list-style-type: none"><li>One electrical circuit is overloaded (two air-conditioning units and the water heater).</li></ul>                                                                                                                                                                    |                                                                                                                                                                                                  |
|  <b>Water Supply &amp; Drainage</b>         |  good    | <ul style="list-style-type: none"><li>Low hot water pressure on the first floor due to undersized piping from the water heater.</li></ul>                                                                                                                                                                  | <ul style="list-style-type: none"><li>Four shut-off valves require replacement.</li></ul>                                                                                                        |
|  <b>Ventilation &amp; Air Conditioning</b>  |  good    | <ul style="list-style-type: none"><li>No mechanical exhaust ventilation in first and second-floor bathrooms. Signs of mould are present</li></ul>                                                                                                                                                          | <ul style="list-style-type: none"><li>Air-conditioning capacity in the first-floor open area may be insufficient (2 × 9,000 BTU units).</li></ul>                                                |
|  <b>Environmental Health &amp; Safety</b>   |  good    |                                                                                                                                                                                                                                                                                                            | <ul style="list-style-type: none"><li>Visible mould beneath the basement window</li></ul>                                                                                                        |
|  <b>Swimming Pool</b>                       |  good    |                                                                                                                                                                                                                                                                                                            | <ul style="list-style-type: none"><li>5-7 mosaic tiles are missing from the pool finish</li></ul>                                                                                                |



## Property Information

Type: *Detached house, two-storey + basement*  
Address: *03501, Benidorm, Your Dream House Location, Alicante, Spain*

Building area claimed: *~250 m<sup>2</sup>*  
Building area measured: *~220 m<sup>2</sup>*

## Conditions during inspection


Date: *June 26, 2025*  
Start time: *14:00*  
Finish time: *18:20*  
Outdoor Temperature: *22 C° -> 27 C°*  
Precipitation: *none*  
Outdoor Relative Humidity: *65%*  
Indoor Temperature: *25-27 C°*  
Outdoor Relative Humidity (min/max): *55% / 70%*

## Inspection Scope Completed

| Category                          | Completion status | Comments                                                                                                                        |
|-----------------------------------|-------------------|---------------------------------------------------------------------------------------------------------------------------------|
| Site                              | 100% of 100%      |                                                                                                                                 |
| Exterior                          | 100% of 100%      |                                                                                                                                 |
| Structural Integrity & Foundation | 70% of 100%       | <i>no external access to the foundation. Partial inspection performed from the basement and exposed plinth only</i>             |
| Roof                              | 50% of 100%       | <i>no access to the attic or concealed roof space. Structural elements could not be inspected</i>                               |
| Interior & Finishes               | 100% of 100%      |                                                                                                                                 |
| Moisture Survey                   | 100% of 100%      |                                                                                                                                 |
| Thermal Insulation                | 100% of 100%      |                                                                                                                                 |
| Electrical System                 | 90% of 100%       |                                                                                                                                 |
| Water Supply & Drainage           |                   |                                                                                                                                 |
| Ventilation & Air Conditioning    | 70% of 100%       | <i>mechanical exhaust ventilation is installed only in the kitchen and basement, other rooms have no mechanical ventilation</i> |
| Heating / Fireplaces              | 0% of 0%          | <i>outside inspection scope</i>                                                                                                 |
| Environmental Health & Safety     | 100% of 100%      |                                                                                                                                 |
| Swimming Pool                     | 100% of 100%      |                                                                                                                                 |
| Garage                            | 50% of 100%       | <i>automatic garage door operation was not tested/ no remote control provided</i>                                               |
| Outbuildings                      | 0% of 0%          | <i>outside inspection scope</i>                                                                                                 |



## Plot plan

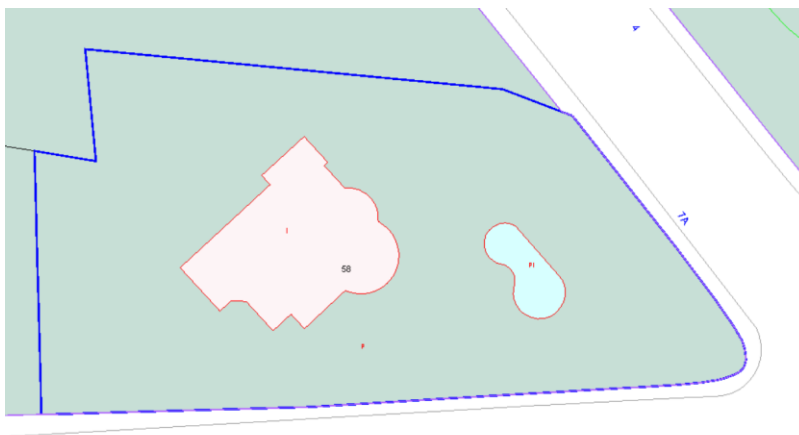


## House plan

### Basement

**20 m<sup>2</sup>**


- Room B1 10 m<sup>2</sup>
- Bathroom B1 10 m<sup>2</sup>

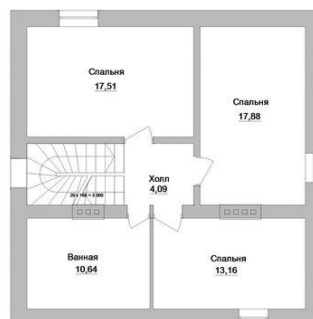

### Floor 1

**30m<sup>2</sup>**


- Room C1 10 m<sup>2</sup>
- Room C2 10 m<sup>2</sup>
- Room C3 10 m<sup>2</sup>
- Room C4 10 m<sup>2</sup>
- Room C5 10 m<sup>2</sup>
- Kitchen C6 10 m<sup>2</sup>
- Bathroom C7 10 m<sup>2</sup>

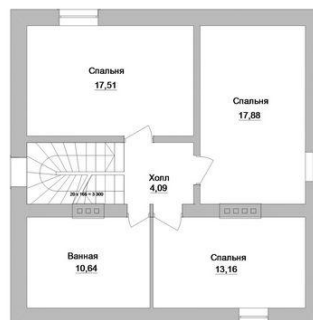

### Этаж 2

**30m<sup>2</sup>**

- Room D1 10 m<sup>2</sup>
- Room D2 10 m<sup>2</sup>
- Room D3 10 m<sup>2</sup>
- Room D4 10 m<sup>2</sup>
- Room D5 10 m<sup>2</sup>
- Room D6 10 m<sup>2</sup>
- Bathroom D7 10 m<sup>2</sup>

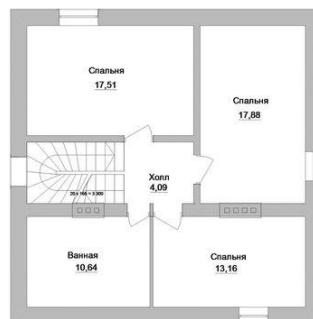



## Site: Summary

### Overall condition



bad

### Comments

- Total site area ~800 m2, usable area is limited with the land slope to ~ 400 m2 (patio and area adjacent to the swimming pool)
- The site's overall condition is negatively affected by deterioration of the terrace and patio tile finishes and by the unsafe condition of the terrace balustrade
- Additional cosmetic repairs are recommended for painted surfaces, boundary walls and landscaping

### Element

### Condition

#### Exterior fence



good

- Fence of concrete blocks with metal mesh on metal posts. Some sections of the fence work as retaining walls, protecting
- All fence elements (foundation, posts, mesh, shading plastic membrane and bamboo decorative finish) are in good condition

#### Retaining walls



average

- All the retaining walls are generally stable, there are cracks up to 5 mm wide. This require monitoring and may require repair if movement continues

#### Terrace, patio



bad

- Patio and terrace are covered with ceramic tiles installed over an older tiled surface. There are significant areas with tile debonding (~10 m2) and cracked tiles (~2 m2). Exterior floor requires tiles replacement and reconstruction of concrete foundation

#### Balustrade, staircases



critical

- The terrace balustrade requires structural reinforcement. It is not anchored to the adjacent house wall, creating a potential collapse hazard.

#### Rainwater drainage



bad

- Site relief and exterior fence protect the site from rainwater penetration. The site has no engineered stormwater drainage system. Drainage relies solely on the natural slope of the site and openings beneath the balustrade.
- Water infiltration is visible beneath the terrace and patio. Leakage into the garage has occurred. Some runoff may enter the swimming pool

#### Main entrance



good

- No defects observed

#### Intercom



good

- No defects observed

#### Vehicle gates



not present

- The property has no vehicle access, which may complicate the delivery of large items.

#### Permanent Sun Protection



average

- A pergola is installed on the terrace. Decorative timber fascia boards require repair. Roof finish shows signs of weathering. The outdoor kitchen awnings are significantly worn and should be replaced..

#### Irrigation system



good

- Two irrigation circuits are installed. Automatic controller and solenoid valves are functioning correctly..

#### Landscaping



good

- No lawn is present. Several hedge sections require restoration. Large trees (pine and palm) are in good condition.



## Site: Estimated Repair Cost

**~ €1 000**

### Critical

- Reinforce terrace balustrade columns

**~ €7 000**

### Important

- Terrace waterproofing, repair of terrace substrate and ceramic tiling
- Repair cracking in the retaining wall (south)
- Repair the foundation apron and improve basement waterproofing (also see Moisture & Water Intrusion section)

### Other

- Install a stormwater drainage system
- Repair cracks in the southern retaining wall
- Restore landscaping and hedges



# Site. Overview and defects

## Retaining walls. Overview

Northern side



Southern side




other photos




[www.housedoctor.es/cid=janwjdkj&chid=01](http://www.housedoctor.es/cid=janwjdkj&chid=01)

## Retaining walls. Defects

Plaster and painting defects (north)



Green hedge sections missing (south)



other photos



[www.housedoctor.es/cid=janwjdkj&chid=01](http://www.housedoctor.es/cid=janwjdkj&chid=01)

## Comments

- Retaining on northern side are in good condition, no important defects found. Some areas of the walls exhibit minor plaster and paint defects and may require localized repairs to restore the surface finish.
- Wall on the southern side has few cracks, show no signs of deformation. There is minor risk of further deterioration, but it requires attention.

## Recommendations

- Monitor cracks in the southern wall, repair and reinforce in case of deterioration.
- If necessary, do localized repairs to restore the surface finish.







# Site. Overview and defects

## Terrace, patio. Overview

Terrace



Patio




other photos



[www.housedoctor.es/cid=janwjdkj&chid=01](http://www.housedoctor.es/cid=janwjdkj&chid=01)


## Terrace, patio. Overview

Cracked tiles on terrace floor

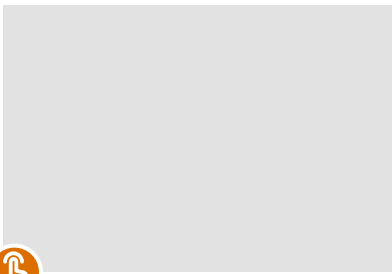

important

Ceramic tile debonding on terrace floor

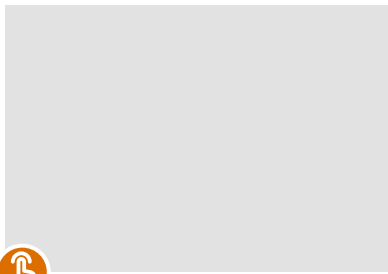


important

other photos



[www.housedoctor.es/cid=janwjdkj&chid=01](http://www.housedoctor.es/cid=janwjdkj&chid=01)

Water penetration into garage through terrace floor



important

other photos



[www.housedoctor.es/cid=janwjdkj&chid=01](http://www.housedoctor.es/cid=janwjdkj&chid=01)

## Comments

- Patio and terrace are covered with ceramic tiles installed over an older tiled surface. There are signs of substrate deformation in the patio area that caused tile debonding and cracks.
- Terraces is constructed on top of garage which is located below ground level. Terrace waterproofing is inadequate. Water penetrates below terrace ceramic tiles into terrace foundation and further into garage.

## Recommendations

- Repair of terrace foundation and floor, waterproofing.
- Localized repair of ceramic tiling on terrace floor is complicated. Replacement of all the tiling will be necessary.



# Structural integrity, exterior: Summary

## Overall condition

**good**

## Comments

- The house is situated on a sloping site with a significant north-to-south gradient. It is supported by a stepped foundation, which extends deeper on the southern side where the basement is located
- The structural design are typical of properties constructed in the 1990s. The house features a reinforced concrete frame with a composite cast-in-place structural system, and the second-floor slab is supported by reinforced concrete beams
- Overall, the property is in good condition, with no significant defects observed in the exterior.

## Element

## Condition

### Foundation

not  
inspected

- There is no direct access to the foundation. Inspection from the basement was limited due to the interior finishes concealing the structural elements

### Basement

**good**

- All interior surfaces of the basement are finished with plaster, ceramic tile, or painted coatings. As a result, assessment of the foundation and other structural elements is limited because these finishes conceal the underlying construction.
- No visible cracks were observed in the basement walls or ceiling. This is indirect evidence that the foundation and the first-floor slab are in satisfactory condition

### Walls, facades

**good**

- The exterior walls are plumb and show no significant signs of deformation or structural movement. The walls are constructed of hollow clay masonry units without additional thermal insulation.
- The exterior finish consists of pebble-dash render with a painted coating. A crack approximately 1 m (3.3 ft) long with a maximum width of about 2 mm was observed on the north exterior wall at the second-floor level. The crack should be monitored for any signs of further movement.
- The corresponding interior surface of the wall is finished with ceramic tile. The tile finish is in good condition, with no visible cracks or evidence of debonding

### Main entrance

**good**

- The main entrance consists of a concrete porch with steps and a cantilevered tiled canopy. All elements are in good overall condition, with no defects observed

### Foundation Plinth & Apron

**bad**

- The foundation plinth is finished with natural stone cladding installed on a cement-sand mortar bed. The perimeter apron is also constructed of natural stone laid on a cement mortar base
- On the north side of the house, no perimeter apron is present; the ceramic tile finish of the patio abuts the foundation plinth directly. On the south side, a natural stone perimeter apron has been constructed on a cement mortar base

### Other architectural elements

not  
present

- No other major exterior elements requiring inspection were identified.



# Structural integrity, exterior: Estimated Repair Cost

**~ €0**

## Critical

- none

**~ €5 000**

## Important

- Reconstruction of the underlying base and restoration of the perimeter apron

## Other

- Repair of a crack in the wall (north)





# Structural integrity, exterior. Overview and defects

## Foundation Plinth & Apron. Overview

North

South





other photos



[www.housedoctor.es/cid=janwjdkj&chid=01](http://www.housedoctor.es/cid=janwjdkj&chid=01)

East

West



other photos





[www.housedoctor.es/cid=janwjdkj&chid=01](http://www.housedoctor.es/cid=janwjdkj&chid=01)

## Foundation Plinth & Apron. Defects

Cracks and missing sections

Cracks and missing sections

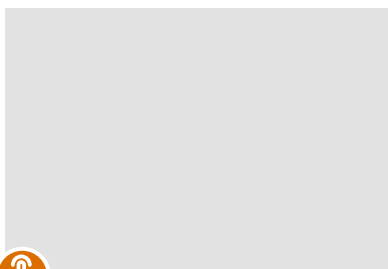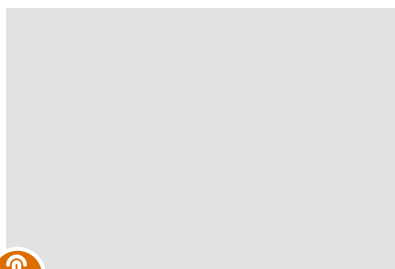

other photos



[www.housedoctor.es/cid=janwjdkj&chid=01](http://www.housedoctor.es/cid=janwjdkj&chid=01)



important



important

## Comments

- The foundation plinth is finished with natural stone cladding installed on a cement-sand mortar bed. The perimeter apron is also constructed of natural stone laid on a cement mortar base
- Several sections of the perimeter apron exhibit cracking and settlement of the underlying base. In addition, localized separation between the perimeter apron and the foundation plinth was observed. These defects allow water to penetrate directly to the exterior face of the foundation, increasing the risk of moisture intrusion.

## Recommendations

- Reconstruction of the underlying base and restoration of the perimeter apron. Repairs should include reconstruction of the underlying base and restoration of the perimeter apron with the proper slope to ensure effective drainage



## Roof. Summary

### Overall condition



average

### Comments

- The roof has a complex four-level configuration, comprising three main roof levels over the house and an additional roof over the extension. Most of the roof is finished with clay roof tiles, while the section above the second-floor bedroom is a flat roof protected by a ballast layer of crushed stone
- The pitched roof is constructed using a traditional system consisting of timber roof framing, ceramic structural roof blocks, and a cement-sand screed, with the roof tiles bedded in cement mortar
- The flat roof has a similar structural system and is protected by a torch-applied waterproofing membrane beneath the ballast layer
- Several cracked roof tiles should be replaced, and the ballast layer on the flat roof should be replenished to maintain the effectiveness of the waterproofing and thermal insulation

### Element

### Condition

#### Roof covering



average

- Cracked roof tiles were observed on the pitched roof sections of the upper level and above the extension. Most of the damaged tiles are located over the house extension (the lower roof level), where they are readily accessible for replacement
- The ballast layer on the flat roof (approximately 15 m<sup>2</sup>) is insufficient and does not provide uniform coverage. There are also visible signs of deterioration of the waterproofing membrane.

#### Attic, roof framing

not  
inspected

- There is no access to the attic or concealed roof void, making a direct assessment of the timber roof framing extremely limited. However, the visible portions of the timber members and the regular, undistorted geometry of the roof indicate that the roof structure is likely to be in good condition.

#### Vapor and water proofing



average

#### Connections, flashings



good

- The roof-to-wall flashings and junctions are in good condition and provide effective resistance to water intrusion
- The gable ends of the roof overhangs are adequately protected.

#### Gutters and downspouts

not  
present

- No gutters and downspouts are installed

#### Other roof elements



good

- A television antenna is installed on the roof. The antenna guy wires are loose and should be re-tensioned.
- The chimney flue passes through a dedicated chimney tower that is structurally independent of the main roof. The exposed upper section of the chimney is constructed of brick masonry. The metal chimney cap (rain cap) is in good condition, and no evidence of water leakage was observed within the fireplace or chimney.



## Roof. Estimated repair cost

~ €0

### Critical

- HET

~ €5 000

### Important

- Replace cracked roof tiles
- Replenish the ballast layer and repair the waterproofing system on the flat roof

### Other

- The television antenna mast is inadequately secured. The guy wires have become loose, and the mast should be either repaired or removed.

# Roof. Overview and defects

## Roof covering. Overview

XXX



XXX




other photos




[www.housedoctor.es/cid=janwjdkj&chid=01](http://www.housedoctor.es/cid=janwjdkj&chid=01)

XXX



XXX




other photos



[www.housedoctor.es/cid=janwjdkj&chid=01](http://www.housedoctor.es/cid=janwjdkj&chid=01)


## Roof covering. Defects

XXX

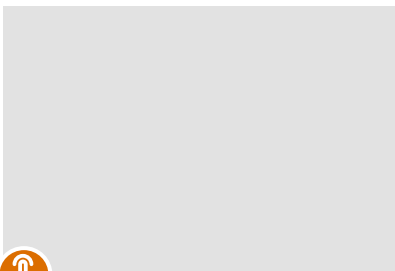

important

XXX

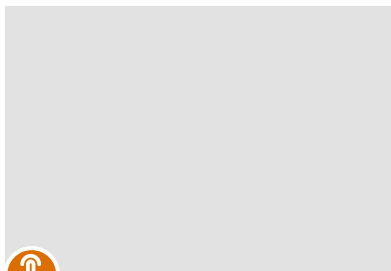

important

other photos



[www.housedoctor.es/cid=janwjdkj&chid=01](http://www.housedoctor.es/cid=janwjdkj&chid=01)

## Comments

- The roof over the house extension has a relatively shallow pitch. This section of the roof also receives rainwater runoff from the higher roof levels. During periods of heavy rainfall, water may penetrate beneath the roof tiles and reach the roof substrate, potentially resulting in water intrusion into the interior of the house.

## Recommendations

- Replace cracked tiles
- Check if further waterproofing is necessary on the part of the roof above house extension.