Cole Easdon

STAGE 2 ROAD SAFETY AUDIT

Proposed Roundabout Access, Thornhill Road, South Marston, Wiltshire on Behalf of Brookbanks Ltd

Date: August 2023
Issue No. 2

DOCUMENT ISSUE RECORD

Client: **Brookbanks Ltd**

Project: **Proposed Roundabout Access, Thornhill Road, South Marston, Swindon, Wiltshire**

Job Number: **9036**

Document Title: **Stage 2 Road Safety Audit**

Issue No.	1	2		
Date	August 2023	August 2023		
Description / Status	Formal issue	Designers response included.		
Prepared	C. Shakespeare BA (Hons) MCIHT	C.McArdle		
Technical Check	P. Salmon MCIHT MSoRSA	S. Murphy		
Authorised	J. B. Farmery MEng CEng MICE MCIHT ICE Health & Safety Registered	D. Swann		
Document Check				

The methodology adopted and the sources of information used by Cole Easdon Consultants Limited (CE) in providing its services are outlined within this Report. Any information provided by third parties and referred to herein has not been checked or verified by CE, unless otherwise expressly stated within this Report. This Report was checked and approved on the date shown in the Document Issue Record and the Report (including its base information, adopted parameters and assessment methodology) is therefore valid on this date. Circumstances, regulations, assessment methodology and professional standards do change which could subsequently affect the validity of this Report.

All intellectual property rights in or arising out of or in connection with this Report are owned by CE. The Report has been prepared for the Client named on the Document Issue Record who has a licence to copy and use this Report only for the purposes for which it was prepared and provided. The licence to use and copy this Report is subject to other Terms & Conditions agreed between CE and the Client. This document cannot be assigned or transferred to any third party and no third party may rely upon this document nor shall CE have any liability to any third party for the contents of this Report without the express written agreement of both CE and the Client.

CONTENTS

SECTION	HEADING	PAGE NO.
1.0	INTRODUCTION	1
2.0	AUDIT BRIEF	3
3.0	VEHICULAR & HIGHWAY ASPECTS OF DESIGN	5
4.0	STREET LIGHTING	10
5.0	ROAD MARKINGS & SIGNAGE	11
6.0	SURFACE WATER DRAINAGE	14
7.0	EMERGENCY ACCESS	15
8.0	AUDIT STATEMENT	16
9.0	DESIGNER'S, ADOPTING AUTHORITY & AUDITOR'S RESPONSES TO STAGE 2 ROAD SAFETY AUDIT	17

APPENDICES

Appendix 1 – Audit Reference Plan

1.0 INTRODUCTION

1.1 This *Stage 2 Road Safety Audit* has been prepared by Cole Easdon Consultants Limited (CE) on behalf of Brookbanks Ltd.

Scope of Study

1.2 This *Stage 2 Road Safety Audit* Report identifies safety concerns and recommendations with respect to the proposed roundabout access to be constructed on Thornhill Road, South Marston, Swindon, Wiltshire as part of the Swindon EDA development. The *Stage 2 Road Safety Audit* has been carried out independently by Paul Salmon (Audit Team Leader) and Caroline Shakespeare (Audit Team Member) both of Cole Easdon Consultants. The Audit Team has had no involvement in the design of the scheme being audited or discussed any safety concerns raised in the Report with members of the Design Team.

Audit Site Visit and Plan Examination

1.3 A site visit was undertaken by the Audit Team on Friday 28th July 2023 at 16.30. Weather conditions were bright and dry. The road surface was dry. Traffic flows were low. There were limited pedestrian and cyclist movements observed, but no equestrian movements. The Audit also comprised an examination of the following documents provided by Brookbanks:

- 1335/HL/56/100 K General Arrangement
- 1335/HL/56/121 A General Arrangement with Priory Lodge Improvements
- 1335/HL/56/102 G Finishes Plan
- 1335/HL/56/103 J Vehicle Tracking
- 1335/HL/56/800 G String Line Plan
- 1335/HL/56/1200 H Traffic Signs and Road Markings
- 1335/HL/56/1300 F Proposed Lighting Layout

1.4 This Report comments only on issues raised in carrying out the *Stage 2 Road Safety Audit*. The Auditors have examined and reported only on the road safety implications of the scheme arising from the site visit and review of the drawings referred to above. The Auditors have not examined or verified the compliance of the design with any other criteria.

1.5 Personal injury accident data has not been provided for consideration within this Audit. A review of the Crashmap.co.uk website indicates no accidents have been reported within the area to be audited in the most recent five-year period.

1.6 Copies of all Road Safety Audits must be retained. All comments and recommendations must be investigated, subsequent decisions/actions must be logged, and a formal record kept of all responses.

1.7 It is the Project Sponsor's responsibility to advise the Audit Team Leader if any Problem / Recommendation is not accepted. The Project Sponsor should then supply a copy of each signed Exception Report to the Audit Team Leader, for information.

1.8 The terms of reference of the Audit are based on *Guidelines for the Safety Audit of Highway Schemes* published by the Institution of Highways and Transportation, other guidance references are the *Traffic Signs Regulations and General Directions 2016*, and *GG 119 – Road Safety Audit from the Design Manual for Roads & Bridges*.

2.0 AUDIT BRIEF

2.1 The Audit Team were provided with an audit brief. This has not been approved by the overseeing local authority.

2.2 The Road Safety Audit is to consider the Section 278 works including the provision of new site access for the New Eastern Villages site in Swindon. The access will be via a 3-arm roundabout.

2.3 Swindon Borough are the Overseeing Organisation.

2.4 The scheme proposes a roundabout access to the site. The works will include provision of a SuDS basin and associated ancillary works.

2.5 The Audit Team has been informed that the scheme has been fully designed in accordance with the *Design Manual for Roads and Bridges* (*DMRB*), specifically *CD109* and *CD123* of the *DMRB*.

2.6 The current Thornhill Road is unrestricted. However, speeds are noted by the designer to be below 60mph along this stretch of road and a 40mph design speed has been assumed. The designer indicates that vehicle speeds will be confirmed with a speed survey. Details of a speed survey have not been supplied to the Audit Team.

2.7 Swindon Borough Council are reported to support a Traffic Regulation Order to reduce the Thornhill Road to 30mph, however, as the outcome cannot be guaranteed, this audit is to be carried out on the existing derestricted speed limit.

2.8 A *Transport Assessment* (*TA*) was produced to support the planning application. This provides an indication of the traffic levels and provides documentary evidence that the highway enhancements operate within capacity thresholds and that the upstream / downstream queuing will not interfere with adjacent junctions.

2.9 The *TA* identified existing travel patterns including identification of existing Public Rights of Way.

Departures from Standards

2.10 The Designer has noted the following departures from Standards resultant from existing site constraints:

- Forward visibility is designed on a 40mph speed limit is one step below desirable minimum
- Existing Access to Priory Lodge has visibility below standard.
- Existing junction to Morses Lane has visibility below standard.

3.0 VEHICULAR & HIGHWAY ASPECTS OF DESIGN

Safety Concern

3.1 Location: Proposed roundabout junction

Summary: Risk of collision

The roundabout is proposed on Thornhill Road within a section of highway that is subject to the national speed limit. Forward visibility splays have been shown on the visibility plan provided to the Audit Team. The visibility splay dimensions shown are not consistent and are below the standard for a 40mph design speed. As mentioned in section 2 above, the section of Thornhill Road considered as part of this audit is currently subject to national speed / 60mph. Collisions may occur should vehicles travel along the carriageway without adequate forward visibility of the proposed roundabout.

Recommendation

3.1.1 Ensure appropriate visibility splays are proposed at the roundabout junction for the prevailing speed of approaching vehicles.

Safety Concern

3.2 Location: Proposed junction

Summary: Risk of loss of control collisions

Swept path analysis showing various vehicles travelling through the proposed roundabout has been provided to the Audit Team. The swept path of the articulated vehicle shows that it will mount the kerb at various locations, colliding with proposed bollards and highway signage.

Recommendation

3.2.1 Redesign the junction to ensure all vehicles using this junction can do so without striking / over-running the kerbs / colliding with adjacent street furniture.

Safety Concern

3.3 Location: Proposed pedestrian crossing point at southern splitter of roundabout

Summary: Risk of slip / trip hazard

A pedestrian crossing point is proposed across the southern splitter island of the proposed roundabout. There is an existing shared footway / cycleway / bridleway to the west of Thornhill Road at this location. There does not appear to be a connection between the proposed crossing point and the existing route. The area between the crossing is currently grass verge with a level difference between the shared route and the existing road. Pedestrians wishing to cross Thornhill Road from the New Eastern Villages (NEV) development may have difficulty

negotiating the grass verge, particularly wheel chair users and push chair users. Inclement weather will increase the difficulty for users at this location.

Recommendation

3.3.1 Provide a surfaced connection between the proposed crossing point and the existing shared route. Ensure the gradient is suitable for pedestrian traffic.

Safety Concern

3.4 Location: Proposed pedestrian crossing point at southern splitter of roundabout

Summary: Risk of collision

A pedestrian crossing point is proposed across the southern splitter island of the proposed roundabout. As mentioned in Safety Concern 3.3 above, there does not appear to be a connection detailed between the proposed crossing point and the existing route. On the assumption a connection is to be provided, there is no warning tactile paving detailed to inform visually impaired pedestrians that they are joining a shared route and to be mindful of cyclists and horses.

Recommendation

3.4.1 Provide warning tactile paving at the junction of the pedestrian route with the shared use route.

Safety Concern

3.5 Location: Proposed pedestrian crossing point at southern splitter of roundabout

Summary: Risk of collision

A pedestrian crossing point is proposed across the southern splitter island of the proposed roundabout. As mentioned in Safety Concern 3.2 above, a shared footway / cycleway / bridleway currently lies to the west of the proposed roundabout. The facilities detailed to enable off-road travel between the shared route and the NEV development do not appear to cater for cyclists. Cyclists may however use this route rather than risk negotiating the roundabout and continue along Thornhill Road. During the site visit, all cyclists observed were using the off-road facilities rather than travelling along Thornhill Road. The footway and splitter island width are not sufficient for cycle use. Cycles may be struck when waiting on the splitter island due to insufficient available width.

Recommendation

3.5.1 Provide cycle facilities between the NEV development and the existing shared route.

Safety Concern

3.6 Location: Proposed pedestrian crossing point at southern splitter of roundabout

Summary: Risk of collision

A pedestrian crossing point is proposed across the southern splitter island of the proposed roundabout. Pedestrian visibility splays have not been detailed on the drawings provided to the Audit Team. Should a pedestrian step into the carriageway with insufficient warning of approaching vehicles they may be struck.

Recommendation

3.6.1 Ensure adequate pedestrian visibility splays are provided at the crossing point.

Safety Concern

3.7 Location: Proposed pedestrian crossing point at southern splitter of roundabout

Summary: Risk of pedestrian injury

A pedestrian crossing point is proposed across the southern splitter island of the proposed roundabout. The proposed refuge width would appear to be 1.5-1.6m in width. This is below the current preferred width for pedestrian refuges. Given the safety concern raised in paragraph 3.1 above, pedestrians may be struck by passing vehicles while waiting in this refuge.

Recommendation

3.7.1 Provide additional width at the pedestrian refuge island.

Safety Concern

3.8 Location: Proposed roundabout

Summary: Risk of collision

No entry path curvature details for the various arms of the proposed roundabout have been provided to the Audit Team. The south-to-north movement does not appear to have much deflection despite the 'step' in carriageway alignment that has been shown. Vehicles approaching the roundabout may be encouraged to do so at an excessive speed and not slow down / react accordingly to traffic within the roundabout, colliding with said traffic; or kerbs / street furniture in an attempt to avoid vehicle-to-vehicle collision.

Recommendation

3.8.1 Ensure adequate deflection is provided at all approaches to the roundabout to ensure appropriate vehicle speed is attained through the junction.

Safety Concern

3.9 Location: Proposed Junction – Southern arm

Summary: Risk of collision

The proposed roundabout is to be located to the north of an existing residential property. This property has a vehicle access that will be located some 10-15m to the south of this proposed roundabout. Due to the location and alignment of the roundabout, coupled with vegetative growth in both the public highway and the residential property, vehicles egressing the residential property may not have sufficient visibility to approaching traffic; particularly traffic approaching from the NEV development that may be travelling faster than traffic from the north due to the entry path curvature of the eastern arm of the roundabout. Collisions may occur should vehicles enter the carriageway without adequate visibility of approaching vehicles.

Recommendation

3.9.1 Ensure suitable visibility is available to vehicles entering and leaving the residential property adjacent to the proposed roundabout. Visibility splays from this location have been detailed on drawing '*1335/HL/56/121 A General Arrangement with Priory Lodge Improvements'* however, the splays have not been detailed to the tangent of the roundabout which leaves a gap, albeit small, for approaching traffic to approach unsighted.

Safety Concern

3.10 Location: Proposed roundabout

Summary: Risk of collision

As mentioned in Safety Concern 3.8 above, no entry path curvature details for the various arms of the proposed roundabout have been provided to the Audit Team. The east-to-south movement appears to have an overly generous radius. Vehicles travelling through the roundabout in this direction may do so at high speed. This higher approach speed may exacerbate the issue raised in Safety Concern 3.9 above.

Recommendation

3.10.1 Ensure adequate deflection is provided at all approaches to the roundabout to ensure appropriate vehicle speed is attained through the junction.

Safety Concern

3.11 Location: Proposed maintenance bay

Summary: Risk of collision

A maintenance bay had been detailed on the north side of the roundabout between the northern and eastern arms. Maintenance vehicles will typically not have rear windows for drivers to see through. As such, drivers leaving this bay in the orientation shown may not have adequate visibility of approaching vehicles, particularly those approaching from the north. Maintenance vehicles may enter into the path of circulating vehicles, resulting in a collision.

Recommendation

3.11.1 Reconfigure the maintenance bay to allow maintenance vehicles to enter and turn around to be perpendicular to the kerb line.

Commentary

3.12 It has been mentioned in the audit brief that 'Morses Lane has visibility below standard' as has the crossing point for the bridleway opposite this junction. Whilst this junction is outside the scope of the works, consideration could be given to undertaking clearance of the vegetation at these locations as part of the scheme to improve the visibility deficiencies.

4.0 STREET LIGHTING

Safety Concern

4.1 Location: Proposed roundabout

Summary: Risk of collision

A proposed lighting plan has been provided to the Audit Team indicating the location of a number of proposed street lighting columns. This plan details lighting columns to be located within the existing vegetation. This vegetation may obscure the light spread of the columns, reducing their effectiveness, posing as a risk that drivers may have insufficient illumination of the roundabout junction. The positioning of the columns may also cause issues with access to the columns for maintenance.

Recommendation

4.1.1 Ensure the lighting column locations are cleared of sufficient vegetation to ensure they are not obstructed and can be accessed for maintenance purposes.

Safety Concern

4.2 Location: Proposed roundabout

Summary: Risk of collision

A proposed lighting plan has been provided to the Audit Team, as well as a traffic signs and road markings plan. Lighting for the proposed signs has not been indicated on either of these plans. The effectiveness of all proposed signs may be reduced due to the relative locations of the proposed street light columns.

Recommendation

4.2.1 Review the relative locations of all proposed signage to the proposed street lighting columns, adding lighting to the proposed signs where necessary.

5.0 ROAD MARKINGS & SIGNAGE

Safety Concern

5.1 Location: Approach lanes / Circulatory carriageway of roundabout

Summary: Risk of side swipe

The approach lanes to the roundabout appear to be intended as single lane, however, the entry widths are sufficient for two cars. There may be differing opinions of approaching drivers where some may treat it as single entry and others may feel it is wide enough for two; with the drivers believing it is single lane entry taking a straighter "driver's line" through the roundabout potentially colliding with vehicles that believe there is room for two.

Recommendation

5.1.1 If it is the designer's intention that the roundabout entry points are single lane, provide hatching adjacent to the splitter islands to indicate single lane entry. If they are intended as two lane approaches, add alternative appropriate carriageway markings.

Safety Concern

5.2 Location: Proposed pedestrian crossing point at southern splitter of roundabout

Summary: Risk of collision

A pedestrian crossing point is proposed across the southern splitter island of the proposed roundabout. As mentioned in Safety Concern 3.3 above, there does not appear to be a connection detailed between the proposed crossing point and the existing shared route on the western side of Thornhill Road. On the assumption that a connection is to be provided, there is no signage detailed to inform pedestrians that they are joining a shared route and to be mindful of cyclists and horses.

Recommendation

5.2.1 Provide signage at the junction of the pedestrian route with the shared use route.

Safety Concern

5.3 Location: Thornhill Road

Summary: Risk of collision

Thornhill Road currently has intermittent kerb lines in the vicinity of the proposed roundabout and as such, edge of carriageway road markings are in place to assist drivers travelling along this road. It is unclear from the drawings provided to the Audit Team if kerbing is to be installed at the outer edges of the proposed roundabout. Drivers may have difficulty negotiating this stretch of road and proposed junction during periods of inclement weather / low levels of light (e.g. fog) without the reflective road markings.

Recommendation

5.3.1 Provide edge of carriageway markings where appropriate to tie in with the existing road markings.

Commentary

5.4 The signage that has been detailed at the roundabout entry points is the arrangement for a mini-roundabout, not a standard or compact roundabout.

Safety Concern

5.5 Location: Proposed footway

Summary: Risk of obstruction

Signage has been detailed to be provided at the immediate approaches to the roundabout. One of these signs is detailed to be located within the proposed footway. No dimensions have been detailed of the sign's location, but given the required set back required for signage from the edge of the carriageway, it is likely that the sign post may become an obstruction to pedestrian traffic at this location; particularly push chair and wheel chair users.

Recommendation

5.5.1 Ensure the proposed signage is not located such that it causes an obstruction to road / footway users.

Safety Concern

5.6 Location: Proposed roundabout

Summary: Risk of collision

Signage has not been detailed on the roundabout to indicate a sharp deviation of route (Diag 515 or similar) or to keep left (Diag 610). Drivers approaching the roundabout from all arms may be unaware that they might find it difficult to negotiate the entry to the roundabout without slowing down as the severity of which cannot easily be seen either by day or by night.

Recommendation

5.6.1 Provide sharp deviation of route & directional arrows for all entries to the roundabout.

Safety Concern

5.7 Location: Proposed roundabout

Summary: Risk of collision

No details of the proposed speed limit through the NEV development have been provided to the Audit Team. No change of speed limit signage has been detailed on the drawings provided

to the Audit Team. Drivers entering the NEV development from Thornhill Road may continue to do so at the current 60mph speed limit.

Recommendation

5.7.1 Provide change of speed limit signage on the Thornhill Road approaches to the roundabout to suit the speed limit for the NEV development as is Swindon Borough Council policy.

Commentary

5.8 No advance directional signage has been provided for consideration as part of this audit.

6.0 SURFACE WATER DRAINAGE

Commentary

6.1 A contour plan has been provided to the Audit Team, however no gully positions are shown on the plan to check the gullies are suitably located to avoid potential ponding issues. It would appear that gully positions are indicated on the Finishes Plan, but these are not shown within the key to confirm they are gullies. The Local Highway Authority should satisfy themselves that the proposed drainage scheme is adequate.

7.0 EMERGENCY ACCESS

Commentary

7.1 Emergency vehicle access would appear to be adequate, however, no swept path analysis of emergency vehicle manoeuvres has been provided to the Audit Team to demonstrate this.

8.0 AUDIT STATEMENT

8.1 We certify that the drawings and other items listed have been examined with the objective of identifying any features of the design at the *Stage 2 Road Safety Audit* stage that could be removed or modified in order to improve the safety of the scheme. Issues identified have been noted in this Report together with any associated safety suggestions; these are recommended for consideration and implementation. Prior to the request to carry out this Audit, we have not been involved in the detailed design of this scheme.

Cole Easdon Consultants Limited
August 2023

9.0 DESIGNER'S & AUDITOR'S RESPONSE TO STAGE 2 ROAD SAFETY AUDIT

9.1 The issues categorised in this road safety audit as a 'Safety Concern' are those causing serious concern and are summarised below. The purpose of this Section is for the scheme Designer or Overseeing Organisation to respond to the 'Safety Concerns'. Responses should be returned to Cole Easdon Consultants Limited. 'Commentary' points in this Report are made for the benefit of the Designer and are not referred to below.

Stage 2 Road Safety Audit - Designer's Road Safety Audit Response:

Safety Concern Reference No	Summary of Road Safety Concern	Designer's Response
3.1	Forward visibility	Speed surveys have been taken along Thornhill Rd showing 85th percentile speeds to be below 40mph in both directions (circa 36mph). The forward visibility chosen for the design reflects this measured speed to ensure that the design is in keeping with the actual speed of the road. If the visibility splays are increased to those appropriate for 60mph it is considered that this would only encourage higher entry and exit speeds from the roundabout into a wider network that does not support those speeds.
3.2	Vehicles over-riding kerbs	It is not anticipated that a sizeable articulated HGV would have need to enter the roundabout from the north and enter the site. South Martson Village is already restricted to 7.5t limit apart from access. In addition along Old Vicarage Road from the other direction through the development HGV access would be restricted by both the bridge under the railway and the South Marston restriction to through traffic above 7.5t. For the very rare occasion a HGV may make this manoeuvre, signs and street furniture have been moved back to avoid damage, with the track being updated to show this.
3.3	No pedestrian connection between roundabout and existing path	The designer acknowledges that the current design shows a pedestrian crossing to what is a hedge and verge between it and the western footway on Thornhill Road. However the verge on which the hedge line is located is neither in the applicants or the highway authorities control and therefore the design as shown cannot complete the connection to the western footway in this submission. The Connection has been required by the Highway Authority who will seek to use their powers in the future to complete the connection.

3.4	No warning tactile paving between footpath and shared space route	As above
3.5	No cycle connection between existing shared route and proposed development site	As above
3.6	Pedestrian visibility splays not detailed	Pedestrian visibility splays have been added to visibility plan.
3.7	Narrow pedestrian refuge island	The roundabout design has been restricted through land ownership constraints The splitter island cannot be amended as the deflection and entry lanes of the roundabout will not be sufficient. We acknowledge it is below standard, but the crossing has been added on SBC request as discussed above.
3.8	Entry path curvature from south to north	Agreed - Roundabout geometry drawing and DMRB schedule to be shared.
3.9	Visibility from Priory Lodge	Visibility splay shown was to show a realistic visibility, but plan to be updated to tangent of roundabout.
3.10	Entry path curvature from east to south	Agreed - Roundabout geometry drawing and DMRB schedule to be shared.
3.11	Maintenance bay location	Vehicles used for maintenance will have full visibility to be able to see oncoming traffic and should have no issues with pulling off from the maintenance bay safely. A larger bay area could encourage pedestrian parking in the bay.
4.1	Obstructed lighting columns	Agree – Sight clearance to ensure lighting visibility unobstructed.
4.2	No signage lighting shown	Agree – Signs will not be located where they may be impacted by lighting columns.
5.1	Lane widths on approach	Whilst the entry lane could be narrowed with hatching, entry lane width of 4.5m is typical for single lane entries as per 3.14.1. of CD 116.
5.2	Signage at footpath entry to shared route	See response to 3.3.
5.3	Edge of carriageway treatment	Edge of carriageway lines not recommended on approach to a junction as per TSRGD 2016 Dia. 1012.1. HB2 kerbs are proposed at the edge of the roundabout where possible to guide drivers and make them aware of the edge of carriageway. Lighting has also been suitably designed to ensure the roundabout is sufficiently lit at all times.
5.5	Sign obstructing footway	Agree – Sign to be relocated.
5.6	No sharp deviation signage	Agree – Signs added to roundabout drawings.

5.7	Speed limit signage	Agree – Roundels are shown on SMPS S38 drawings just beyond S278 boundary line, so the change of speed limit is evidenced just not in this pack of drawings.

Adopting Authority Response:

Safety Concern Reference No.	Adopting Authority Response
3.1	
3.2	
3.3	
3.4	
3.5	
3.6	
3.7	
3.8	
3.9	
3.10	

Safety Concern Reference No.	Adopting Authority Response
3.11	
4.1	
4.2	
5.1	
5.2	
5.3	
5.5	
5.6	
5.7	

Audit Team Response (If required):

Safety Concern Reference No.	Audit Team Response
3.1	
3.2	
3.3	
3.4	
3.5	
3.6	
3.7	
3.8	
3.9	
3.10	
3.11	

Safety Concern Reference No.	Audit Team Response
4.1	
4.2	
5.1	
5.2	
5.3	
5.5	
5.6	
5.7	

Appendix 1

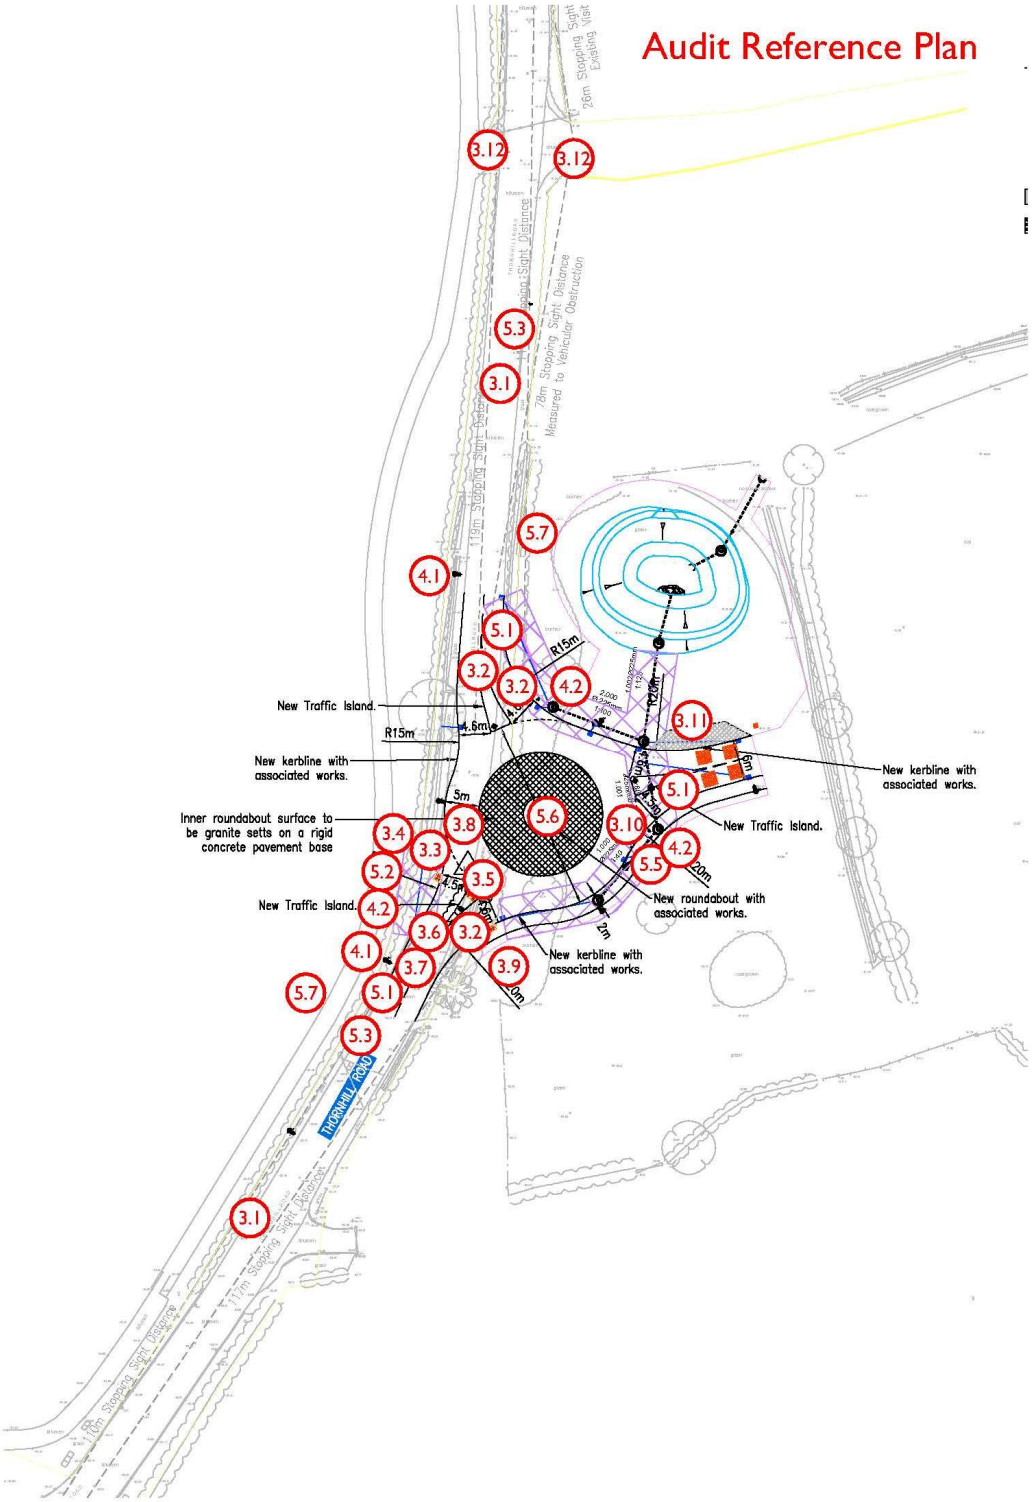
Audit Reference Plan
New Traffic Island.
New kerbline with associated works.
Inner roundabout surface to be granite setts on a rigid concrete pavement base
New Traffic Island.
New roundabout with associated works.
New kerbline with associated works.
New kerbline with associated works.
New Traffic Island.
THORNHILL ROAD
3.12
3.12
5.3
3.1
5.7
4.1
5.1
3.2
3.2
4.2
3.11
5.1
5.6
3.10
4.2
5.5
3.4
3.8
3.3
5.2
3.5
4.2
3.6
3.2
4.1
3.7
5.1
3.9
5.7
5.3
3.1
R15m
R20m
R15m
4.6m
5m
1.5m
2m
20m
10m