FireCheck®

Initial Annual Fire & Smoke Door Inspection

Albuquerque Indian Health Service
Albuquerque Indian Health
801 Vassar Dr Ne
Albuquerque, NM 87106

Inspection No.: SLS384140
Code Edition: NFPA 80 - 2010 for Healthcare

Inspection Initiated: August 28 2025

DHPACE®
COMPLIANCE SERVICES
Inspections • Labeling • Training • Consulting

If the report indicates that deficiencies were found (and were not repaired on-site), please refer to corresponding proposal.
This comprehensive FireCheck® inspection report is based on NFPA 80 (fire) and NFPA 105 (smoke) requirements. This report applies only to door list provided by the Customer.


Code Interpretation Disclaimer: All information provided by DH Pace Inc. represents our interpretation regarding the intent of the standard(s) and/or code(s) applicable to the issue being addressed. By law, the Authority Having Jurisdiction (AHJ) is the only entity with the legal standing and discretionary authority to make a definitive ruling on these matters. As such, DH Pace disclaims any consequential damages that may arise from the use of the information provided, recommendation made, or opinions expressed on this matter.

This document was developed by and is the Exclusive property of DH Pace Company, Inc. Any unauthorized use, reproduction or duplication, in whole or in part, is expressly prohibited. © 2022 DH Pace Company, Inc.

Initial Annual Fire & Smoke Door Inspection Summary

Name	Albuquerque Indian Health	**Contact**	Patricio, Patrick
Address	801 Vassar Dr Ne	**Contact #**	(505) 290-0260
City, State Zip	Albuquerque, NM 87106	**Inspection Date**	8/28/2025

P/F	Initial	Repaired	Post Repair
Pass	0	0	0
Fail	19	0	19
Total	19	0	

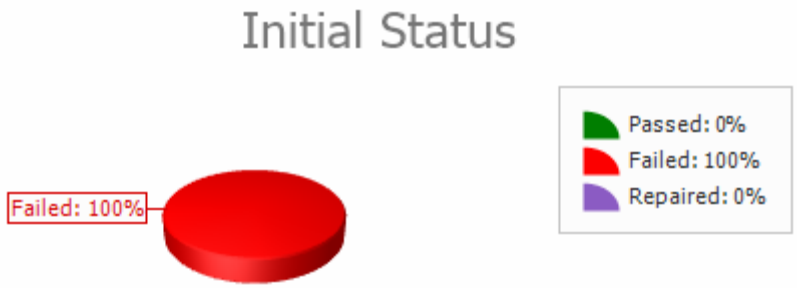


Priority of Failed Openings	Opening #
Critical	15
Immediate	4
Total Failed	**19**

Priority Definitions

Critical - Deficiency requires urgent corrective action without delay

Immediate - Deficiency requires corrective action without delay

Essential - Deficiency requires corrective action, safety concern

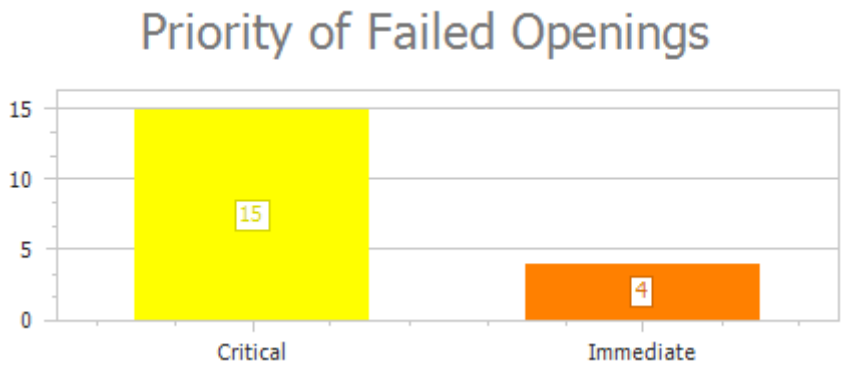

Owner to remove excess signage.
Owner to verify rating of protection plates, electric strikes, power transfer cords, presence sensors, door position/alarm sensors, steel pick guards, door/frame guards, gasketing/perimeter seal, door viewers, and auto door bottoms/sweeps.

Name: Faron Shetter Jr - DSI Signature: Date: **9/05/2025**

Faron Shetter Jr
Main: (505) 221-9025
Email: Faron.ShetterJr@dhpace.com

DH Pace Compliance Services
5656 Pasadena Avenue N.E.
Albuquerque, NM 87113
(505) 344-3667

This document was developed by and is the Exclusive property of DH Pace Company, Inc. Any unauthorized use, reproduction or duplication, in whole or in part, is expressly prohibited. © 2022 DH Pace Company, Inc.

Initial Annual Fire & Smoke Door Inspection Criteria

Name	Albuquerque Indian Health	**Code Edition:**	
Address	801 Vassar Dr Ne Albuquerque, NM 87106	NFPA 80 - 2010 for Healthcare	
Inspection Date	8/28/2025	**Inspection No.**	SLS384140

Criteria	Components	Description	# Failed Openings
FC1	Frame, Door	No open holes or breaks exist in surfaces of either the door or frame.	**4**
FC2	Frame, Door	Glazing, vision light frames, and glazing beads are intact and securely fastened in place, if so equipped. Safety glass is the correct size and type.	**0**
FC3	Frame, Door, Hardware	The door, frame, hinges, hardware and non-combustible threshold are secured, aligned, and in working order with no signs of visible damage.	**0**
FC4	Frame, Door, Hardware	No parts are missing or broken.	**1**
FC5	Top, Bottom, Hinge Edge, Strike Edge	Door clearances do not exceed clearances listed in 4.8.4 and 6.3.1.7. WOOD/PLAM EDGES/TOP not > 1/8", WOOD/PLAM BOTTOM not > 3/4", HM-STEEL EDGES/TOP 1/8" + or - 1/16", HM-STEEL BOTTOM not > 3/4"	**14**
FC6	Hardware	The self-closing device is operational, that is, the active door completely closes when operated from the full open position.	**4**
FC7	Hardware	If a coordinator is installed, the inactive leaf closes before the active leaf.	**0**
FC8	Hardware	Where latching hardware is required, it operates and secures the door when it is in the closed position (not required for cross-corridor doors 1-hr Smoke Barriers in Healthcare deemed "Substantial Doors" and not 20-min rated/labeled)	**0**
FC9	Hardware	Auxiliary items that interfere or prohibit operation are not installed on the door or frame.	**0**
FC10	Frame, Door, Hardware	No field modifications to the door assembly have been performed to void the label.	**0**
FC11	Frame, Door	Gasketing and edge seals, where required, are inspected to verify their presence and integrity.	**0**
FC12	Size, Mounting	Signage is the correct size and mounted properly.	**1**
FC13.D	Door	Labels are present and readily visible on the opening door.	**5**
FC13.F	Frame	Labels are present and readily visible on the opening frame.	**14**
FC13.G	Glass	Labels are present and readily visible on the opening glass.	**0**
FC13.H	Hardware	Labels are present and readily visible on the opening hardware.	**14**
FC13.P	Protection Plate	Labels are present and readily visible on the protection plate (when plate is mounted above 16" from bottom of door)	**0**
FC14	Hardware	Doors installed in pressurized applications have gasketing and a bottom seal (note deficient gasketing on FC11)	**0**
FC15	Hardware	No louvers or transfer grills in door (when door is in combo fire and smoke barrier or just smoke barrier)	**1**

Door Type

S - Single UP - Unequal Pair P - Pair DE - Double Egress B - Bank D - Dutch

This document was developed by and is the Exclusive property of DH Pace Company, Inc. Any unauthorized use, reproduction or duplication, in whole or in part, is expressly prohibited. © 2022 DH Pace Company, Inc.

Initial Annual Fire & Smoke Door Inspection Details

Name Albuquerque Indian Health
Address 801 Vassar Dr Ne Albuquerque, NM 87106
Inspection Date 8/28/2025 **Project #** 384633 **Inspection No.** SLS384140

Building: MAIN
Floor: 01

Opening Door Type	Barcode Door Material	P/F Door Size	Area Frame Material	Inspector Barrier Type	Date Priority
0001	278-415176-001-0001	Failed	MECHANICAL	Shawn Boxer	8/28/2025
Single	Wood	36" x 80"	Hollow Metal Not Filled	1-Hour Smoke Barrier	Immediate

Leaf	Fire Rating	Smoke Label	Failed Fire Criteria
Leaf A	60 mins	N/A	FC5, FC15

0002	278-415176-001-0002	Failed	STAIR	Shawn Boxer	8/28/2025
Single	Hollow Metal	48" x 84"	Hollow Metal Filled	2-Hour Fire Barrier	Critical

Leaf	Fire Rating	Smoke Label	Failed Fire Criteria
Leaf A	90 mins	N/A	FC5, FC13.F, FC13.H

0004	278-415176-001-0004	Failed	STAIR	Shawn Boxer	8/28/2025
Single	Hollow Metal	48" x 84"	Hollow Metal Filled	2-Hour Fire Barrier	Critical

Leaf	Fire Rating	Smoke Label	Failed Fire Criteria
Leaf A	90 mins	N/A	FC5, FC13.F, FC13.H

0005	278-415176-001-0005	Failed	MECHANICAL	Shawn Boxer	8/28/2025
Single	Hollow Metal	36" x 80"	Hollow Metal Filled	1-Hour Smoke Barrier	Critical

Leaf	Fire Rating	Smoke Label	Failed Fire Criteria
Leaf A	90 mins	N/A	FC6

0006	278-415176-001-0006	Failed	MECHANICAL	Shawn Boxer	8/28/2025
Single	Hollow Metal	36" x 80"	Hollow Metal Not Filled	1-Hour Smoke Barrier	Immediate

Leaf	Fire Rating	Smoke Label	Failed Fire Criteria
Leaf A	180 mins	N/A	FC1, FC4

Floor: 02

Opening Door Type	Barcode Door Material	P/F Door Size	Area Frame Material	Inspector Barrier Type	Date Priority
0007	278-415176-001-0007	Failed	STAIR	Shawn Boxer	8/28/2025
Single	Hollow Metal	48" x 84"	Hollow Metal Filled	2-Hour Fire Barrier	Critical

Leaf	Fire Rating	Smoke Label	Failed Fire Criteria
Leaf A	90 mins	N/A	FC1, FC5, FC13.F, FC13.H

0008	278-415176-001-0008	Failed	STAIR	Shawn Boxer	8/28/2025
Single	Hollow Metal	48" x 84"	Hollow Metal Filled	2-Hour Fire Barrier	Critical

Leaf	Fire Rating	Smoke Label	Failed Fire Criteria
Leaf A	90 mins	N/A	FC5, FC13.F, FC13.H

0009	278-415176-001-0009	Failed	MECHANICAL	Shawn Boxer	8/28/2025
Single	Wood	36" x 84"	Hollow Metal Not Filled	1-Hour Smoke Barrier	Immediate

Leaf	Fire Rating	Smoke Label	Failed Fire Criteria
Leaf A	N/A	N/A	FC5

0010	278-415176-001-0010	Failed	STAIR	Shawn Boxer	8/28/2025
Single	Hollow Metal	36" x 84"	Hollow Metal Not Filled	1-Hour Fire Barrier	Critical

Leaf	Fire Rating	Smoke Label	Failed Fire Criteria
Leaf A	N/A	N/A	FC13.D, FC13.F, FC13.H

This document was developed by and is the Exclusive property of DH Pace Company, Inc. Any unauthorized use, reproduction or duplication, in whole or in part, is expressly prohibited. © 2022 DH Pace Company, Inc.

Initial Annual Fire & Smoke Door Inspection Details

Name Albuquerque Indian Health
Address 801 Vassar Dr Ne Albuquerque, NM 87106
Inspection Date 8/28/2025 **Project #** 384633 **Inspection No.** SLS384140

Building: MAIN
Floor: 02

Opening Door Type	Barcode Door Material	P/F Door Size	Area Frame Material	Inspector Barrier Type	Date Priority
0011	278-415176-001-0011	Failed	STAIR	Shawn Boxer	8/28/2025
Single	Hollow Metal	36" x 84"	Hollow Metal Not Filled	1-Hour Fire Barrier	Critical

Leaf	Fire Rating	Smoke Label	Failed Fire Criteria
Leaf A	N/A	N/A	FC1, FC5, FC13.D, FC13.F, FC13.H

Floor: 03

Opening Door Type	Barcode Door Material	P/F Door Size	Area Frame Material	Inspector Barrier Type	Date Priority
0012	278-415176-001-0012	Failed	STAIR	Shawn Boxer	8/28/2025
Single	Hollow Metal	48" x 84"	Hollow Metal Filled	2-Hour Fire Barrier	Critical

Leaf	Fire Rating	Smoke Label	Failed Fire Criteria
Leaf A	90 mins	N/A	FC5, FC13.F, FC13.H

0014	278-415176-001-0014	Failed	STAIR	Shawn Boxer	8/28/2025
Single	Hollow Metal	48" x 84"	Hollow Metal Filled	2-Hour Fire Barrier	Critical

Leaf	Fire Rating	Smoke Label	Failed Fire Criteria
Leaf A	90 mins	N/A	FC5, FC13.F, FC13.H

0015	278-415176-001-0015	Failed	STAIR	Shawn Boxer	8/28/2025
Single	Hollow Metal	46" (3'10") x 84"	Hollow Metal Filled	2-Hour Fire Barrier	Immediate

Leaf	Fire Rating	Smoke Label	Failed Fire Criteria
Leaf A	90 mins	N/A	FC5, FC13.H

Floor: 04

Opening Door Type	Barcode Door Material	P/F Door Size	Area Frame Material	Inspector Barrier Type	Date Priority
0016	278-415176-001-0016	Failed	STAIR	Shawn Boxer	8/28/2025
Single	Hollow Metal	48" x 84"	Hollow Metal Filled	2-Hour Fire Barrier	Critical

Leaf	Fire Rating	Smoke Label	Failed Fire Criteria
Leaf A	90 mins	N/A	FC5, FC13.F, FC13.H

0017	278-415176-001-0017	Failed	STAIR	Shawn Boxer	8/28/2025
Single	Wood	28" x 84"	Hollow Metal Filled	1-Hour Fire Barrier	Critical

Leaf	Fire Rating	Smoke Label	Failed Fire Criteria
Leaf A	Label Missing	N/A	FC5, FC6, FC12, FC13.D, FC13.F

0018	278-415176-001-0018	Failed	STAIR	Shawn Boxer	8/28/2025
Single	Hollow Metal	48" x 84"	Hollow Metal Filled	2-Hour Fire Barrier	Critical

Leaf	Fire Rating	Smoke Label	Failed Fire Criteria
Leaf A	90 mins	N/A	FC5, FC13.F, FC13.H

0019	278-415176-001-0019	Failed	STAIR	Shawn Boxer	8/28/2025
Single	Hollow Metal	48" x 84"	Hollow Metal Filled	2-Hour Fire Barrier	Critical

Leaf	Fire Rating	Smoke Label	Failed Fire Criteria
Leaf A	90 mins	N/A	FC5, FC13.F, FC13.H

This document was developed by and is the Exclusive property of DH Pace Company, Inc. Any unauthorized use, reproduction or duplication, in whole or in part, is expressly prohibited. © 2022 DH Pace Company, Inc.

Initial Annual Fire & Smoke Door Inspection Details

Name Albuquerque Indian Health
Address 801 Vassar Dr Ne Albuquerque, NM 87106
Inspection Date 8/28/2025 **Project #** 384633 **Inspection No.** SLS384140

Building: MAIN
Floor: 05

Opening Door Type	Barcode Door Material	P/F Door Size	Area Frame Material	Inspector Barrier Type	Date Priority
0020	278-415176-001-0020	Failed	STORAGE	Shawn Boxer	8/28/2025
Single	Wood	36" x 84"	Hollow Metal Not Filled	2-Hour Fire Barrier	Critical

Leaf	Fire Rating	Smoke Label	Failed Fire Criteria
Leaf A	Label Missing	N/A	FC1, FC6, FC13.D, FC13.F, FC13.H

0021	278-415176-001-0021	Failed	MECHANICAL	Shawn Boxer	8/28/2025
Single	Wood	36" x 84"	Hollow Metal Not Filled	1-Hour Fire Barrier	Critical

Leaf	Fire Rating	Smoke Label	Failed Fire Criteria
Leaf A	Label Missing	N/A	FC6, FC13.D, FC13.F, FC13.H

This document was developed by and is the Exclusive property of DH Pace Company, Inc. Any unauthorized use, reproduction or duplication, in whole or in part, is expressly prohibited. © 2022 DH Pace Company, Inc.

Initial Annual Fire & Smoke Inspection Door Details

Name Albuquerque Indian Health
Address 801 Vassar Dr Ne Albuquerque, NM 87106
Inspection Date 8/28/2025 **Project #** 384633 **Inspection No.** SLS384140

Building: MAIN Floor: 01 Opening: 0001

Barcode Door Type	Fire / Smoke Door Material	P/F Door Size	Area Frame Material	Inspector Barrier Type	Date Priority
278-415176-001-0001	Yes / No	Failed	MECHANICAL	Shawn Boxer	8/28/2025
Single	Wood	36" x 80"	Hollow Metal Not Filled	1-Hour Smoke Barrier	Immediate

Leaf	Fire Rating	Smoke Label
Leaf A	60 mins	N/A

Criteria	Failed Notes	General Notes	Components	Repaired	Compliant Repaired
FC5	WD/PLAM strike edge clearance > 1/8"		Strike Edge	No	No
FC15	No louver or transfer grille installed in door		Hardware	No	No

Push



Pull



FC15 - Deficiency



FC5 - Deficiency



This document was developed by and is the Exclusive property of DH Pace Company, Inc. Any unauthorized use, reproduction or duplication, in whole or in part, is expressly prohibited. © 2022 DH Pace Company, Inc.

Initial Annual Fire & Smoke Inspection Door Details

Name Albuquerque Indian Health
Address 801 Vassar Dr Ne Albuquerque, NM 87106
Inspection Date 8/28/2025 **Project #** 384633 **Inspection No.** SLS384140

Building: MAIN Floor: 01 Opening: 0002

Barcode Door Type	Fire / Smoke Door Material	P/F Door Size	Area Frame Material	Inspector Barrier Type	Date Priority
278-415176-001-0002	Yes / No	Failed	STAIR	Shawn Boxer	8/28/2025
Single	Hollow Metal	48" x 84"	Hollow Metal Filled	2-Hour Fire Barrier	Critical


Leaf	Fire Rating	Smoke Label
Leaf A	90 mins	N/A

Criteria	Failed Notes	General Notes	Components	Repaired	Compliant Repaired
FC5	HM strike edge clearance > 3/16" HM top edge clearance > 3/16"		Top, Strike Edge	No	No
FC13.F	Missing / illegible frame label		Frame	No	No
FC13.H	Missing / illegible fire exit hardware label (cannot label panic hardware, must be fire exit hardware - no mechanical dogging)		Hardware, Hardware	No	No

Push



Pull

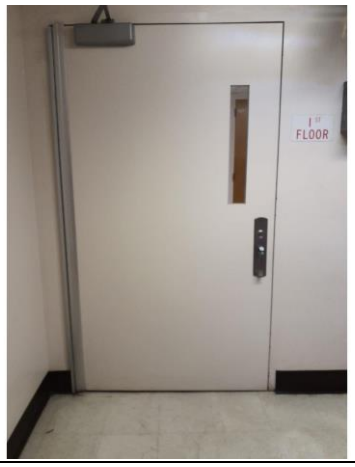


FC13.F - Deficiency



FC5 - Deficiency



FC5 - Deficiency

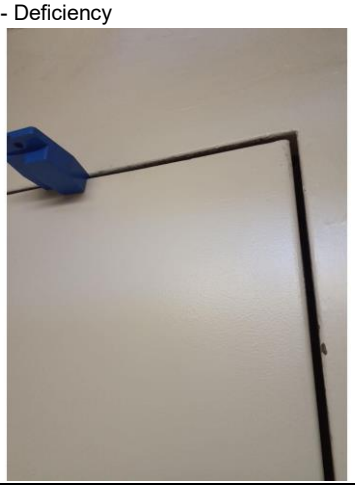

This document was developed by and is the Exclusive property of DH Pace Company, Inc. Any unauthorized use, reproduction or duplication, in whole or in part, is expressly prohibited. © 2022 DH Pace Company, Inc.

Initial Annual Fire & Smoke Inspection Door Details

Name Albuquerque Indian Health
Address 801 Vassar Dr Ne Albuquerque, NM 87106
Inspection Date 8/28/2025 **Project #** 384633 **Inspection No.** SLS384140

Building: MAIN Floor: 01 Opening: 0004

Barcode Door Type	Fire / Smoke Door Material	P/F Door Size	Area Frame Material	Inspector Barrier Type	Date Priority
278-415176-001-0004	Yes / No	Failed	STAIR	Shawn Boxer	8/28/2025
Single	Hollow Metal	48" x 84"	Hollow Metal Filled	2-Hour Fire Barrier	Critical


Leaf	Fire Rating	Smoke Label
Leaf A	90 mins	N/A

Criteria	Failed Notes	General Notes	Components	Repaired	Compliant Repaired
FC5	HM top edge clearance > 3/16" HM strike edge clearance > 3/16"		Top, Strike Edge	No	No
FC13.F	Missing / illegible frame label		Frame	No	No
FC13.H	Missing / illegible fire exit hardware label (cannot label panic hardware, must be fire exit hardware - no mechanical dogging)		Hardware, Hardware	No	No

Push



Pull

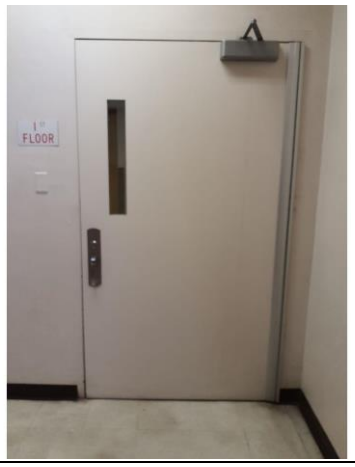

FC13.F - Deficiency



FC5 - Deficiency



FC5 - Deficiency



This document was developed by and is the Exclusive property of DH Pace Company, Inc. Any unauthorized use, reproduction or duplication, in whole or in part, is expressly prohibited. © 2022 DH Pace Company, Inc.

Initial Annual Fire & Smoke Inspection Door Details

Name Albuquerque Indian Health
Address 801 Vassar Dr Ne Albuquerque, NM 87106
Inspection Date 8/28/2025 **Project #** 384633 **Inspection No.** SLS384140


Building: MAIN Floor: 01 Opening: 0005

Barcode Door Type	Fire / Smoke Door Material	P/F Door Size	Area Frame Material	Inspector Barrier Type	Date Priority
278-415176-001-0005	Yes / No	Failed	MECHANICAL	Shawn Boxer	8/28/2025
Single	Hollow Metal	36" x 80"	Hollow Metal Filled	1-Hour Smoke Barrier	Critical


Leaf	Fire Rating	Smoke Label
Leaf A	90 mins	N/A

Criteria	Failed Notes	General Notes	Components	Repaired	Compliant Repaired
FC6	Missing / damaged closer		Hardware	No	No

Push

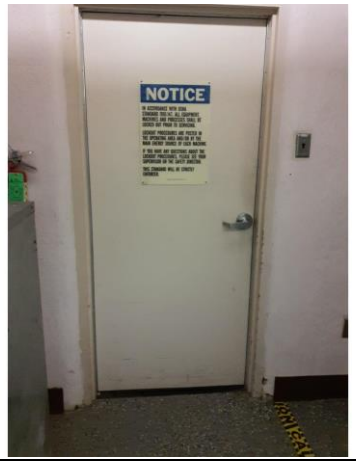

Pull

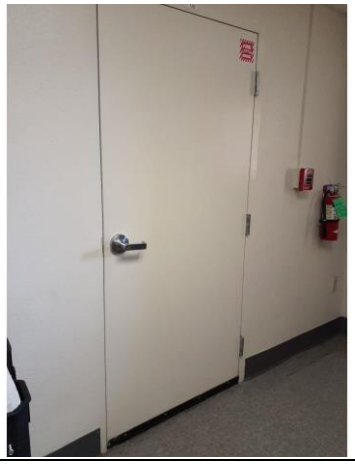

FC6 - Deficiency



This document was developed by and is the Exclusive property of DH Pace Company, Inc. Any unauthorized use, reproduction or duplication, in whole or in part, is expressly prohibited. © 2022 DH Pace Company, Inc.

Initial Annual Fire & Smoke Inspection Door Details

Name Albuquerque Indian Health
Address 801 Vassar Dr Ne Albuquerque, NM 87106
Inspection Date 8/28/2025 **Project #** 384633 **Inspection No.** SLS384140

Building: MAIN Floor: 01 Opening: 0006

Barcode Door Type	Fire / Smoke Door Material	P/F Door Size	Area Frame Material	Inspector Barrier Type	Date Priority
278-415176-001-0006	Yes / No	Failed	MECHANICAL	Shawn Boxer	8/28/2025
Single	Hollow Metal	36" x 80"	Hollow Metal Not Filled	1-Hour Smoke Barrier	Immediate


Leaf	Fire Rating	Smoke Label
Leaf A	180 mins	N/A

Criteria	Failed Notes	General Notes	Components	Repaired	Compliant Repaired
FC1	Missing hardware leaving hole in frame / door		Door	No	No
FC4	Lock/latch fire exit hardware missing part		Door	No	No

Push



Pull

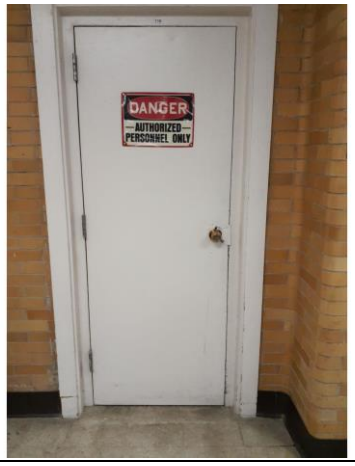

FC1 - Deficiency



FC4 - Deficiency



This document was developed by and is the Exclusive property of DH Pace Company, Inc. Any unauthorized use, reproduction or duplication, in whole or in part, is expressly prohibited. © 2022 DH Pace Company, Inc.

Initial Annual Fire & Smoke Inspection Door Details

Name Albuquerque Indian Health
Address 801 Vassar Dr Ne Albuquerque, NM 87106
Inspection Date 8/28/2025 **Project #** 384633 **Inspection No.** SLS384140


Building: MAIN Floor: 02 Opening: 0007

Barcode Door Type	Fire / Smoke Door Material	P/F Door Size	Area Frame Material	Inspector Barrier Type	Date Priority
278-415176-001-0007	Yes / No	Failed	STAIR	Shawn Boxer	8/28/2025
Single	Hollow Metal	48" x 84"	Hollow Metal Filled	2-Hour Fire Barrier	Critical

Leaf	Fire Rating	Smoke Label
Leaf A	90 mins	N/A

Criteria	Failed Notes	General Notes	Components	Repaired	Compliant Repaired
FC1	Missing hardware leaving hole in frame / door		Frame	No	No
FC5	HM strike edge clearance > 3/16" HM top edge clearance > 3/16"		Top, Strike Edge	No	No
FC13.F	Missing / illegible frame label		Frame	No	No
FC13.H	Missing / illegible fire exit hardware label (cannot label panic hardware, must be fire exit hardware - no mechanical dogging)		Hardware, Hardware	No	No

Push

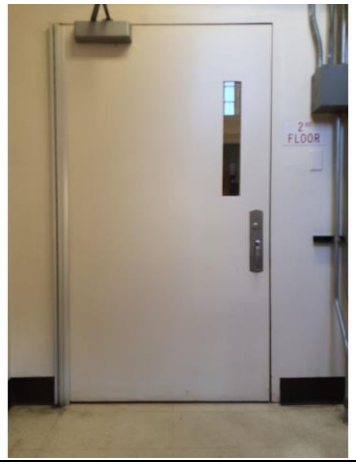

Push



FC1 - Deficiency



FC13.F - Deficiency



FC5 - Deficiency



FC5 - Deficiency



This document was developed by and is the Exclusive property of DH Pace Company, Inc. Any unauthorized use, reproduction or duplication, in whole or in part, is expressly prohibited. © 2022 DH Pace Company, Inc.

Initial Annual Fire & Smoke Inspection Door Details

Name Albuquerque Indian Health
Address 801 Vassar Dr Ne Albuquerque, NM 87106
Inspection Date 8/28/2025 **Project #** 384633 **Inspection No.** SLS384140


Building: MAIN Floor: 02 Opening: 0008

Barcode Door Type	Fire / Smoke Door Material	P/F Door Size	Area Frame Material	Inspector Barrier Type	Date Priority
278-415176-001-0008	Yes / No	Failed	STAIR	Shawn Boxer	8/28/2025
Single	Hollow Metal	48" x 84"	Hollow Metal Filled	2-Hour Fire Barrier	Critical


Leaf	Fire Rating	Smoke Label
Leaf A	90 mins	N/A

Criteria	Failed Notes	General Notes	Components	Repaired	Compliant Repaired
FC5	HM top edge clearance > 3/16" HM strike edge clearance > 3/16"		Top, Strike Edge	No	No
FC13.F	Missing / illegible frame label		Frame	No	No
FC13.H	Missing / illegible fire exit hardware label (cannot label panic hardware, must be fire exit hardware - no mechanical dogging)		Hardware, Hardware	No	No

Push

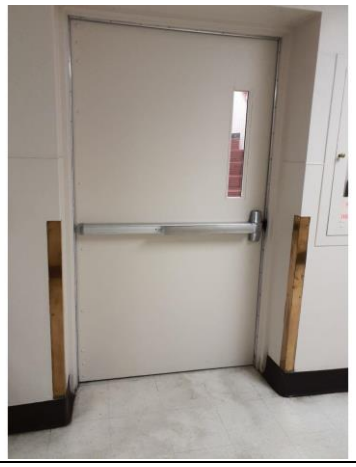

Pull

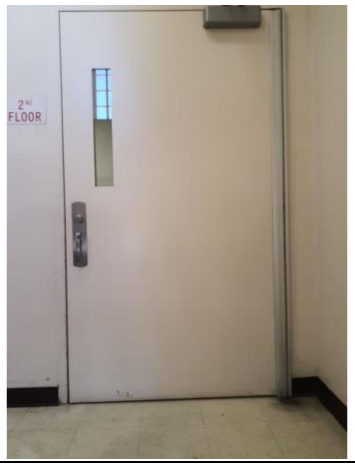

FC13.F - Deficiency



FC5 - Deficiency



FC5 - Deficiency



This document was developed by and is the Exclusive property of DH Pace Company, Inc. Any unauthorized use, reproduction or duplication, in whole or in part, is expressly prohibited. © 2022 DH Pace Company, Inc.

Initial Annual Fire & Smoke Inspection Door Details

Name Albuquerque Indian Health
Address 801 Vassar Dr Ne Albuquerque, NM 87106
Inspection Date 8/28/2025 **Project #** 384633 **Inspection No.** SLS384140


Building: MAIN Floor: 02 Opening: 0009

Barcode Door Type	Fire / Smoke Door Material	P/F Door Size	Area Frame Material	Inspector Barrier Type	Date Priority
278-415176-001-0009	No / No	Failed	MECHANICAL	Shawn Boxer	8/28/2025
Single	Wood	36" x 84"	Hollow Metal Not Filled	1-Hour Smoke Barrier	Immediate


Leaf	Fire Rating	Smoke Label
Leaf A	N/A	N/A

Criteria	Failed Notes	General Notes	Components	Repaired	Compliant Repaired
FC5	WD/PLAM top edge clearance > 1/8"		Top	No	No


Push

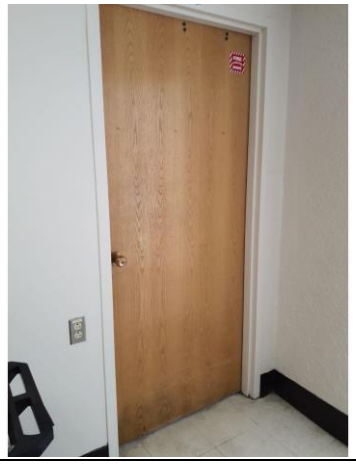

Pull

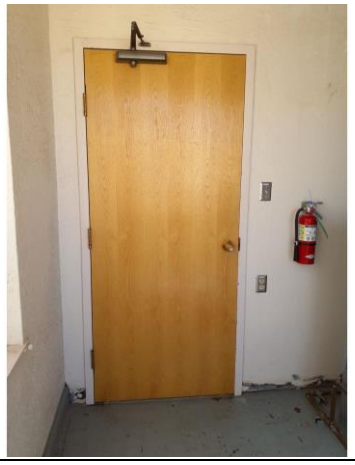

FC5 - Deficiency

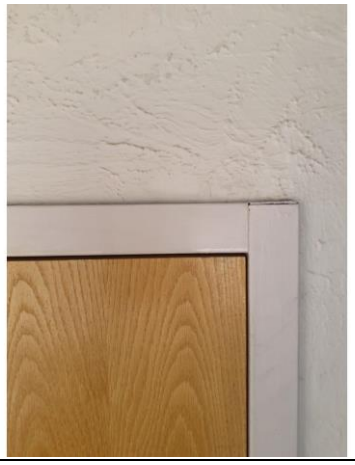

This document was developed by and is the Exclusive property of DH Pace Company, Inc. Any unauthorized use, reproduction or duplication, in whole or in part, is expressly prohibited. © 2022 DH Pace Company, Inc.

Initial Annual Fire & Smoke Inspection Door Details

Name Albuquerque Indian Health
Address 801 Vassar Dr Ne Albuquerque, NM 87106
Inspection Date 8/28/2025 **Project #** 384633 **Inspection No.** SLS384140

Building: MAIN Floor: 02 Opening: 0010

Barcode Door Type	Fire / Smoke Door Material	P/F Door Size	Area Frame Material	Inspector Barrier Type	Date Priority
278-415176-001-0010	No / No	Failed	STAIR	Shawn Boxer	8/28/2025
Single	Hollow Metal	36" x 84"	Hollow Metal Not Filled	1-Hour Fire Barrier	Critical

Leaf	Fire Rating	Smoke Label
Leaf A	N/A	N/A

Criteria	Failed Notes	General Notes	Components	Repaired	Compliant Repaired
FC13.D	Missing / illegible door label (double-check top of door)		Door	No	No
FC13.F	Missing / illegible frame label		Frame	No	No
FC13.H	Missing / illegible fire exit hardware label (cannot label panic hardware, must be fire exit hardware - no mechanical dogging)		Hardware	No	No

Push



Pull



FC13.D - Deficiency



FC13.F - Deficiency



This document was developed by and is the Exclusive property of DH Pace Company, Inc. Any unauthorized use, reproduction or duplication, in whole or in part, is expressly prohibited. © 2022 DH Pace Company, Inc.

Initial Annual Fire & Smoke Inspection Door Details

Name Albuquerque Indian Health
Address 801 Vassar Dr Ne Albuquerque, NM 87106
Inspection Date 8/28/2025 **Project #** 384633 **Inspection No.** SLS384140


Building: MAIN Floor: 02 Opening: 0011

Barcode Door Type	Fire / Smoke Door Material	P/F Door Size	Area Frame Material	Inspector Barrier Type	Date Priority
278-415176-001-0011	No / No	Failed	STAIR	Shawn Boxer	8/28/2025
Single	Hollow Metal	36" x 84"	Hollow Metal Not Filled	1-Hour Fire Barrier	Critical

Leaf	Fire Rating	Smoke Label
Leaf A	N/A	N/A

Criteria	Failed Notes	General Notes	Components	Repaired	Compliant Repaired
FC1	Missing hardware leaving hole in frame / door		Frame	No	No
FC5	HM strike edge clearance > 3/16"		Strike Edge	No	No
FC13.D	Missing / illegible door label (double-check top of door)		Door	No	No
FC13.F	Missing / illegible frame label		Frame	No	No
FC13.H	Missing / illegible fire exit hardware label (cannot label panic hardware, must be fire exit hardware - no mechanical dogging)		Hardware, Hardware	No	No

FC5 - Repaired Deficiency

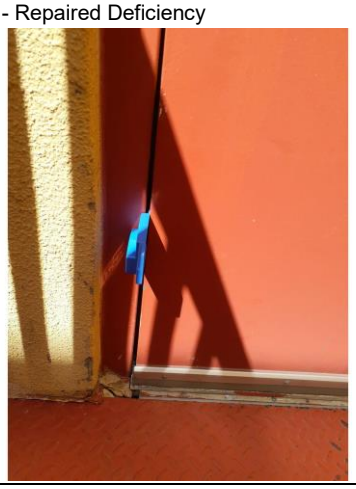


Push



Pull




FC1 - Deficiency

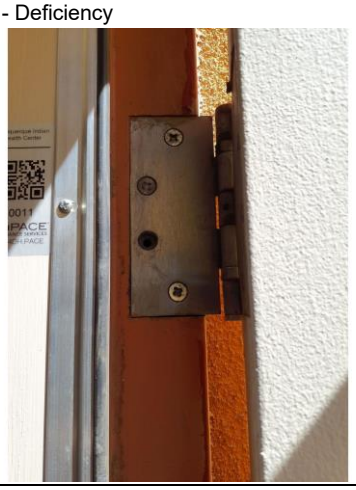

FC13.D - Deficiency



FC13.F - Deficiency

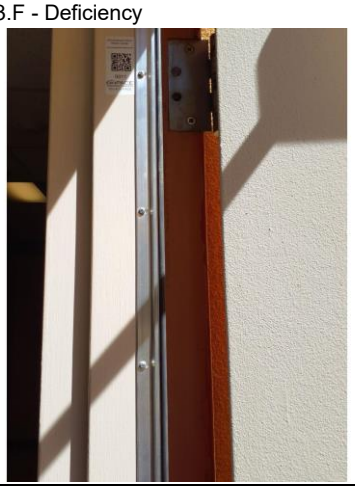

This document was developed by and is the Exclusive property of DH Pace Company, Inc. Any unauthorized use, reproduction or duplication, in whole or in part, is expressly prohibited. © 2022 DH Pace Company, Inc.

Initial Annual Fire & Smoke Inspection Door Details

Name Albuquerque Indian Health
Address 801 Vassar Dr Ne Albuquerque, NM 87106
Inspection Date 8/28/2025 **Project #** 384633 **Inspection No.** SLS384140

Building: MAIN Floor: 03 Opening: 0012

Barcode Door Type	Fire / Smoke Door Material	P/F Door Size	Area Frame Material	Inspector Barrier Type	Date Priority
278-415176-001-0012	Yes / No	Failed	STAIR	Shawn Boxer	8/28/2025
Single	Hollow Metal	48" x 84"	Hollow Metal Filled	2-Hour Fire Barrier	Critical


Leaf	Fire Rating	Smoke Label
Leaf A	90 mins	N/A

Criteria	Failed Notes	General Notes	Components	Repaired	Compliant Repaired
FC5	Bottom clearance for HM and WD/PLAM > 3/4" HM top edge clearance > 3/16" HM strike edge clearance > 3/16"		Top, Bottom, Strike Edge	No	No
FC13.F	Missing / illegible frame label		Frame	No	No
FC13.H	Missing / illegible fire exit hardware label (cannot label panic hardware, must be fire exit hardware - no mechanical dogging)		Hardware, Hardware	No	No

Push



Pull

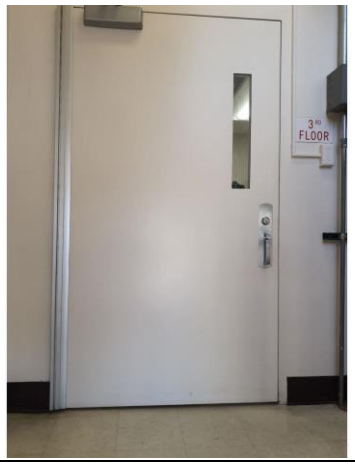

Deficiency



FC13.F - Deficiency



FC5 - Deficiency



FC5 - Deficiency



This document was developed by and is the Exclusive property of DH Pace Company, Inc. Any unauthorized use, reproduction or duplication, in whole or in part, is expressly prohibited. © 2022 DH Pace Company, Inc.

Initial Annual Fire & Smoke Inspection Door Details

Name Albuquerque Indian Health
Address 801 Vassar Dr Ne Albuquerque, NM 87106
Inspection Date 8/28/2025 **Project #** 384633 **Inspection No.** SLS384140

Building: MAIN Floor: 03 Opening: 0014

Barcode Door Type	Fire / Smoke Door Material	P/F Door Size	Area Frame Material	Inspector Barrier Type	Date Priority
278-415176-001-0014	Yes / No	Failed	STAIR	Shawn Boxer	8/28/2025
Single	Hollow Metal	48" x 84"	Hollow Metal Filled	2-Hour Fire Barrier	Critical


Leaf	Fire Rating	Smoke Label
Leaf A	90 mins	N/A

Criteria	Failed Notes	General Notes	Components	Repaired	Compliant Repaired
FC5	HM strike edge clearance > 3/16" HM top edge clearance > 3/16"		Top, Strike Edge	No	No
FC13.F	Missing / illegible frame label		Frame	No	No
FC13.H	Missing / illegible fire exit hardware label (cannot label panic hardware, must be fire exit hardware - no mechanical dogging)		Hardware, Hardware	No	No


Push




Pull

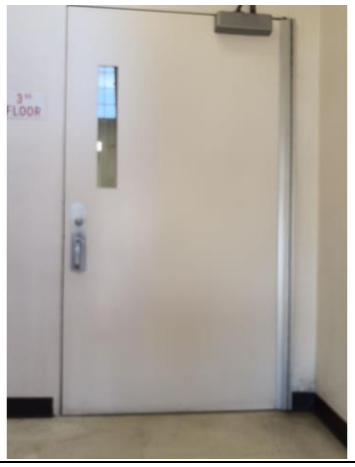

FC13.F - Deficiency

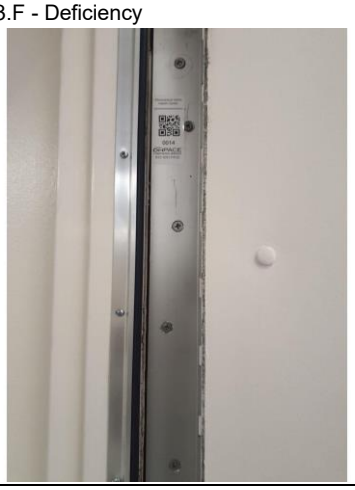

FC5 - Deficiency

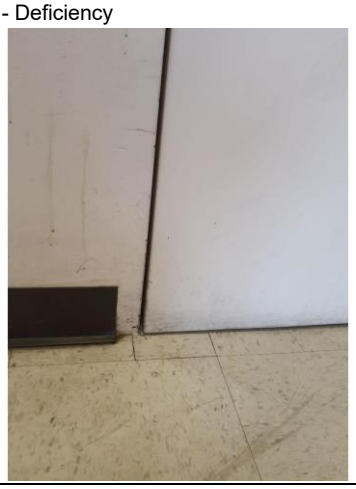

FC5 - Deficiency



This document was developed by and is the Exclusive property of DH Pace Company, Inc. Any unauthorized use, reproduction or duplication, in whole or in part, is expressly prohibited. © 2022 DH Pace Company, Inc.

Initial Annual Fire & Smoke Inspection Door Details

Name Albuquerque Indian Health
Address 801 Vassar Dr Ne Albuquerque, NM 87106
Inspection Date 8/28/2025 **Project #** 384633 **Inspection No.** SLS384140


Building: MAIN Floor: 03 Opening: 0015

Barcode Door Type	Fire / Smoke Door Material	P/F Door Size	Area Frame Material	Inspector Barrier Type	Date Priority
278-415176-001-0015	Yes / No	Failed	STAIR	Shawn Boxer	8/28/2025
Single	Hollow Metal	46" (3'10") x 84"	Hollow Metal Filled	2-Hour Fire Barrier	Immediate


Leaf	Fire Rating	Smoke Label
Leaf A	90 mins	N/A

Criteria	Failed Notes	General Notes	Components	Repaired	Compliant Repaired
FC5	HM strike edge clearance > 3/16"		Strike Edge	No	No
FC13.H	Missing / illegible fire exit hardware label (cannot label panic hardware, must be fire exit hardware - no mechanical dogging)		Hardware, Hardware	No	No

Push

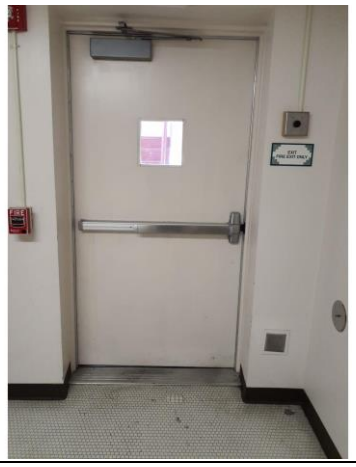

Pull

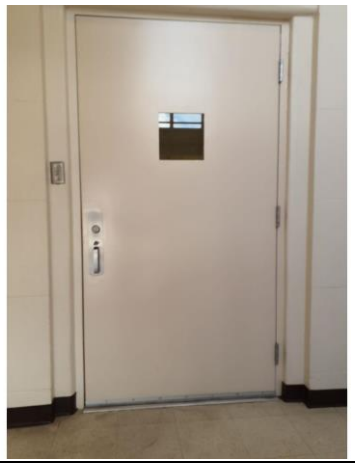

FC5 - Deficiency



This document was developed by and is the Exclusive property of DH Pace Company, Inc. Any unauthorized use, reproduction or duplication, in whole or in part, is expressly prohibited. © 2022 DH Pace Company, Inc.

Initial Annual Fire & Smoke Inspection Door Details

Name Albuquerque Indian Health
Address 801 Vassar Dr Ne Albuquerque, NM 87106
Inspection Date 8/28/2025 **Project #** 384633 **Inspection No.** SLS384140


Building: MAIN Floor: 04 Opening: 0016

Barcode Door Type	Fire / Smoke Door Material	P/F Door Size	Area Frame Material	Inspector Barrier Type	Date Priority
278-415176-001-0016	Yes / No	Failed	STAIR	Shawn Boxer	8/28/2025
Single	Hollow Metal	48" x 84"	Hollow Metal Filled	2-Hour Fire Barrier	Critical

Leaf	Fire Rating	Smoke Label
Leaf A	90 mins	N/A

Criteria	Failed Notes	General Notes	Components	Repaired	Compliant Repaired
FC5	HM strike edge clearance > 3/16" HM top edge clearance > 3/16"		Top, Strike Edge	No	No
FC13.F	Missing / illegible frame label		Frame	No	No
FC13.H	Missing / illegible fire exit hardware label (cannot label panic hardware, must be fire exit hardware - no mechanical dogging)		Hardware, Hardware	No	No

Push

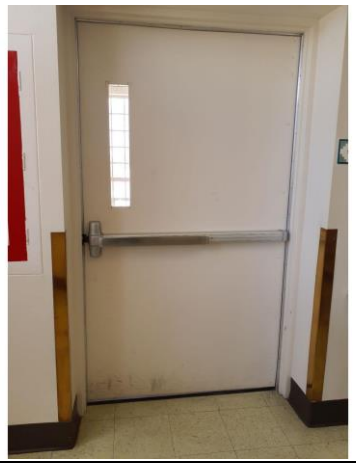

Pull



FC13.F - Deficiency



FC5 - Deficiency



FC5 - Deficiency



This document was developed by and is the Exclusive property of DH Pace Company, Inc. Any unauthorized use, reproduction or duplication, in whole or in part, is expressly prohibited. © 2022 DH Pace Company, Inc.

Initial Annual Fire & Smoke Inspection Door Details

Name Albuquerque Indian Health
Address 801 Vassar Dr Ne Albuquerque, NM 87106
Inspection Date 8/28/2025 **Project #** 384633 **Inspection No.** SLS384140

Building: MAIN Floor: 04 Opening: 0017

Barcode Door Type	Fire / Smoke Door Material	P/F Door Size	Area Frame Material	Inspector Barrier Type	Date Priority
278-415176-001-0017	Yes / No	Failed	STAIR	Shawn Boxer	8/28/2025
Single	Wood	28" x 84"	Hollow Metal Filled	1-Hour Fire Barrier	Critical

Leaf	Fire Rating	Smoke Label
Leaf A	Label Missing	N/A

Criteria	Failed Notes	General Notes	Components	Repaired	Compliant Repaired
FC5	WD/PLAM top edge clearance > 1/8" Bottom clearance for HM and WD/PLAM > 3/4"		Top, Bottom	No	No
FC6	Missing / damaged closer		Hardware	No	No
FC12	Signage > 5%		Size	No	No
FC13.D	Missing / illegible door label (double-check top of door)		Door	No	No
FC13.F	Missing / illegible frame label		Frame	No	No

Push




Pull




FC12 - Deficiency



FC13.D - Deficiency

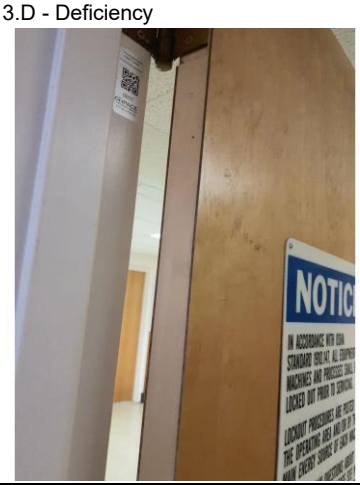

FC13.F - Deficiency

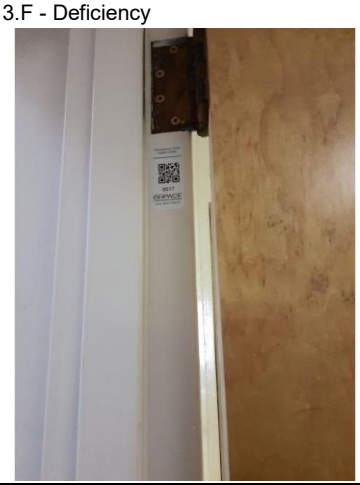

FC5 - Deficiency



This document was developed by and is the Exclusive property of DH Pace Company, Inc. Any unauthorized use, reproduction or duplication, in whole or in part, is expressly prohibited. © 2022 DH Pace Company, Inc.

Initial Annual Fire & Smoke Inspection Door Details

Name Albuquerque Indian Health
Address 801 Vassar Dr Ne Albuquerque, NM 87106
Inspection Date 8/28/2025 **Project #** 384633 **Inspection No.** SLS384140

Building: MAIN Floor: 04 Opening: 0017

Barcode Door Type	Fire / Smoke Door Material	P/F Door Size	Area Frame Material	Inspector Barrier Type	Date Priority

FC5 - Deficiency



FC6 - Deficiency



This document was developed by and is the Exclusive property of DH Pace Company, Inc. Any unauthorized use, reproduction or duplication, in whole or in part, is expressly prohibited. © 2022 DH Pace Company, Inc.

Initial Annual Fire & Smoke Inspection Door Details

Name Albuquerque Indian Health
Address 801 Vassar Dr Ne Albuquerque, NM 87106
Inspection Date 8/28/2025 **Project #** 384633 **Inspection No.** SLS384140


Building: MAIN Floor: 04 Opening: 0018

Barcode Door Type	Fire / Smoke Door Material	P/F Door Size	Area Frame Material	Inspector Barrier Type	Date Priority
278-415176-001-0018	Yes / No	Failed	STAIR	Shawn Boxer	8/28/2025
Single	Hollow Metal	48" x 84"	Hollow Metal Filled	2-Hour Fire Barrier	Critical


Leaf	Fire Rating	Smoke Label
Leaf A	90 mins	N/A

Criteria	Failed Notes	General Notes	Components	Repaired	Compliant Repaired
FC5	HM top edge clearance > 3/16"		Top	No	No
FC13.F	Missing / illegible frame label		Frame	No	No
FC13.H	Missing / illegible fire exit hardware label (cannot label panic hardware, must be fire exit hardware - no mechanical dogging)		Hardware, Hardware	No	No

Push

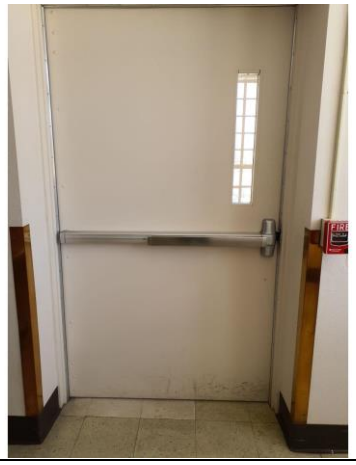

Pull

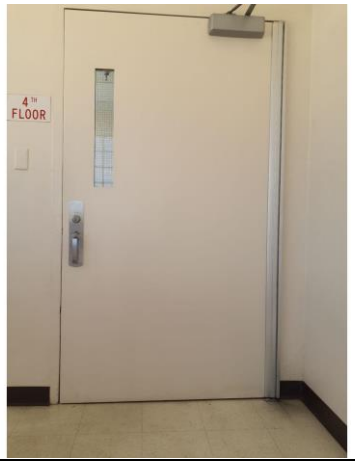

FC13.F - Deficiency



FC5 - Deficiency



This document was developed by and is the Exclusive property of DH Pace Company, Inc. Any unauthorized use, reproduction or duplication, in whole or in part, is expressly prohibited. © 2022 DH Pace Company, Inc.

Initial Annual Fire & Smoke Inspection Door Details

Name Albuquerque Indian Health
Address 801 Vassar Dr Ne Albuquerque, NM 87106
Inspection Date 8/28/2025 **Project #** 384633 **Inspection No.** SLS384140


Building: MAIN Floor: 04 Opening: 0019

Barcode Door Type	Fire / Smoke Door Material	P/F Door Size	Area Frame Material	Inspector Barrier Type	Date Priority
278-415176-001-0019	Yes / No	Failed	STAIR	Shawn Boxer	8/28/2025
Single	Hollow Metal	48" x 84"	Hollow Metal Filled	2-Hour Fire Barrier	Critical

Leaf	Fire Rating	Smoke Label
Leaf A	90 mins	N/A

Criteria	Failed Notes	General Notes	Components	Repaired	Compliant Repaired
FC5	HM top edge clearance > 3/16" HM strike edge clearance > 3/16"		Top, Strike Edge	No	No
FC13.F	Missing / illegible frame label		Frame	No	No
FC13.H	Missing / illegible fire exit hardware label (cannot label panic hardware, must be fire exit hardware - no mechanical dogging)		Hardware, Hardware	No	No

Push

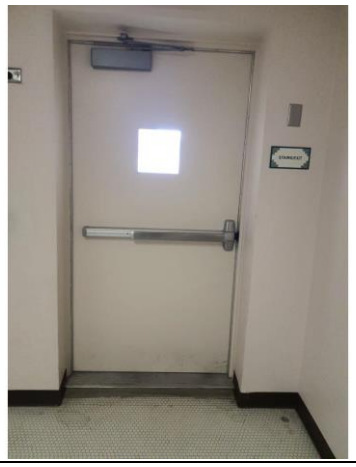

Pull



FC13.F - Deficiency



FC5 - Deficiency



FC5 - Deficiency



This document was developed by and is the Exclusive property of DH Pace Company, Inc. Any unauthorized use, reproduction or duplication, in whole or in part, is expressly prohibited. © 2022 DH Pace Company, Inc.

Initial Annual Fire & Smoke Inspection Door Details

Name Albuquerque Indian Health
Address 801 Vassar Dr Ne Albuquerque, NM 87106
Inspection Date 8/28/2025 **Project #** 384633 **Inspection No.** SLS384140

Building: MAIN Floor: 05 Opening: 0020

Barcode Door Type	Fire / Smoke Door Material	P/F Door Size	Area Frame Material	Inspector Barrier Type	Date Priority
278-415176-001-0020	Yes / No	Failed	STORAGE	Shawn Boxer	8/28/2025
Single	Wood	36" x 84"	Hollow Metal Not Filled	2-Hour Fire Barrier	Critical


Leaf	Fire Rating	Smoke Label
Leaf A	Label Missing	N/A

Criteria	Failed Notes	General Notes	Components	Repaired	Compliant Repaired
FC1	Missing hardware leaving hole in frame / door		Door	No	No
FC6	Missing / damaged closer		Hardware	No	No
FC13.D	Missing / illegible door label (double-check top of door)		Door	No	No
FC13.F	Missing / illegible frame label		Frame	No	No
FC13.H	Missing 'F' stamp on latch that designates rated lockset		Hardware	No	No


Push



Pull

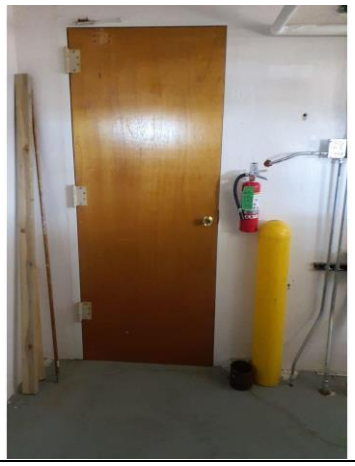

FC13.D - Deficiency

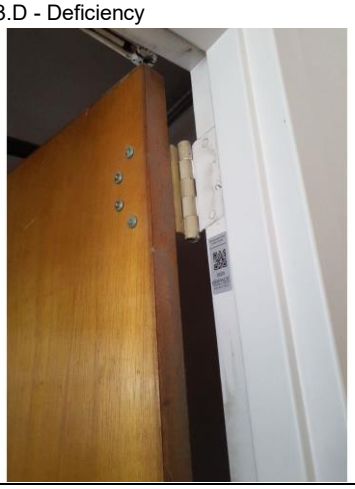


FC13.F - Deficiency



FC13.H - Deficiency



FC6 - Deficiency

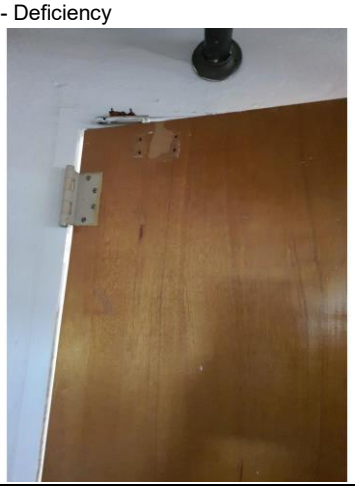

This document was developed by and is the Exclusive property of DH Pace Company, Inc. Any unauthorized use, reproduction or duplication, in whole or in part, is expressly prohibited. © 2022 DH Pace Company, Inc.

Initial Annual Fire & Smoke Inspection Door Details

Name Albuquerque Indian Health
Address 801 Vassar Dr Ne Albuquerque, NM 87106
Inspection Date 8/28/2025 **Project #** 384633 **Inspection No.** SLS384140


Building: MAIN Floor: 05 Opening: 0021

Barcode Door Type	Fire / Smoke Door Material	P/F Door Size	Area Frame Material	Inspector Barrier Type	Date Priority
278-415176-001-0021	Yes / No	Failed	MECHANICAL	Shawn Boxer	8/28/2025
Single	Wood	36" x 84"	Hollow Metal Not Filled	1-Hour Fire Barrier	Critical

Leaf	Fire Rating	Smoke Label
Leaf A	Label Missing	N/A

Criteria	Failed Notes	General Notes	Components	Repaired	Compliant Repaired
FC6	Missing / damaged closer		Hardware	No	No
FC13.D	Missing / illegible door label (double-check top of door)		Door	No	No
FC13.F	Missing / illegible frame label		Frame	No	No
FC13.H	Missing 'F' stamp on latch that designates rated lockset		Hardware	No	No


Push

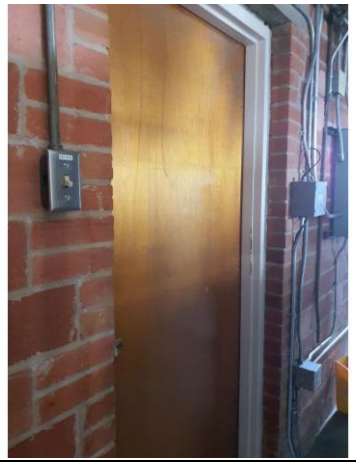

Pull



FC13.D - Deficiency

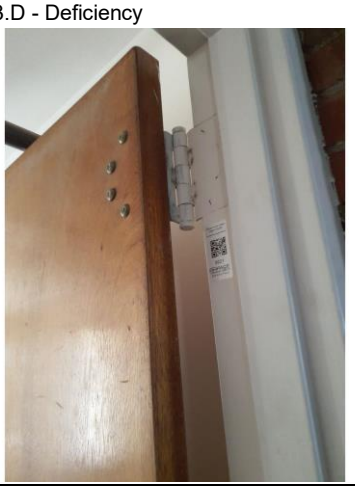


FC13.F - Deficiency



FC13.H - Deficiency



FC6 - Deficiency

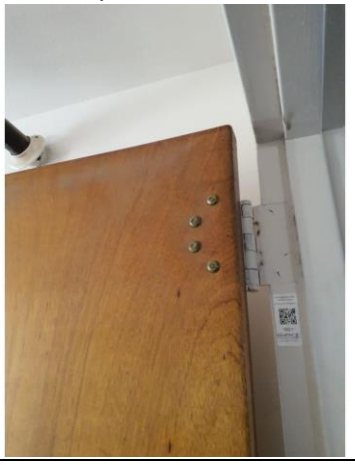

This document was developed by and is the Exclusive property of DH Pace Company, Inc. Any unauthorized use, reproduction or duplication, in whole or in part, is expressly prohibited. © 2022 DH Pace Company, Inc.

--- End of Report ---

Albuquerque Indian Health Service
Albuquerque Indian Health
801 Vassar Dr Ne
Albuquerque, NM 87106

Inspection No.:	SLS384140
Code Edition:	NFPA 80 - 2010 for Healthcare
Inspection Initiated:	August 28 2025

DH PACE®
COMPLIANCE SERVICES
Inspections • Labeling • Training • Consulting

If the report indicates that deficiencies were found (and were not repaired on-site), please refer to corresponding proposal.
This comprehensive FireCheck® inspection report is based on NFPA 80 (fire) and NFPA 105 (smoke) requirements. This report applies only to door list provided by the Customer.

Code Interpretation Disclaimer: All information provided by DH Pace Inc. represents our interpretation regarding the intent of the standard(s) and/or code(s) applicable to the issue being addressed. By law, the Authority Having Jurisdiction (AHJ) is the only entity with the legal standing and discretionary authority to make a definitive ruling on these matters. As such, DH Pace disclaims any consequential damages that may arise from the use of the information provided, recommendation made, or opinions expressed on this matter.

This document was developed by and is the Exclusive property of DH Pace Company, Inc. Any unauthorized use, reproduction or duplication, in whole or in part, is expressly prohibited. © 2022 DH Pace Company, Inc.