


This bulletin discusses failure mechanisms of the internally enhanced .625 x .020 prime surface, internally enhanced tubes. These tubes can be found with .020, .025 or .028 walls. They are commonly used in evaporators of reciprocal chillers. These systems usually have the refrigerant on the inside of the tubes and water flowing around the outside. A baffle system is used to force the water to circulate around and between the tubes for increased efficiency. See **figure 1**.

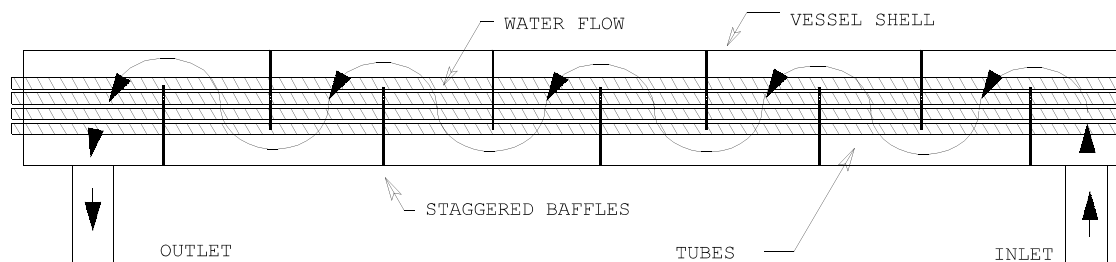


**Figure 1** Typical Reciprocal Baffle System

**Failure Mechanisms:** The principle problems we have found are Baffle Wear and Under Baffle Corrosion. The wear results from the tube vibrating in the baffles and is predominate around the perimeter of the bundle. Under Baffle Corrosion is due to poor or non-existent water treatment, and is most likely galvanic in nature.


Tubes removed from a York YCWZ88 Reciprocal showed Grooves and Pitting. It was noted that the baffles used in this unit were 1/8 inch thick but the grooves were 1/16 inches wide. See Figures 2 through 5.

The tubes used in this document have a .020 wall, but can be ordered with a .025 or .028. These tubes were tested at 36KHz. Even at this high frequency there was a large separation between the OD Grooves and the 100% through hole milled into the calibration standard. See Figure 5. The calibration standard used was an exact match to the tubes tested. It contained OD Grooves ranging from 20% to 55%.


*When inspecting units containing these tubes you must prepare a "Phase Chart" and evaluate damage, if found, on the differential channel. Significant grooving at a baffle can appear minor. However, as can be seen in Figures 6 through 8 the damage can be quite significant. The tubes shown here are actual tubes removed from a failed unit. As can be seen the phase angles appear minor until compared to a phase chart. See Figure 9.*

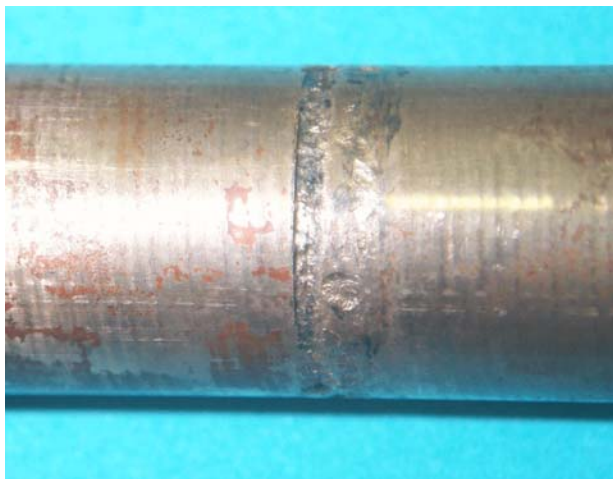


**Figure 2** 5% - 10% Groove

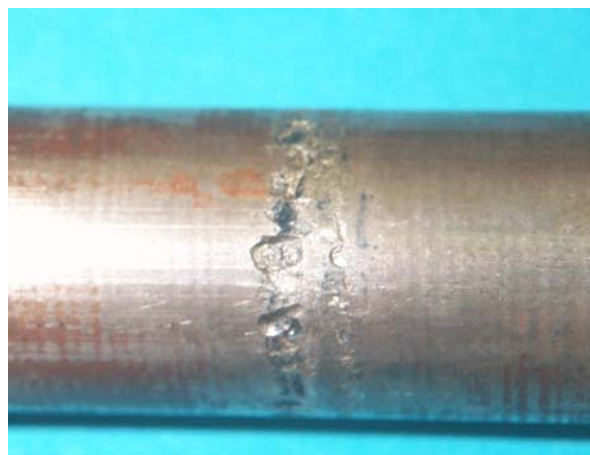


**Figure 3** 58% Pitting Under Baffle

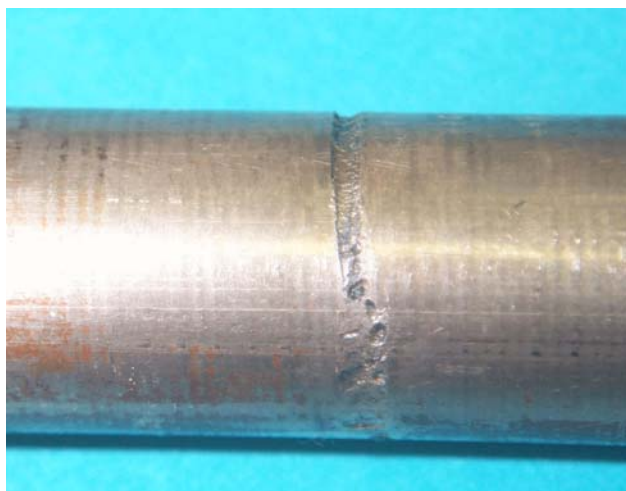


**Figure 4** 62% Groove Under Baffle

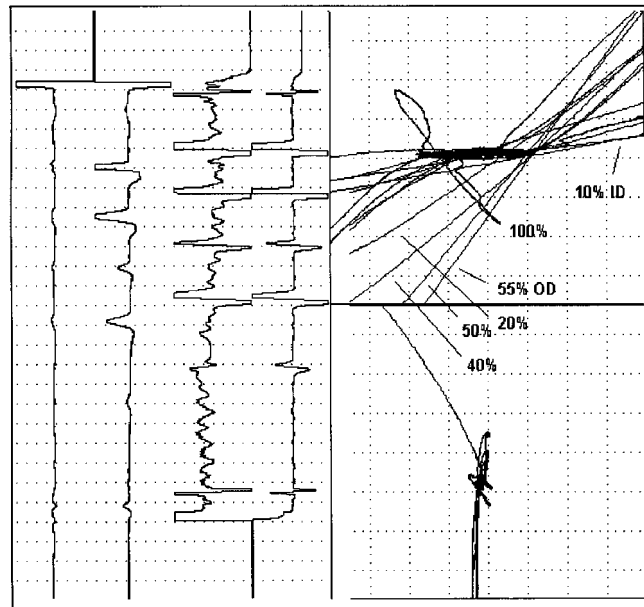

**Figure 5**  
 .620 x .020 PSIE Copper Calibration Standard

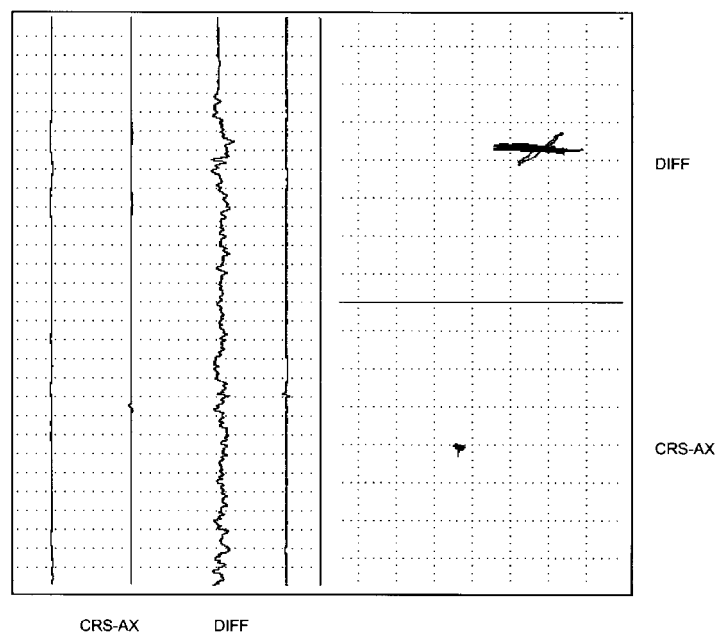


**Figure 6**  
 5% Baffle Wear

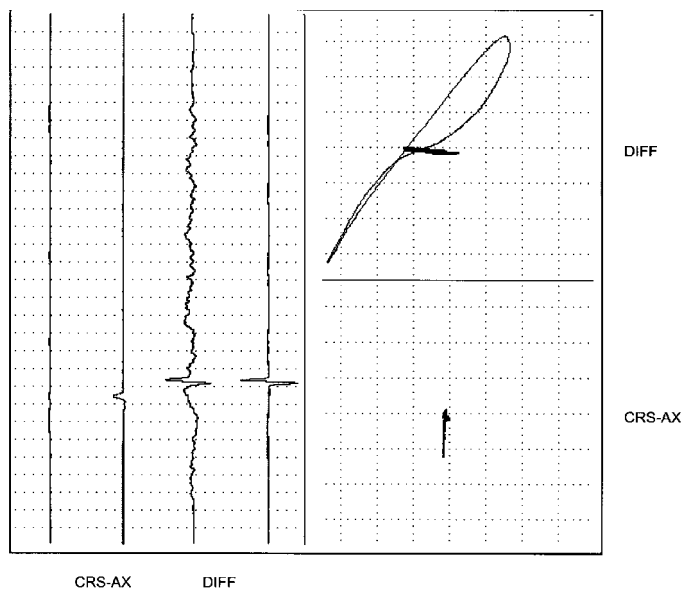


**Figure 7**

58% OD Groove

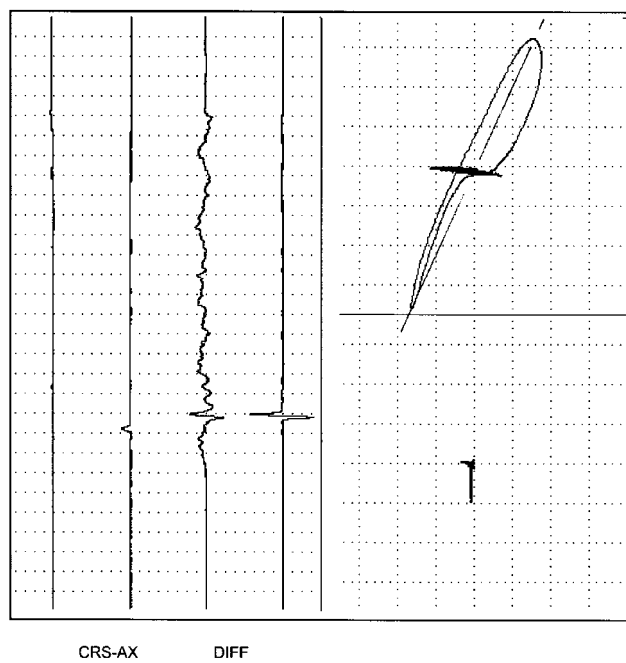

**Figure 8**


62% OD Groove

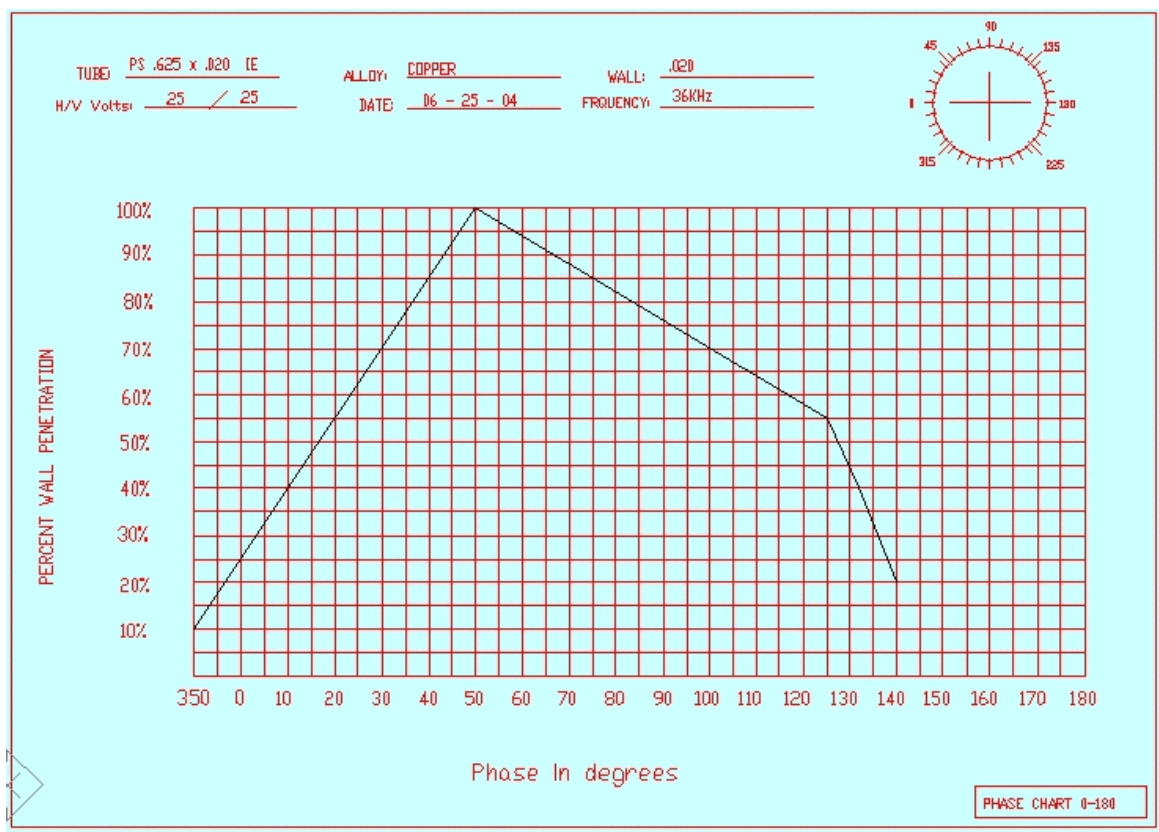

**Figure 9** Phase Chart for .625 x .020 IE Copper Tube



This bulletin discusses failure mechanisms of the internally enhanced .625 x .020 prime surface, internally enhanced tubes. These tubes can be found with .020, .025 or .028 walls. They are commonly used in evaporators of reciprocal chillers. These systems usually have the refrigerant on the inside of the tubes and water flowing around the outside. A baffle system is used to force the water to circulate around and between the tubes for increased efficiency. See **figure 1**.

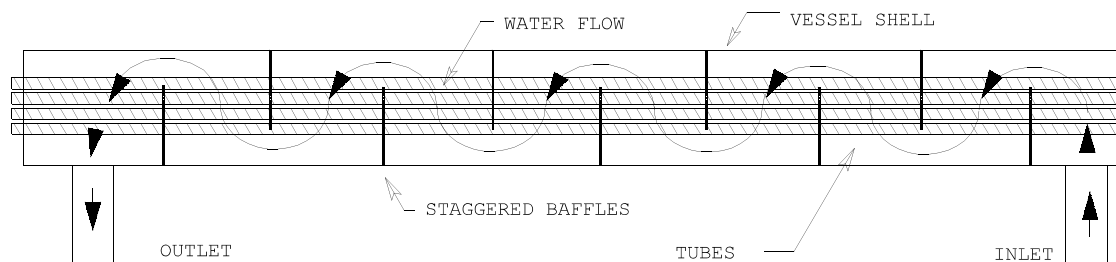


**Figure 1** Typical Reciprocal Baffle System

**Failure Mechanisms:** The principle problems we have found are Baffle Wear and Under Baffle Corrosion. The wear results from the tube vibrating in the baffles and is predominate around the perimeter of the bundle. Under Baffle Corrosion is due to poor or non-existent water treatment, and is most likely galvanic in nature.


Tubes removed from a York YCWZ88 Reciprocal showed Grooves and Pitting. It was noted that the baffles used in this unit were 1/8 inch thick but the grooves were 1/16 inches wide. See Figures 2 through 5.

The tubes used in this document have a .020 wall, but can be ordered with a .025 or .028. These tubes were tested at 36KHz. Even at this high frequency there was a large separation between the OD Grooves and the 100% through hole milled into the calibration standard. See Figure 5. The calibration standard used was an exact match to the tubes tested. It contained OD Grooves ranging from 20% to 55%.


*When inspecting units containing these tubes you must prepare a "Phase Chart" and evaluate damage, if found, on the differential channel. Significant grooving at a baffle can appear minor. However, as can be seen in Figures 6 through 8 the damage can be quite significant. The tubes shown here are actual tubes removed from a failed unit. As can be seen the phase angles appear minor until compared to a phase chart. See Figure 9.*

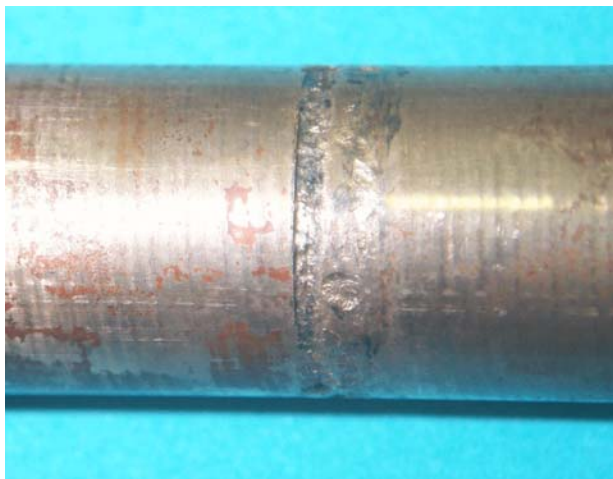

**Figure 2** 5% - 10% Groove

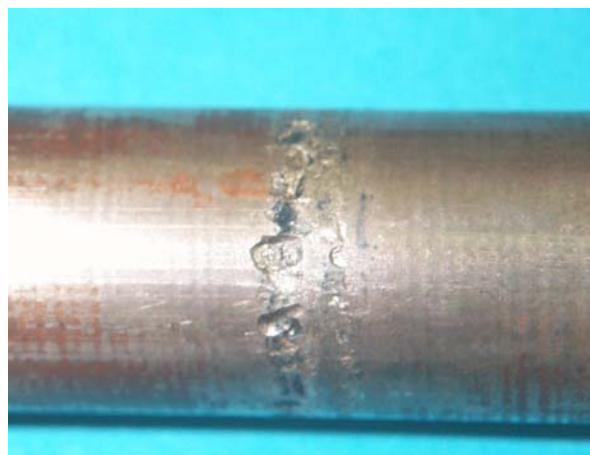


**Figure 3** 58% Pitting Under Baffle

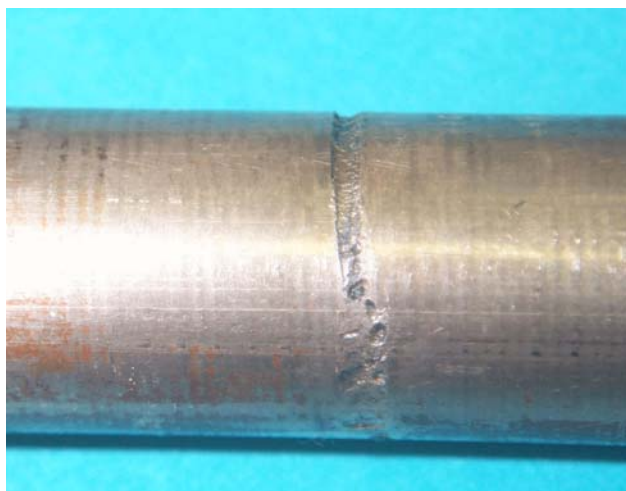


**Figure 4** 62% Groove Under Baffle




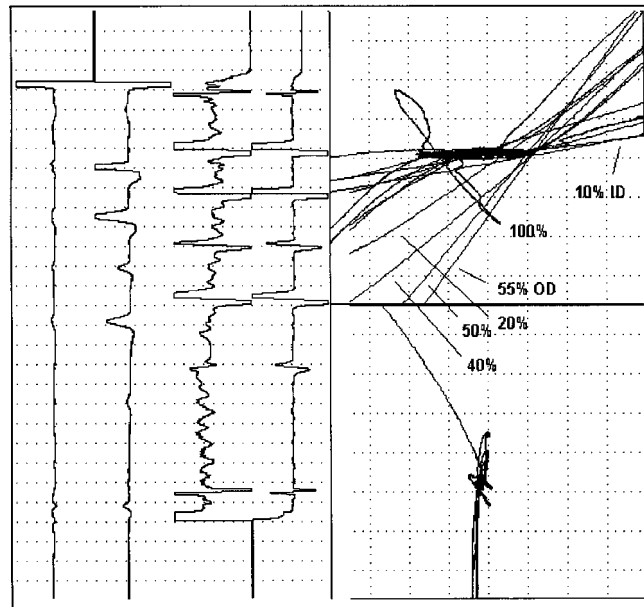

**Figure 5**  
 .620 x .020 PSIE Copper Calibration Standard

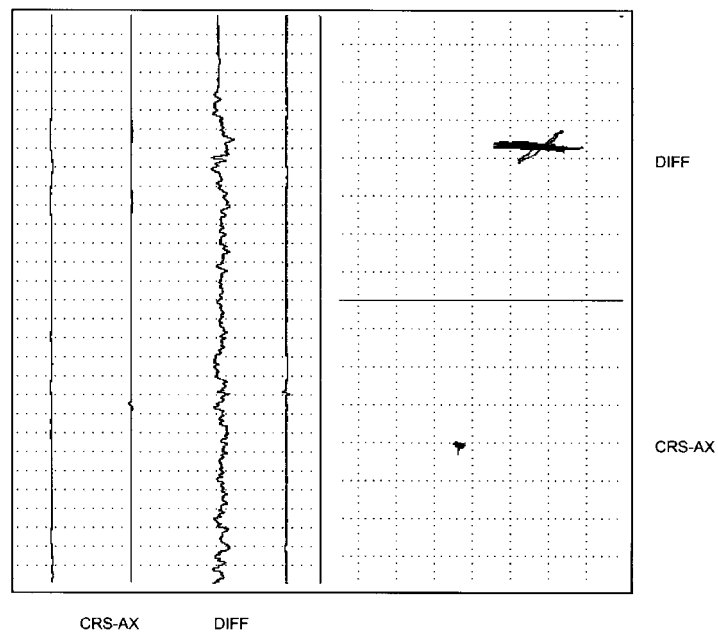


**Figure 6**  
 5% Baffle Wear

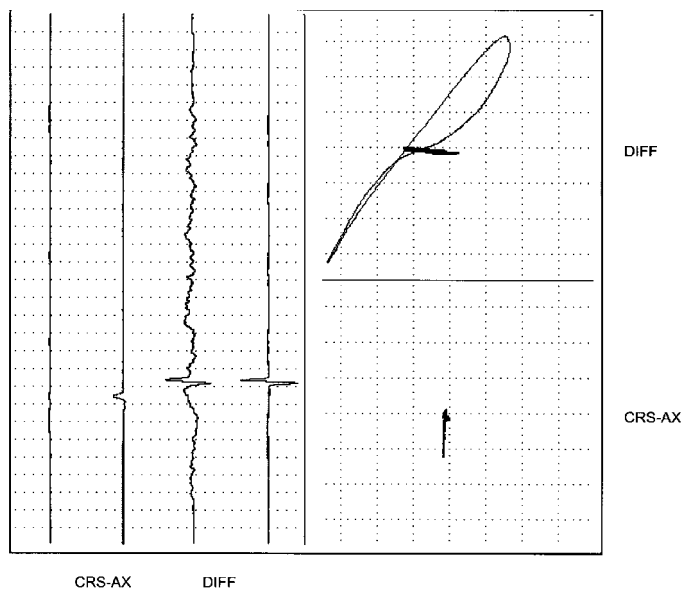


**Figure 7**

58% OD Groove

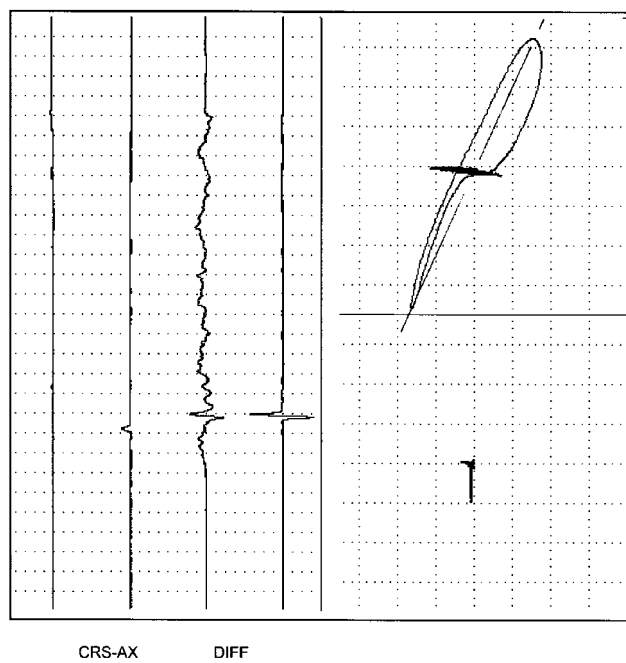

**Figure 8**


62% OD Groove

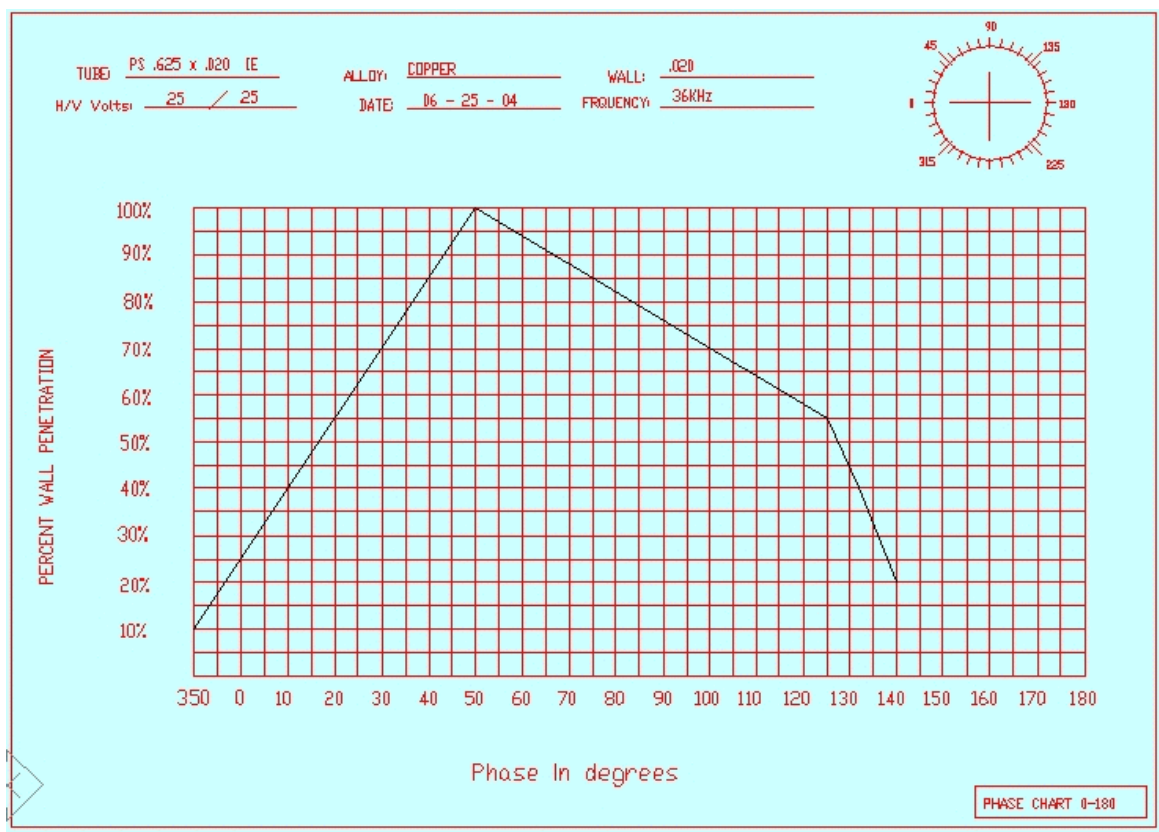

**Figure 9** Phase Chart for .625 x .020 IE Copper Tube



This bulletin discusses failure mechanisms of the internally enhanced .625 x .020 prime surface, internally enhanced tubes. These tubes can be found with .020, .025 or .028 walls. They are commonly used in evaporators of reciprocal chillers. These systems usually have the refrigerant on the inside of the tubes and water flowing around the outside. A baffle system is used to force the water to circulate around and between the tubes for increased efficiency. See **figure 1**.

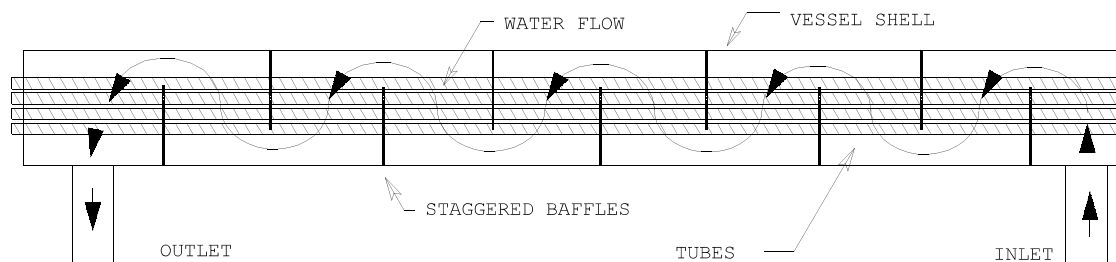


**Figure 1** Typical Reciprocal Baffle System

**Failure Mechanisms:** The principle problems we have found are Baffle Wear and Under Baffle Corrosion. The wear results from the tube vibrating in the baffles and is predominate around the perimeter of the bundle. Under Baffle Corrosion is due to poor or non-existent water treatment, and is most likely galvanic in nature.


Tubes removed from a York YCWZ88 Reciprocal showed Grooves and Pitting. It was noted that the baffles used in this unit were 1/8 inch thick but the grooves were 1/16 inches wide. See Figures 2 through 5.

The tubes used in this document have a .020 wall, but can be ordered with a .025 or .028. These tubes were tested at 36KHz. Even at this high frequency there was a large separation between the OD Grooves and the 100% through hole milled into the calibration standard. See Figure 5. The calibration standard used was an exact match to the tubes tested. It contained OD Grooves ranging from 20% to 55%.


*When inspecting units containing these tubes you must prepare a "Phase Chart" and evaluate damage, if found, on the differential channel. Significant grooving at a baffle can appear minor. However, as can be seen in Figures 6 through 8 the damage can be quite significant. The tubes shown here are actual tubes removed from a failed unit. As can be seen the phase angles appear minor until compared to a phase chart. See Figure 9.*

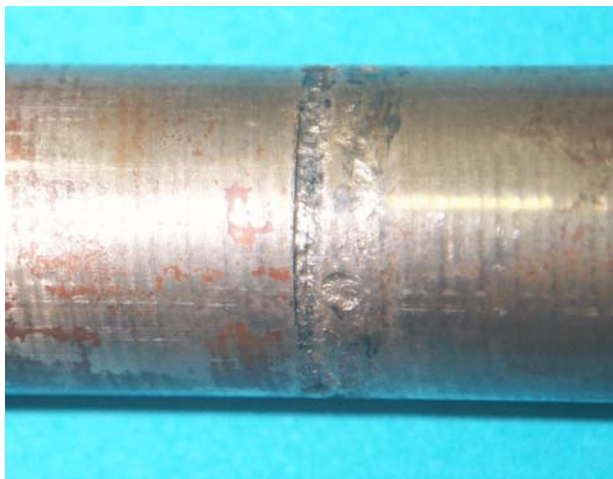


**Figure 2** 5% - 10% Groove

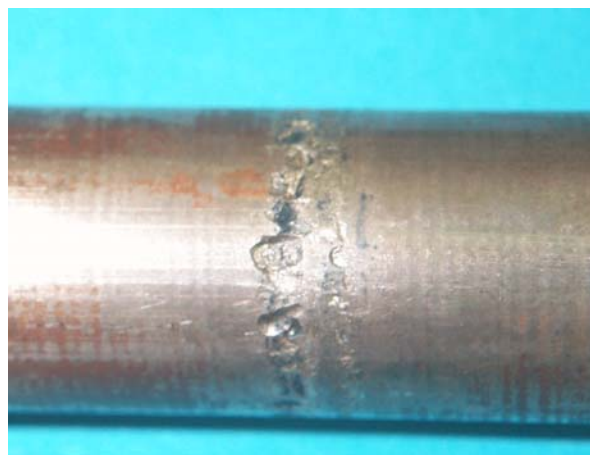


**Figure 3** 58% Pitting Under Baffle

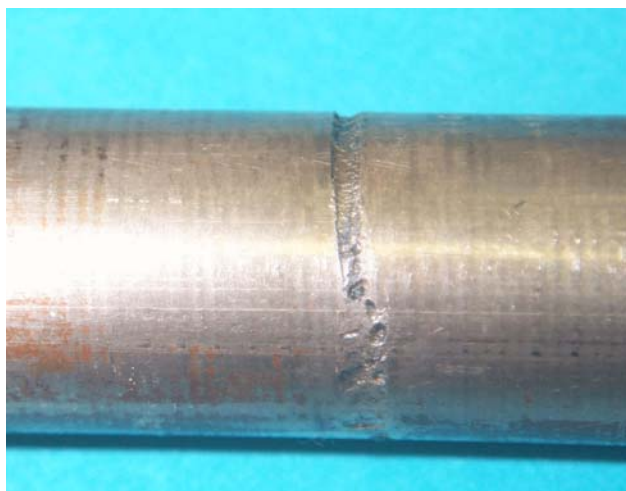


**Figure 4** 62% Groove Under Baffle

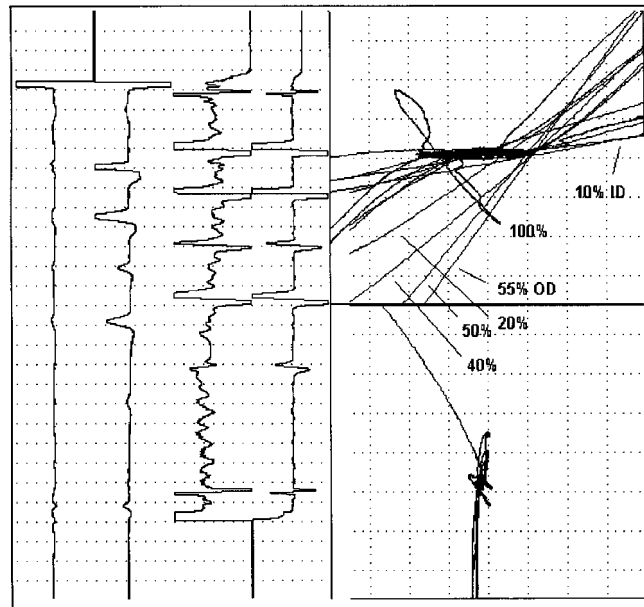

**Figure 5**  
 .620 x .020 PSIE Copper Calibration Standard

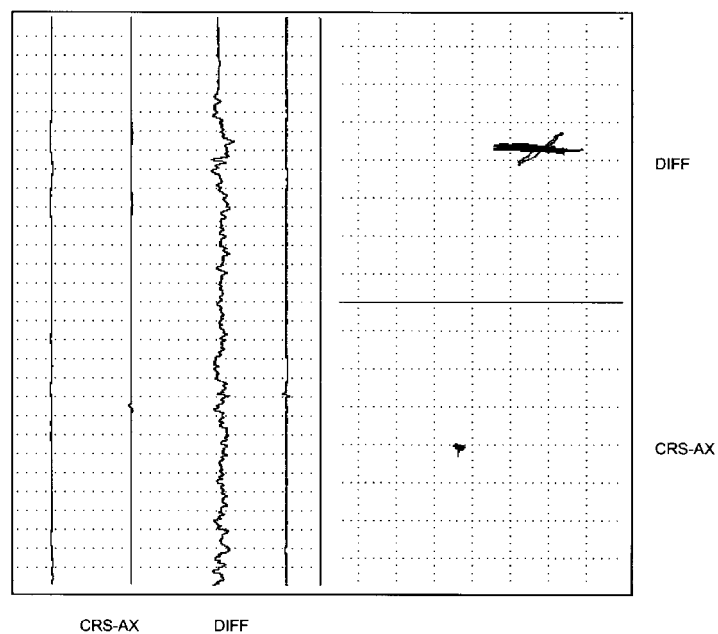


**Figure 6**  
 5% Baffle Wear

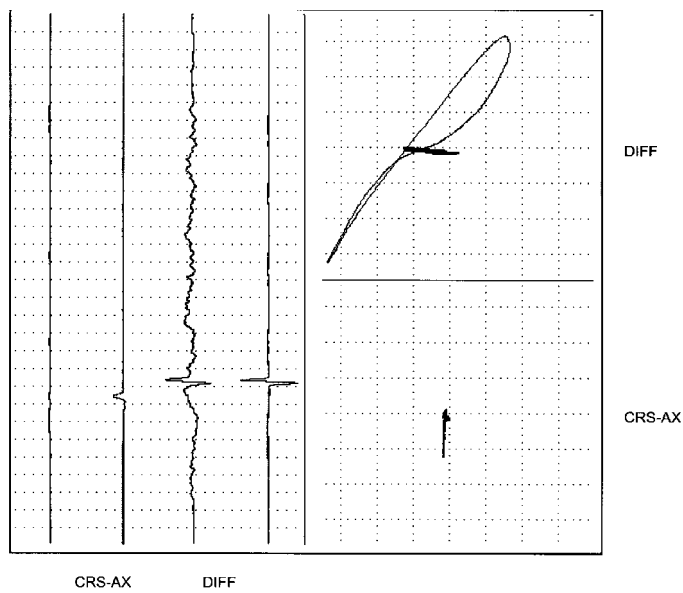

**Figure 7**


58% OD Groove

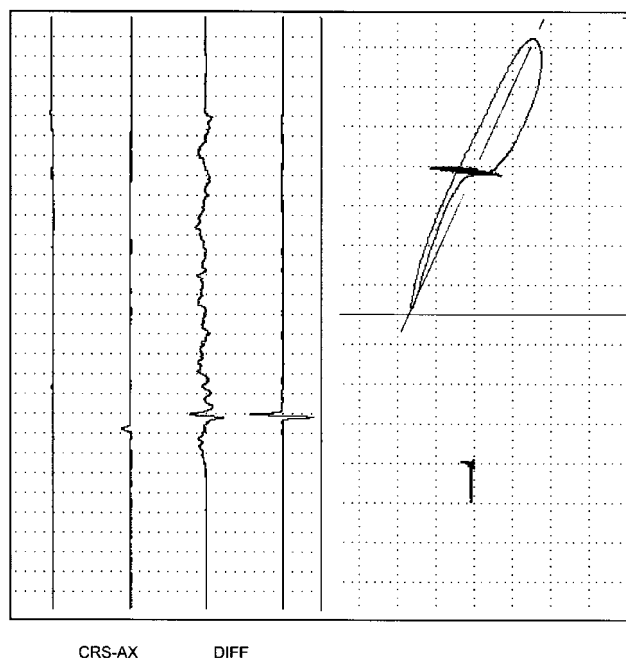

**Figure 8**

62% OD Groove




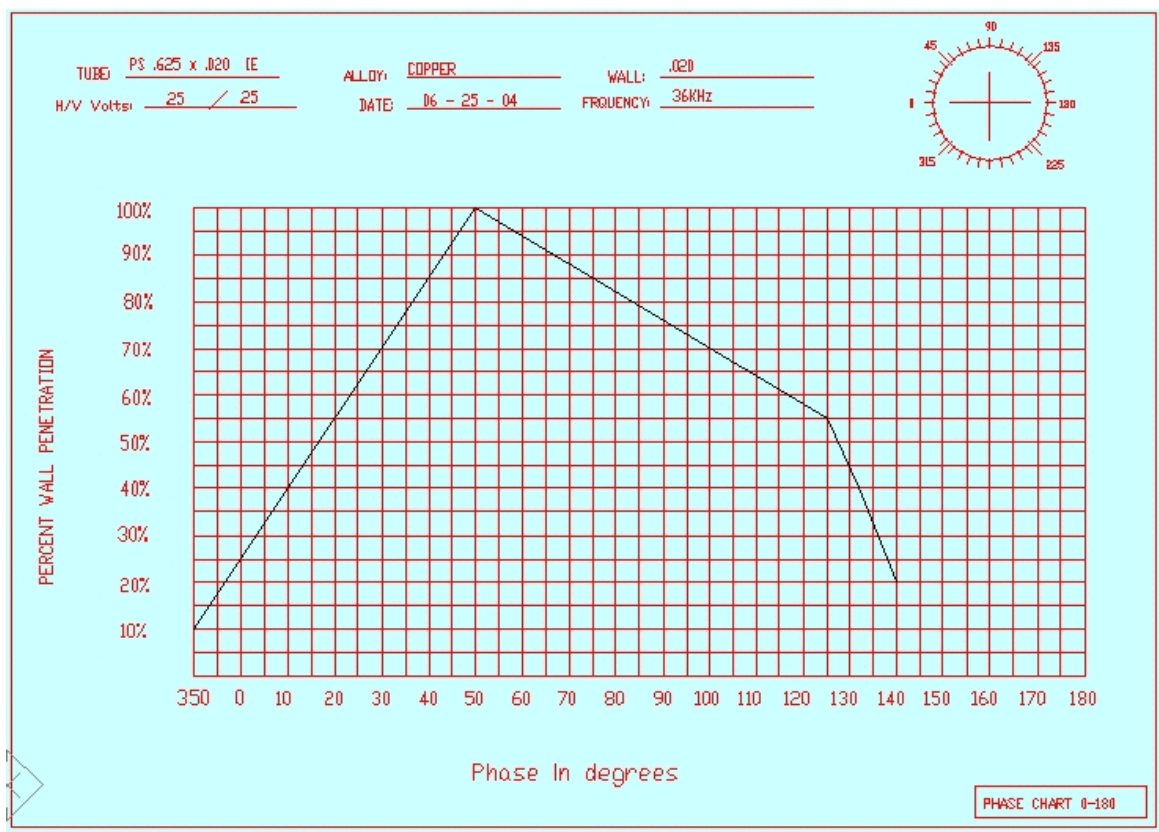

**Figure 9** Phase Chart for .625 x .020 IE Copper Tube



This bulletin discusses failure mechanisms of the internally enhanced .625 x .020 prime surface, internally enhanced tubes. These tubes can be found with .020, .025 or .028 walls. They are commonly used in evaporators of reciprocal chillers. These systems usually have the refrigerant on the inside of the tubes and water flowing around the outside. A baffle system is used to force the water to circulate around and between the tubes for increased efficiency. See **figure 1**.

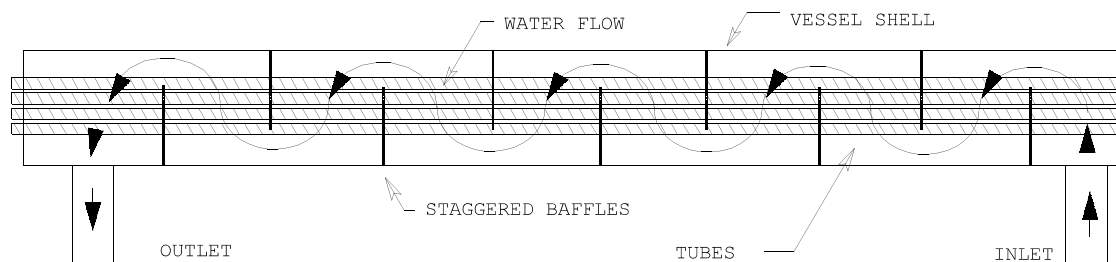


**Figure 1** Typical Reciprocal Baffle System

**Failure Mechanisms:** The principle problems we have found are Baffle Wear and Under Baffle Corrosion. The wear results from the tube vibrating in the baffles and is predominate around the perimeter of the bundle. Under Baffle Corrosion is due to poor or non-existent water treatment, and is most likely galvanic in nature.


Tubes removed from a York YCWZ88 Reciprocal showed Grooves and Pitting. It was noted that the baffles used in this unit were 1/8 inch thick but the grooves were 1/16 inches wide. See Figures 2 through 5.

The tubes used in this document have a .020 wall, but can be ordered with a .025 or .028. These tubes were tested at 36KHz. Even at this high frequency there was a large separation between the OD Grooves and the 100% through hole milled into the calibration standard. See Figure 5. The calibration standard used was an exact match to the tubes tested. It contained OD Grooves ranging from 20% to 55%.


*When inspecting units containing these tubes you must prepare a "Phase Chart" and evaluate damage, if found, on the differential channel. Significant grooving at a baffle can appear minor. However, as can be seen in Figures 6 through 8 the damage can be quite significant. The tubes shown here are actual tubes removed from a failed unit. As can be seen the phase angles appear minor until compared to a phase chart. See Figure 9.*

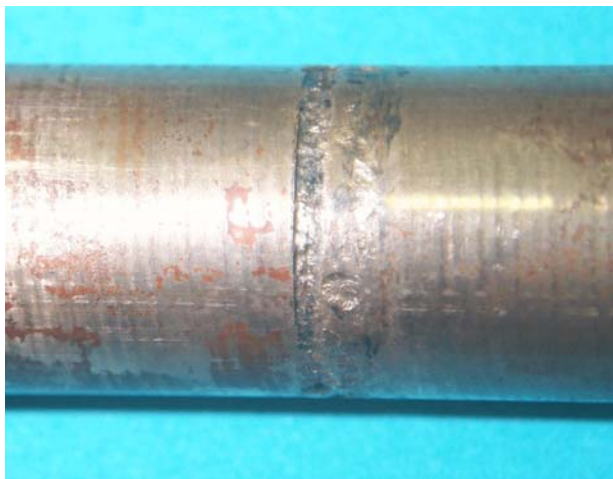


**Figure 2** 5% - 10% Groove

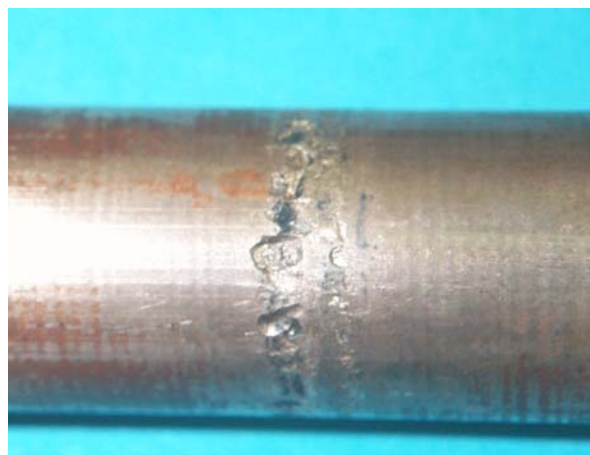


**Figure 3** 58% Pitting Under Baffle

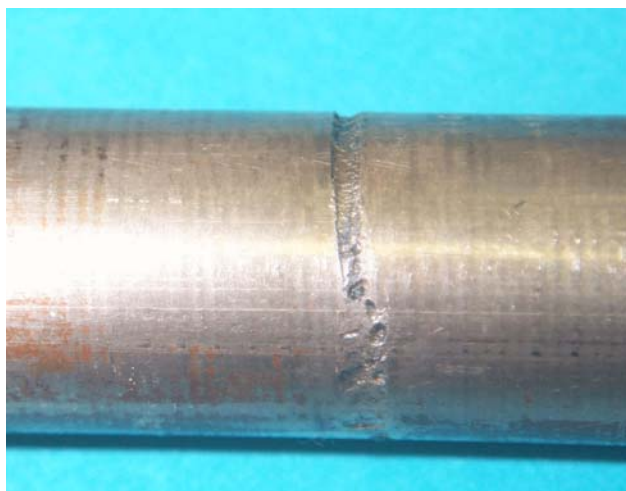


**Figure 4** 62% Groove Under Baffle

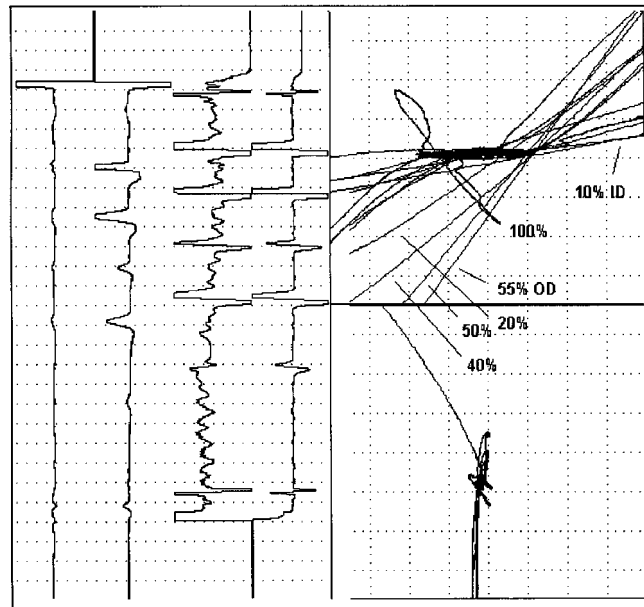

**Figure 5**  
 .620 x .020 PSIE Copper Calibration Standard

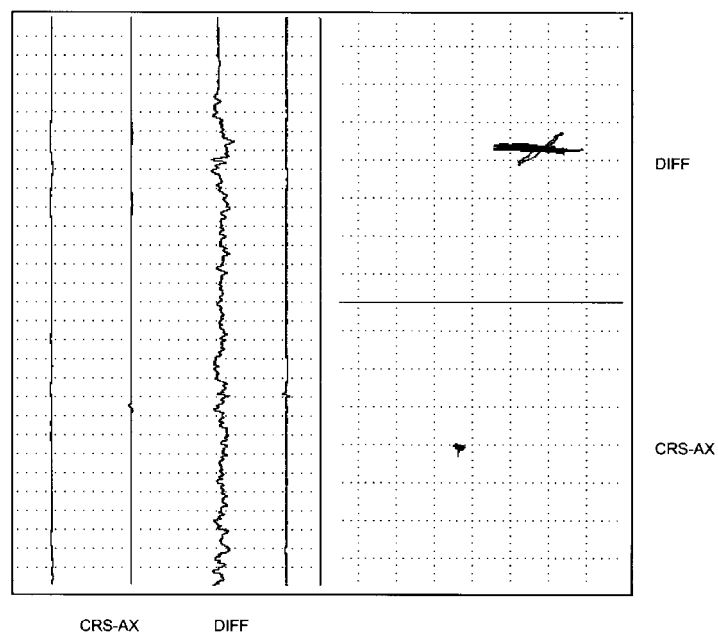


**Figure 6**  
 5% Baffle Wear

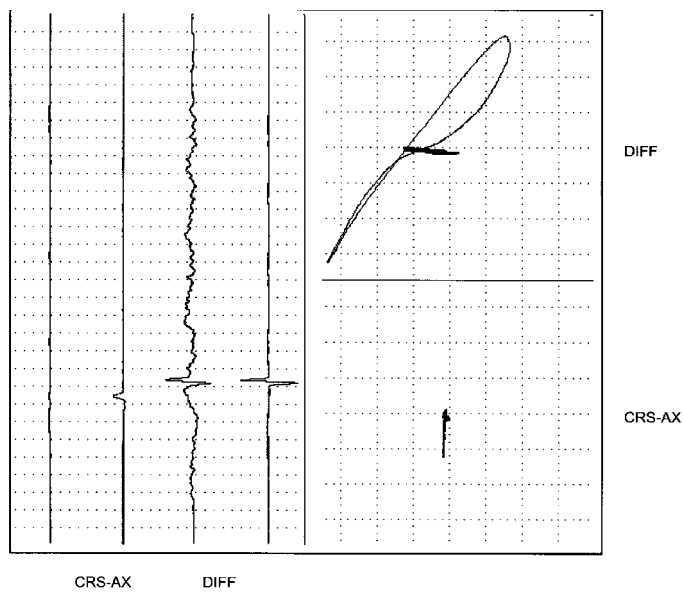


**Figure 7**

58% OD Groove

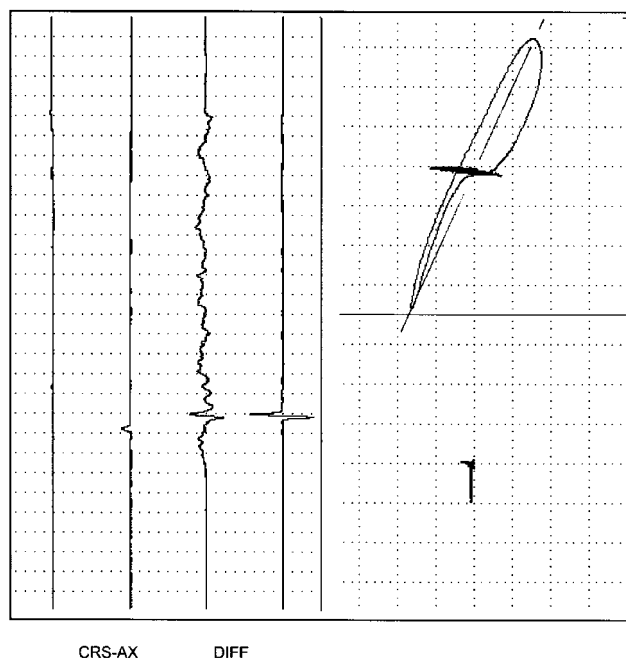

**Figure 8**

62% OD Groove

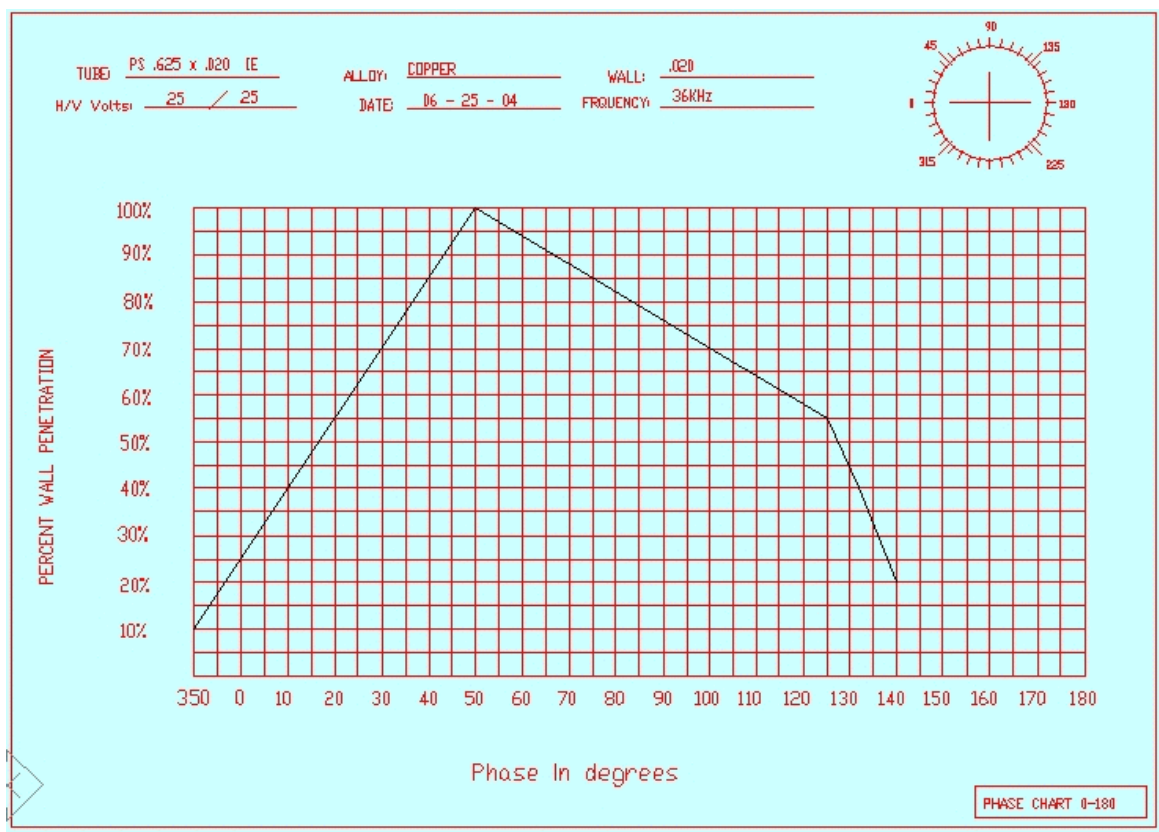


**Figure 9** Phase Chart for .625 x .020 IE Copper Tube





This bulletin discusses failure mechanisms of the internally enhanced .625 x .020 prime surface, internally enhanced tubes. These tubes can be found with .020, .025 or .028 walls. They are commonly used in evaporators of reciprocal chillers. These systems usually have the refrigerant on the inside of the tubes and water flowing around the outside. A baffle system is used to force the water to circulate around and between the tubes for increased efficiency. See **figure 1**.

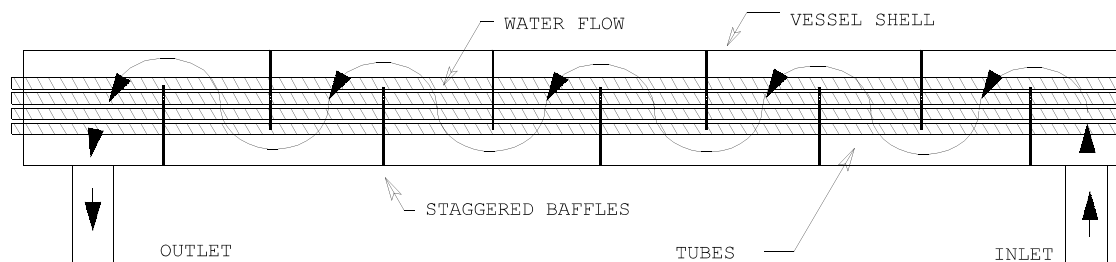


**Figure 1** Typical Reciprocal Baffle System

**Failure Mechanisms:** The principle problems we have found are Baffle Wear and Under Baffle Corrosion. The wear results from the tube vibrating in the baffles and is predominate around the perimeter of the bundle. Under Baffle Corrosion is due to poor or non-existent water treatment, and is most likely galvanic in nature.


Tubes removed from a York YCWZ88 Reciprocal showed Grooves and Pitting. It was noted that the baffles used in this unit were 1/8 inch thick but the grooves were 1/16 inches wide. See Figures 2 through 5.

The tubes used in this document have a .020 wall, but can be ordered with a .025 or .028. These tubes were tested at 36KHz. Even at this high frequency there was a large separation between the OD Grooves and the 100% through hole milled into the calibration standard. See Figure 5. The calibration standard used was an exact match to the tubes tested. It contained OD Grooves ranging from 20% to 55%.


*When inspecting units containing these tubes you must prepare a "Phase Chart" and evaluate damage, if found, on the differential channel. Significant grooving at a baffle can appear minor. However, as can be seen in Figures 6 through 8 the damage can be quite significant. The tubes shown here are actual tubes removed from a failed unit. As can be seen the phase angles appear minor until compared to a phase chart. See Figure 9.*

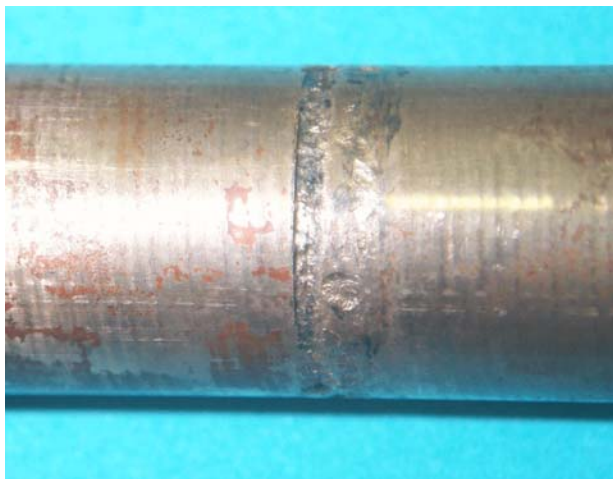


**Figure 2** 5% - 10% Groove

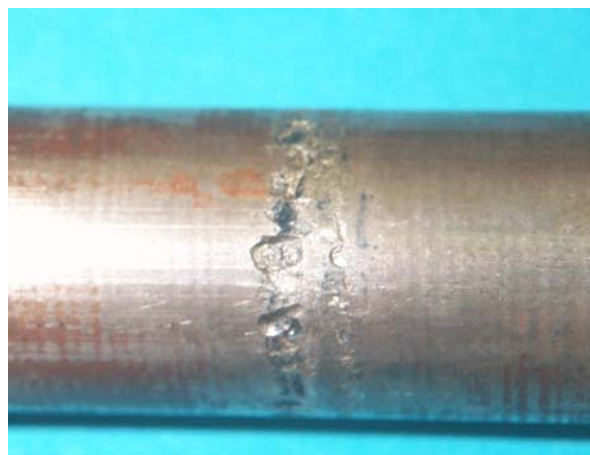


**Figure 3** 58% Pitting Under Baffle

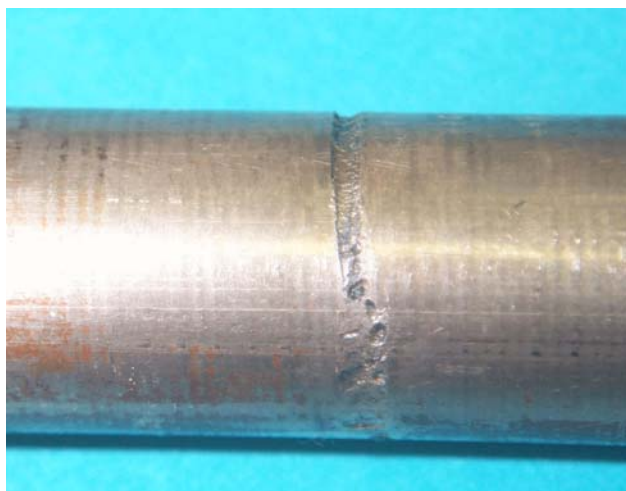


**Figure 4** 62% Groove Under Baffle

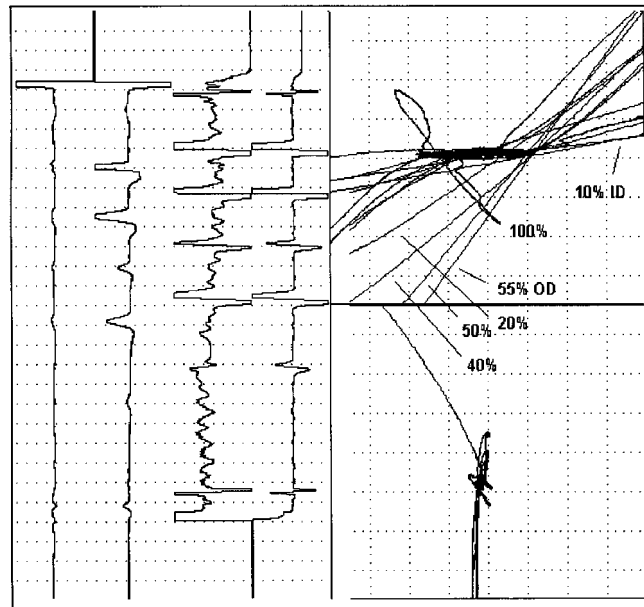

**Figure 5**  
 .620 x .020 PSIE Copper Calibration Standard

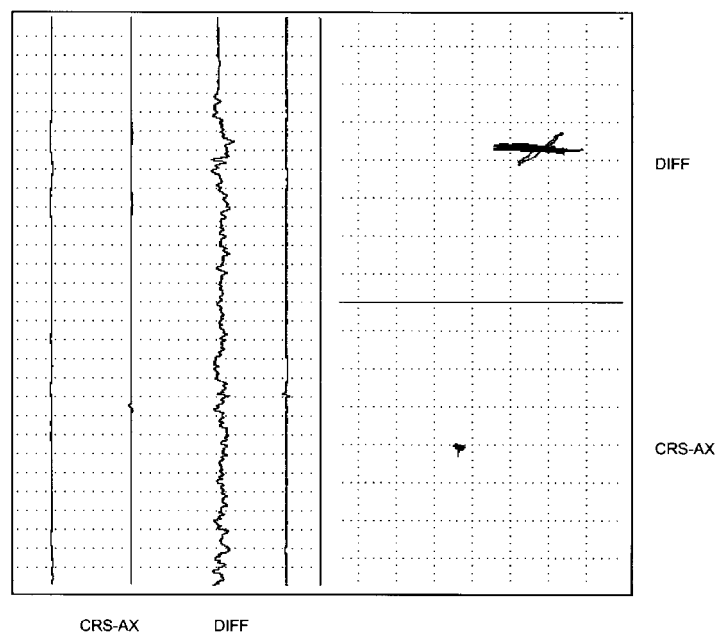


**Figure 6**  
 5% Baffle Wear

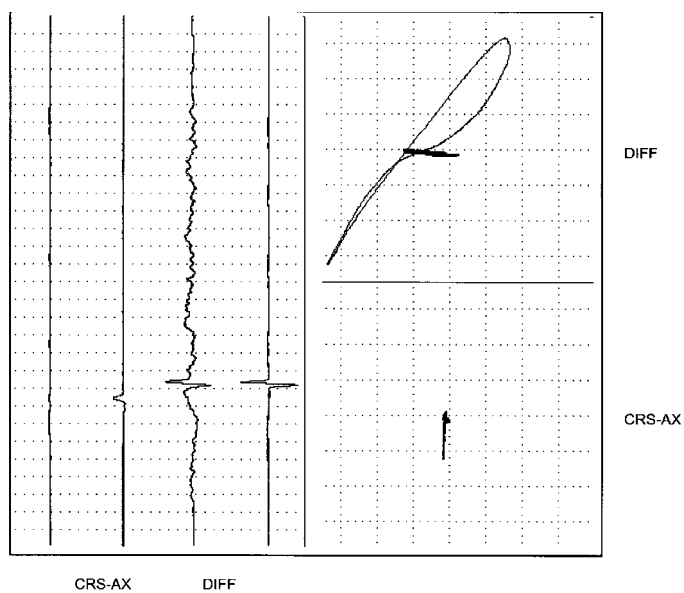


**Figure 7**

58% OD Groove

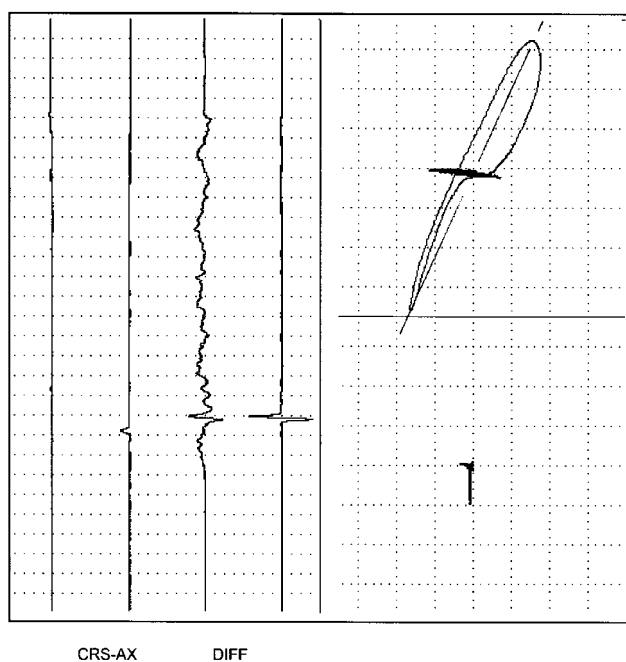

**Figure 8**


62% OD Groove

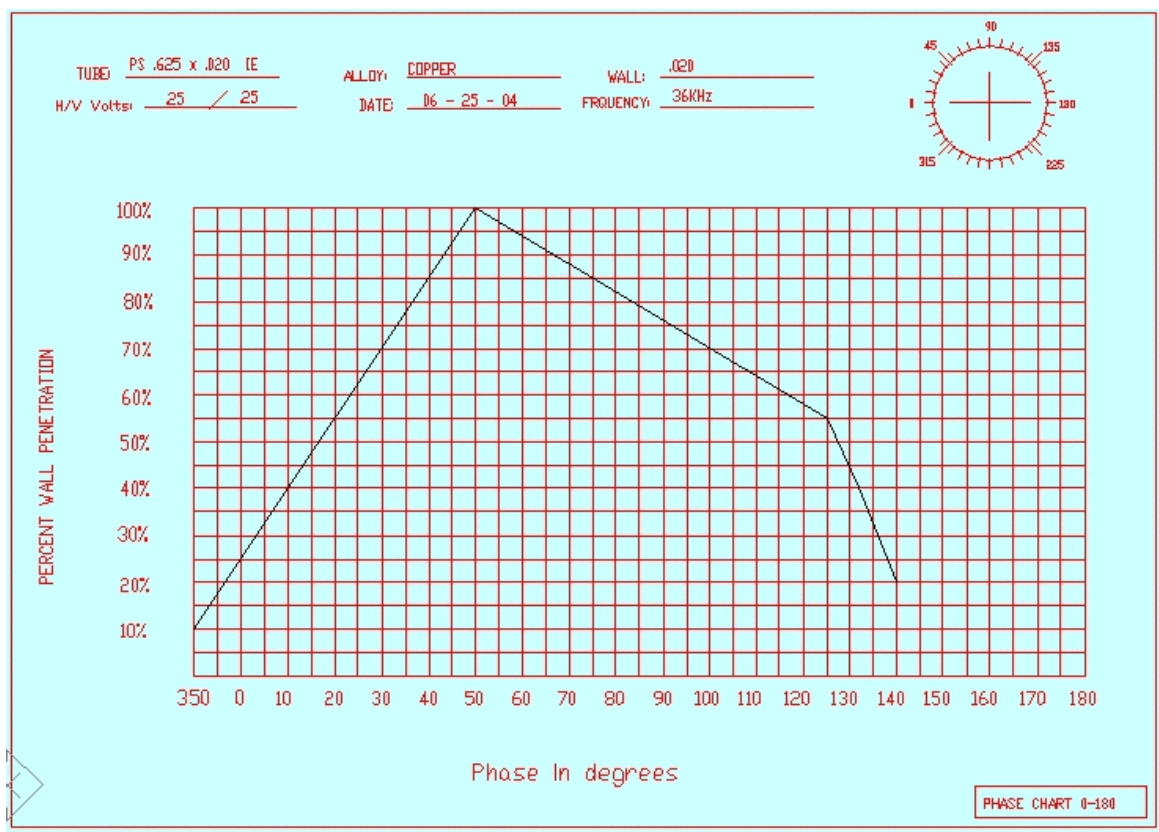

**Figure 9** Phase Chart for .625 x .020 IE Copper Tube



This bulletin discusses failure mechanisms of the internally enhanced .625 x .020 prime surface, internally enhanced tubes. These tubes can be found with .020, .025 or .028 walls. They are commonly used in evaporators of reciprocal chillers. These systems usually have the refrigerant on the inside of the tubes and water flowing around the outside. A baffle system is used to force the water to circulate around and between the tubes for increased efficiency. See **figure 1**.

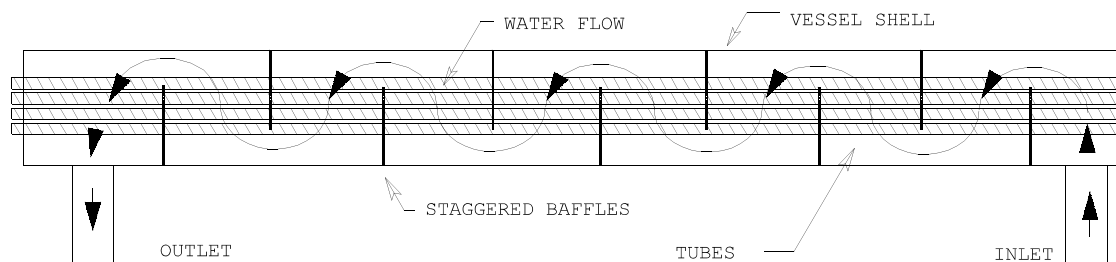


**Figure 1** Typical Reciprocal Baffle System

**Failure Mechanisms:** The principle problems we have found are Baffle Wear and Under Baffle Corrosion. The wear results from the tube vibrating in the baffles and is predominate around the perimeter of the bundle. Under Baffle Corrosion is due to poor or non-existent water treatment, and is most likely galvanic in nature.


Tubes removed from a York YCWZ88 Reciprocal showed Grooves and Pitting. It was noted that the baffles used in this unit were 1/8 inch thick but the grooves were 1/16 inches wide. See Figures 2 through 5.

The tubes used in this document have a .020 wall, but can be ordered with a .025 or .028. These tubes were tested at 36KHz. Even at this high frequency there was a large separation between the OD Grooves and the 100% through hole milled into the calibration standard. See Figure 5. The calibration standard used was an exact match to the tubes tested. It contained OD Grooves ranging from 20% to 55%.


*When inspecting units containing these tubes you must prepare a "Phase Chart" and evaluate damage, if found, on the differential channel. Significant grooving at a baffle can appear minor. However, as can be seen in Figures 6 through 8 the damage can be quite significant. The tubes shown here are actual tubes removed from a failed unit. As can be seen the phase angles appear minor until compared to a phase chart. See Figure 9.*

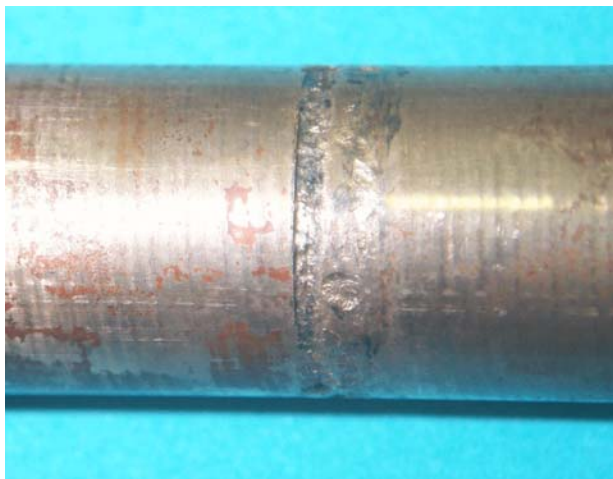

**Figure 2** 5% - 10% Groove

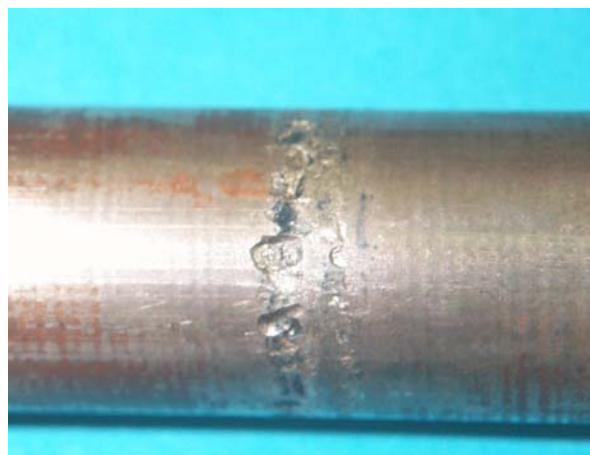


**Figure 3** 58% Pitting Under Baffle

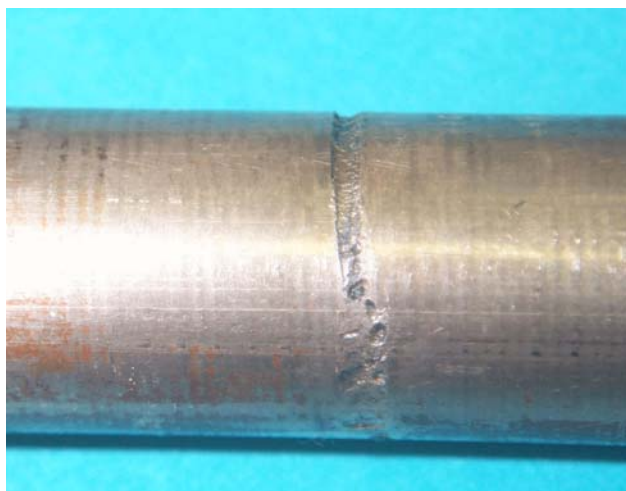


**Figure 4** 62% Groove Under Baffle




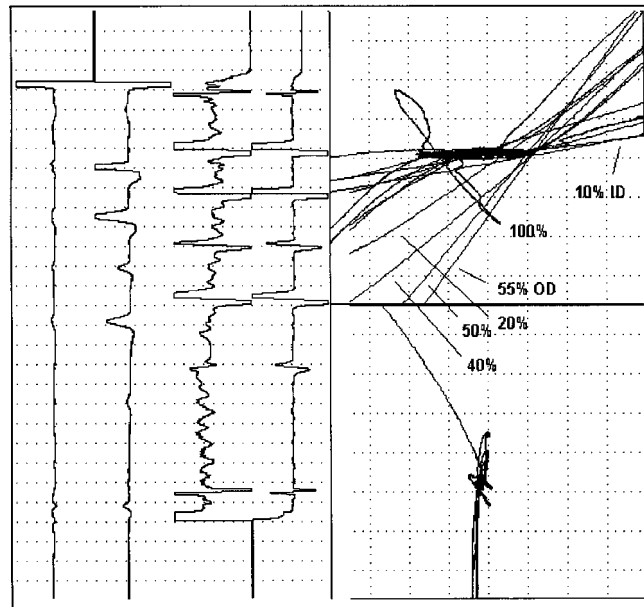

**Figure 5**  
 .620 x .020 PSIE Copper Calibration Standard

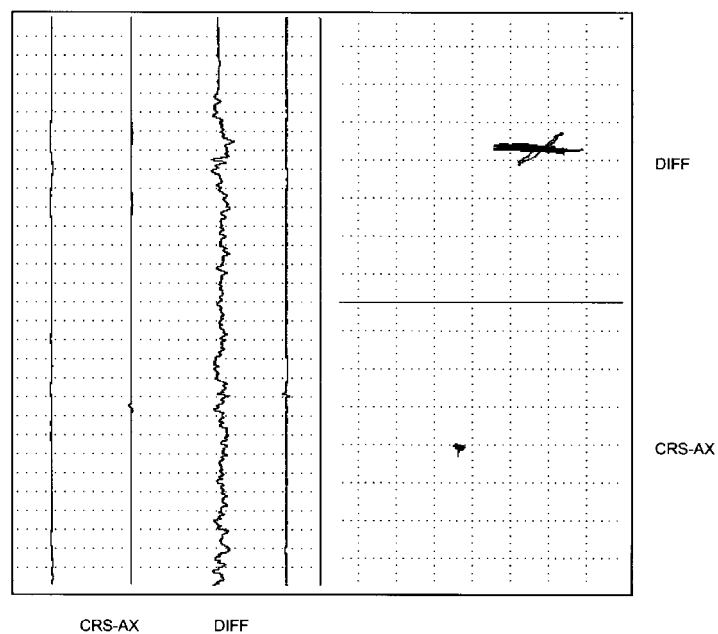


**Figure 6**  
 5% Baffle Wear

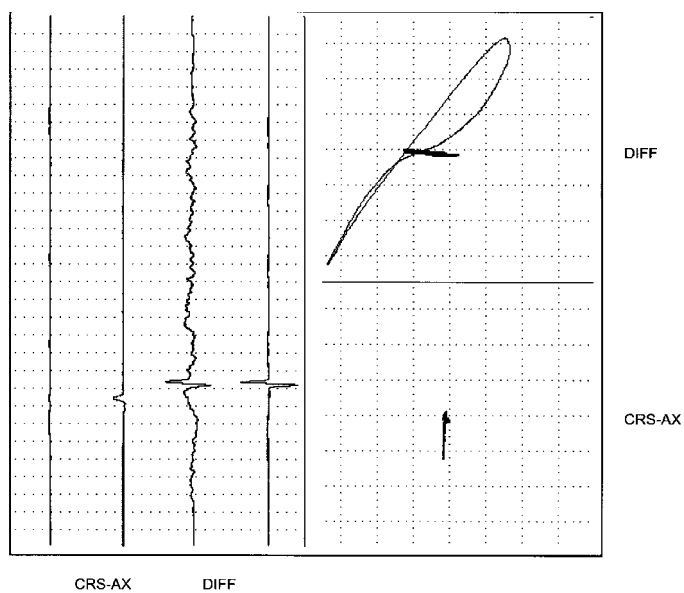


**Figure 7**

58% OD Groove

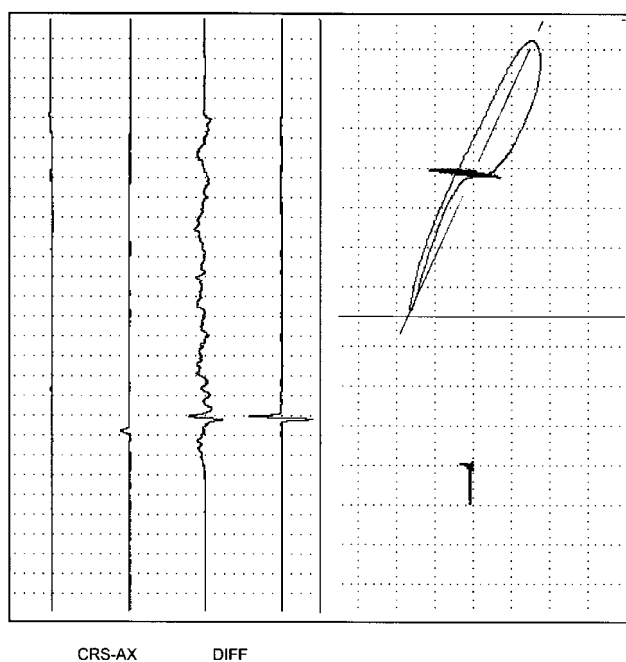

**Figure 8**

62% OD Groove

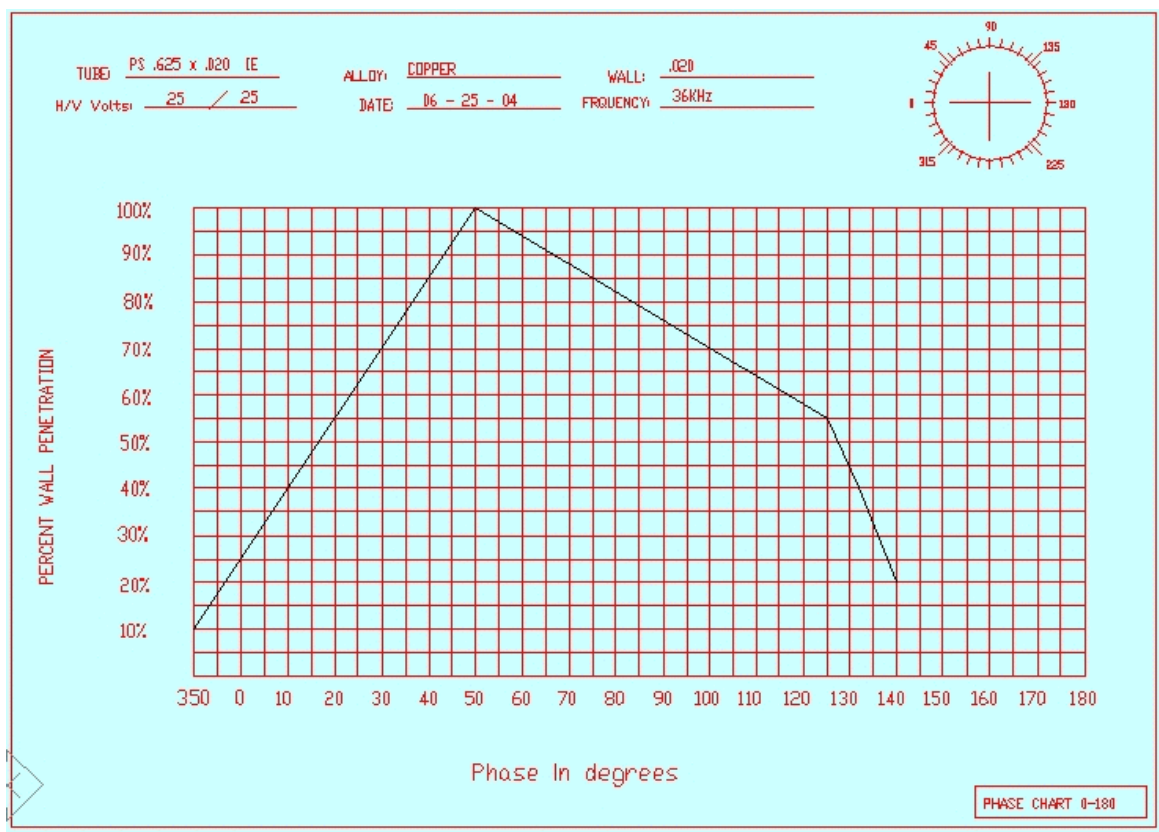

**Figure 9** Phase Chart for .625 x .020 IE Copper Tube

