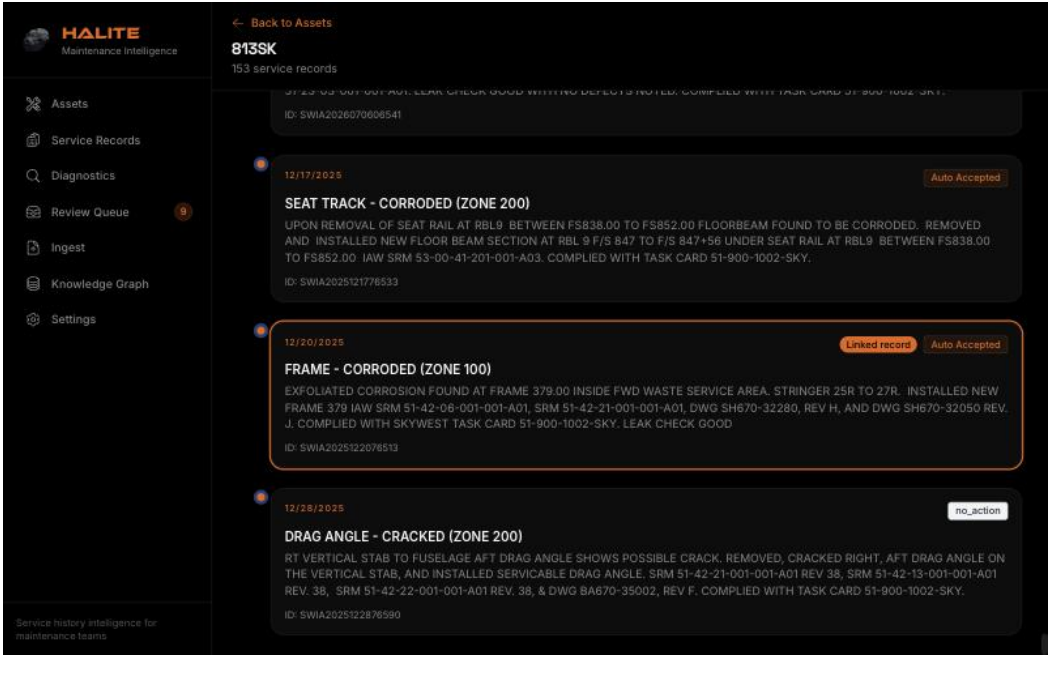

HALITE
Maintenance Intelligence
Assets
Service Records
Diagnostics
Review Queue
9
Ingest
Knowledge Graph
Settings
Service history intelligence for maintenance teams
← Back to Assets
813SK
153 service records
ID: SWIA2026070606541
12/17/2025
Auto Accepted
SEAT TRACK - CORRODED (ZONE 200)
UPON REMOVAL OF SEAT RAIL AT RBL9 BETWEEN FS838.00 TO FS852.00 FLOORBEAM FOUND TO BE CORRODED. REMOVED AND INSTALLED NEW FLOOR BEAM SECTION AT RBL 9 F/S 847 TO F/S 847+56 UNDER SEAT RAIL AT RBL9 BETWEEN FS838.00 TO FS852.00 IAW SRM 53-00-41-201-001-A03. COMPLIED WITH TASK CARD 51-900-1002-SKY.
ID: SWIA2025121776533
12/20/2025
Linked record
Auto Accepted
FRAME - CORRODED (ZONE 100)
EXFOLIATED CORROSION FOUND AT FRAME 379.00 INSIDE FWD WASTE SERVICE AREA. STRINGER 25R TO 27R. INSTALLED NEW FRAME 379 IAW SRM 51-42-06-001-001-A01, SRM 51-42-21-001-001-A01, DWG SH670-32280, REV H, AND DWG SH670-32050 REV. J. COMPLIED WITH SKYWEST TASK CARD 51-900-1002-SKY. LEAK CHECK GOOD
ID: SWIA2025122076513
12/28/2025
no_action
DRAG ANGLE - CRACKED (ZONE 200)
RT VERTICAL STAB TO FUSELAGE AFT DRAG ANGLE SHOWS POSSIBLE CRACK. REMOVED, CRACKED RIGHT, AFT DRAG ANGLE ON THE VERTICAL STAB, AND INSTALLED SERVICABLE DRAG ANGLE. SRM 51-42-21-001-001-A01 REV 38, SRM 51-42-13-001-001-A01 REV. 38, SRM 51-42-22-001-001-A01 REV. 38, & DWG 8A670-35002, REV F. COMPLIED WITH TASK CARD 51-900-1002-SKY.
ID: SWIA2025122876590