IP-65 Error codes 163, 164 (pg 1 of 4) EC-163: NRMSE too large EC-164: Cor. Coef. low Start Perform MEIA Performance Panel Verify that Syringe Run (VP-47) using a different lot Retainer is properly Inspect Reaction Cells number of Reaction Cells. secured (PL-5). on Carousel used when the error occurred. Problem Νo Fluid resolved Error Yes has pooled 164 Yes on top of the Yes

2 Troubleshooting IP-65: Error codes 163, 164 2 - 160 LCx® Analyzer Service Manual (Text P/N 47278-102)

No.

Matrix


Nο

Chapter Manual CD Main Index Contents Contents Screen

Normal operation

IP65-1.vsd


IP-65 (pg 2 of 4)

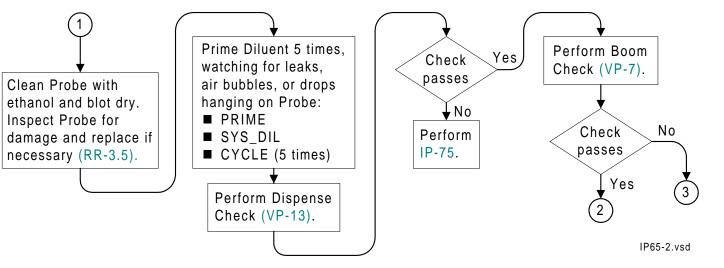

2 Troubleshooting IP-65: Error codes 163, 164 2 - 161 LCx® Analyzer Service Manual (Text P/N 47278-102)


Chapter Manual Contents Contents	CD Main Screen	Index
----------------------------------	-------------------	-------

IP-65 (pg 3 of 4)

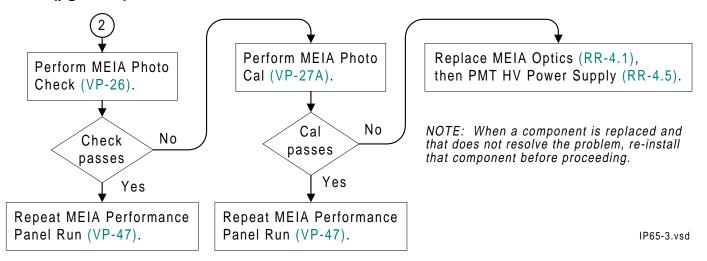

2 Troubleshooting IP-65: Error codes 163, 164 2 - 162 LCx® Analyzer Service Manual (Text P/N 47278-102)

Chapter Manual Contents Contents	CD Main Screen	Index
----------------------------------	-------------------	-------

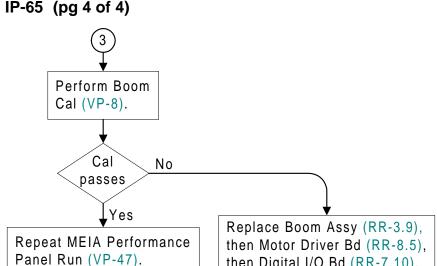

then Digital I/O Bd (RR-7.10).

2 Troubleshooting IP-65: Error codes 163, 164 2 - 163 LCx[®] Analyzer Service Manual (Text P/N 47278-102)

Chapter Manual Contents Contents	CD Main Screen	Index
----------------------------------	-------------------	-------