

IP-17 Error code 36 (pg 1 of 7) EC-36 Carousel load error



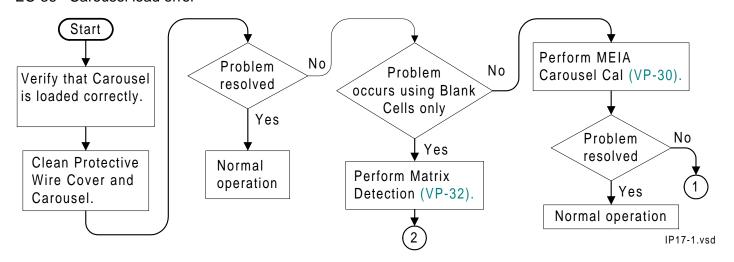


2 Troubleshooting	IP-17: Error code 36	2 - 73
LCx [®] Analyzer Service Manual (Text P/N 47278-102)		

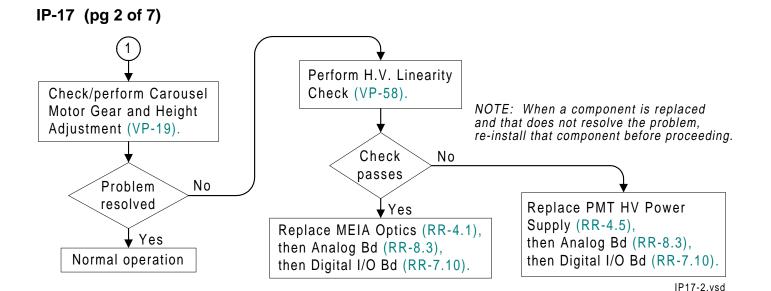

2 Troubleshooting IP-17: Error code 36 2 - 74 LCx® Analyzer Service Manual (Text P/N 47278-102)

Chapter	Manual	CD Main	Index
Contents	Contents	Screen	


IP-17 (pg 3 of 7)

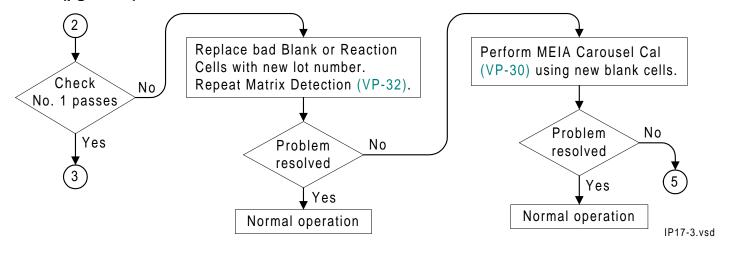


2	Troubleshooting	IP-17: Error code 36	2 - 75
	LCx [®] Analyzer Service Manual (Text P/N 47278-102)		

Chapter Manual Contents Contents	CD Main Screen	Index
----------------------------------	-------------------	-------


IP-17 (pg 4 of 7)

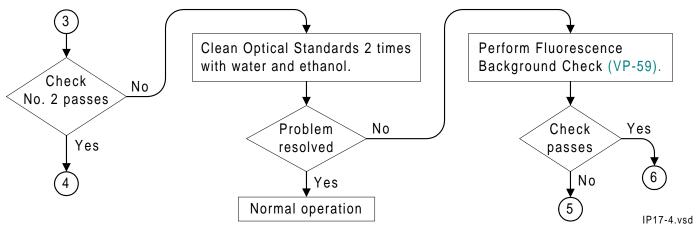



Chapter Manua Contents Conter		Index
----------------------------------	--	-------

IP-17 (pg 5 of 7)

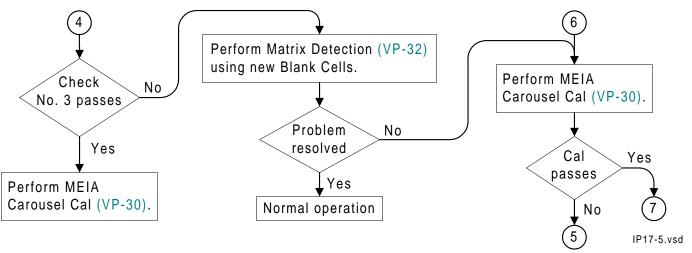

Troubleshooting	IP-17: Error code 36	2 - 77
LCx [®] Analyzer Service Manual (Text P/N 47278-102)		

Chapter Manua Contents Conter		Index
----------------------------------	--	-------


Perform H.V. Linearity Check (VP-58). Clean carousel gear and Protective Wire Cover with distilled water and alcohol. (May need to clean Protective Wire Cover more than once.) Clean MEIA Optics lens.

then Analog Bd (RR-8.3), then Digital I/O Bd (RR-7.10).

Replace PMT HV Power Supply (RR-4.5),

IP17-6.vsd

2	Troubleshooting	IP-17: Error code 36	2 - 78
	LCx® Analyzer Service Manual (Text P/N 47278-102)		

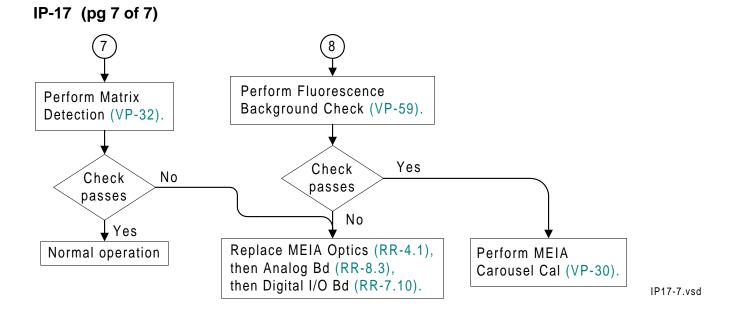



Chapter Manual Contents Contents	CD Main Screen	Index	
----------------------------------	-------------------	-------	--