


Battery Charging Instructions

The batteries are to be charged using the power supply which must either be connected to the Lab Bench supply or a feasible supply;

The supply voltage should NOT exceed 17.9V

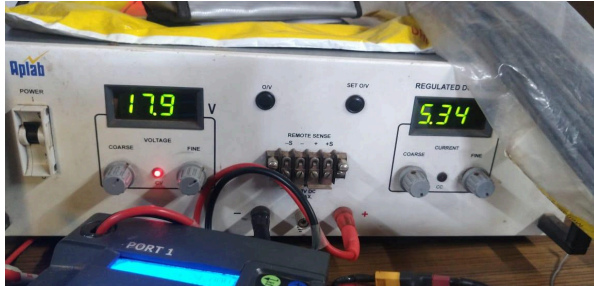


Always check the voltage before plugging the charger into the Lab bench supply and set the current limit to maximum (The photo shows this much current when it is charging the batteries, otherwise without any battery, it draws 0.35A)

Connect Red of the charger to Red of the supply and Black to black






PROCEDURE FOR CHARGING:




1. Connect the xt60 to banana (Further Referred to as X2B) connector to the supply by connecting Red to Red and Black to Black

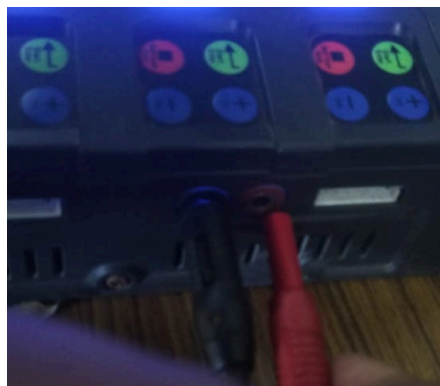

2. Take the battery and connect the white connector (Further referred to as balance connector) into the same port as the X2B in the charger in the correct orientation, be aware that it is polarity protected and will be connected to the charger only with the notch upwards making sure ground is rightmost and highest voltage is leftmost

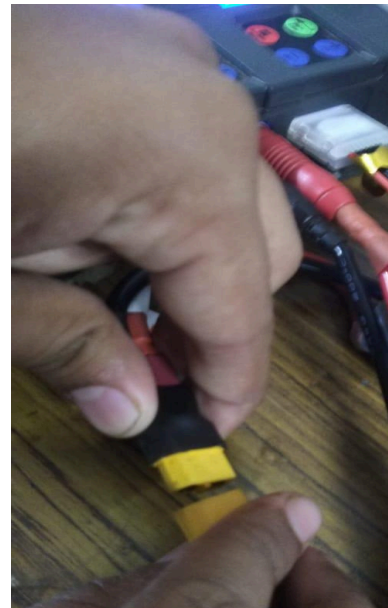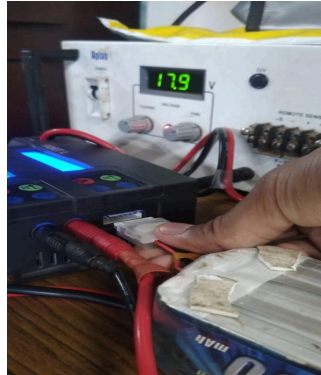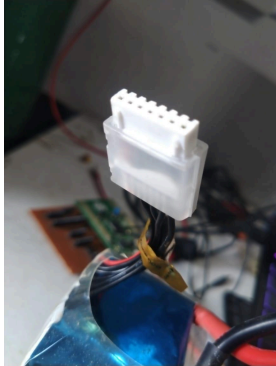


3. Connect the battery xt60 to X2B and set the method of charging to LiPo balance
4. Limit the current based on power supply and battery, the Lab bench Supply cannot handle more than 5.5A at once, so you can set the balance charging current at 2A for one battery and 1.6A for the second battery

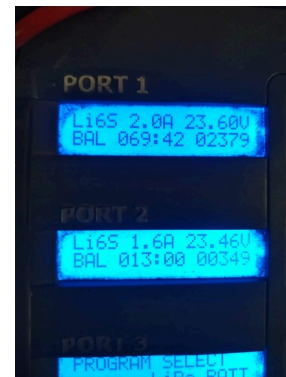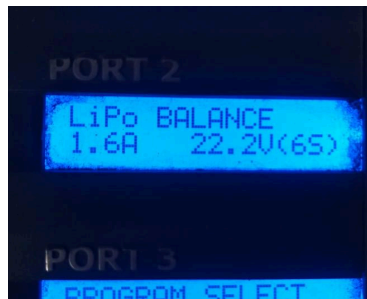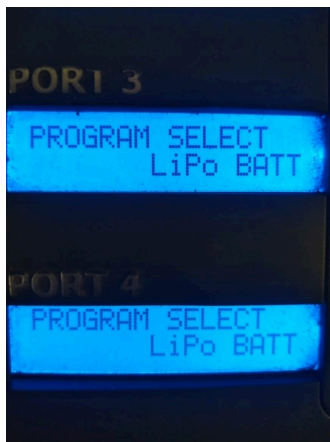



5. Set the battery voltage to 6S and hold the start button for 3 seconds to start charging, the charger will ask for confirmation with number of cells in series (6); press enter



6. Keep an eye on the battery every now and then, if the battery is charged or there is a connection break the charger will give out continuous beeps, in case of a full battery, it will show the same screen as the charging screen with a voltage of 25.2V and a current of 0A, and the Li6s will be alternating with full

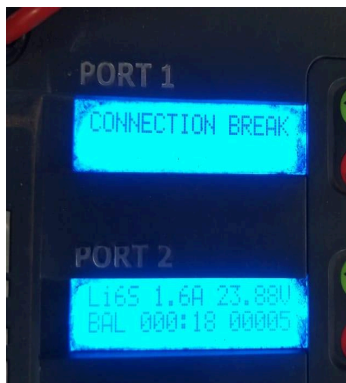

7. In case of a connection break, check the connections or reduce the charging current and restart charging (follow steps 4 to 6)
8. To remove the battery, first disconnect the balance connector then remove the yellow connectors, they require some force to disconnect but they can be removed safely, do **NOT** remove the X2B from the charger with the battery xt60 connected to the X2B

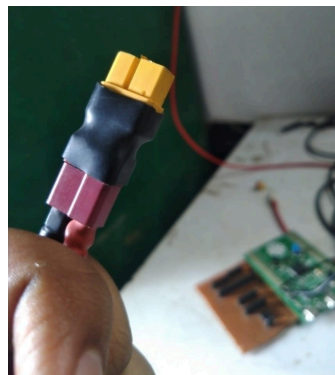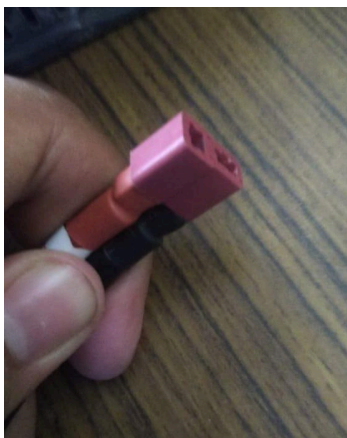

9. In case the xt60 cannot be disconnected, first remove the deans connector, remove the X2B and then the xt60

CONSEQUENCES

The battery is very powerful and can be dangerous if it shorts, a maximum of 225A can flow through at once as its the max capability of the battery it can melt steel and other metals

