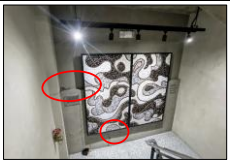
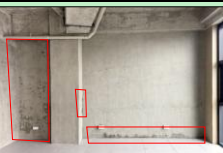
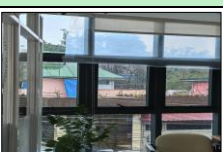
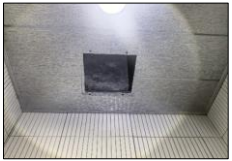
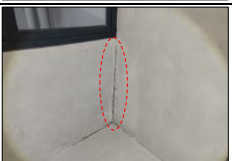


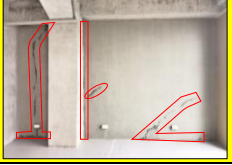
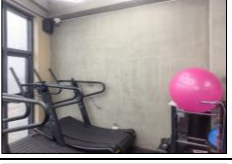
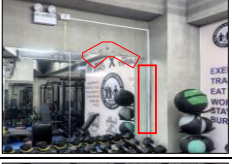
 FCLARANANG DEVELOPMENT CORPORATION #181 Spring Water Street, Crystal Gate, Baguio City TEL. #: (074) 442-3489 TELEFAX #: (074) 442-3488	LEAK TRACING & RECTIFICATION LOG (as of August 31, 2026)	Doc. Code : _____ Rev. No. : _____ Eff. Date : _____ Page : _____
---	--	---

No.	Date	Leak ID	Area/ Location (Picture)	Identified Finding / Observation	Possible/ Identified Source	Required Rectification Procedure	Rectification/Corrective Action	Responsible/ Verification Conducted	Remarks/Date Closed	Current Status	Recurrence Date
1	46240	L01-3B		Water leak detected on the wall	Cracks from past quake may be present.	Inject epoxy into identified cracks to restore integrity	Application of injection packer. For continuation of PU injection	DEV.CORP/ QAQC/BM		Ongoing	N/A
2	46240	L02-2B		Water leak detected on the wall	Cracks from past quake may be present.	Inject epoxy into identified cracks to restore integrity	Application of injection packer. For continuation of PU injection	DEV.CORP/ QAQC/BM		Ongoing	N/A
3	8/10/2026	L03-(2B-3B)		Water seepage observed at wall & corners	Cracks from past quake may be present on wall surface and wall connection.	Inject PU foam on visible wall cracks.	Application of injection packer. For continuation of PU injection	DEV.CORP/ QAQC/BM		Ongoing	N/A
4	46244	L04-(1B-2B)		Water seepage observed at wall & corners	Cracks from past quake may be present on wall surface and wall connection.	Inject PU foam on visible wall cracks.		DEV.CORP/ QAQC/BM		Ongoing	N/A
5	8/10/2026	L05-(G-1B)		Water seepage observed at wall & corners	Cracks from past quake may be present on wall surface and wall connection.	Inject PU foam on visible wall cracks.		DEV.CORP/ QAQC/BM		Open- New Leak	N/A
6	8/10/2026	L06-(G-2)		Water seepage observed at wall & corners	Cracks from past quake may be present on wall surface and wall connection.	Inject PU foam on visible wall cracks.		DEV.CORP/ QAQC/BM		Open- New Leak	N/A

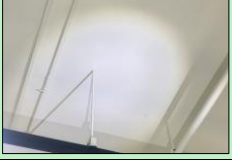
7	8/8/2026	L07-(2-3)		Water seepage observed at wall & corners	Cracks from past quake may be present on wall surface and wall connection.	Inject PU foam on connections or visible cracks,		DEV.CORP/ QAQC/BM		Open- New Leak	N/A
8	7/7/2026	L08-301		Water leakage/droplets was identified that is coming from the tip of the vertical frame (Big mullion)	1.Possible unseen Aluminum Panel crack, Sealant failure/debonding/crack 2.Possible leakage from upper floors directly impacts the area due to frame interconnection.	1.Conduct detailed inspection, 2. Replace all defective/cracked silicone sealant or ACP panel		DEV.CORP/ QAQC/BM		Open- New Leak	N/A
9	8/3/2026	L09-301		Water seepage observed at wall to floor connection	Cracks from past quake may be present on wall surface and wall connection.	1.For expedited rectification, inject PU foam to visible wall cracks, 2.Inspect exterior walls and seal all cracks or apply water proofing	Visible water seepage was treated through PU foam injection	DEV.CORP/ QAQC/BM	Aug. 22, 2026	continuous monitoring	N/A
10	9/17/2025	L10-302		Visible Water ingress at the awning window	Misalignment or improper positioning of the window frame/ 4 bars hinge allowing water ingress.	Inspect the window frame alignment and perimeter gap. Correct the window alignment and reposition where necessary.	Awning window adjusted; silicone sealant reapplied on aluminum frame corners before reinstallation.	RFJ/ QAQC/BM	No leak detected during leak testing 10/17/2025	Closed	N/A
11	7/7/2026	L11-302		Water is flowing down from the vetical Mullion frames	Possible unseen Aluminum Panel crack. Inadequate adhesion or improper application of silicon sealant	Conduct detailed inspection for possible ACP cracks, damaged or adhesion failure of applied silicone sealant. Replace all damaged or defective silicone sealant	ACP panels were dismantled, crack inspection performed, reinstalled after verification. 7/29/2026	RFJ/ QAQC/BM	For monitoring and observation of potential recurring leak sources.	Under monitoring	8/11/2025
12	8/6/2026	L12-302		Vissible water ingress flowing from the curtain wall frame	1.Possible unseen Aluminum Panel crack, Sealant failure/debonding/crack 2.Possible leakage from upper floors directly impacts the area due to frame interconnection.	1.Conduct detailed inspection, 2. Replace all defective/cracked silicone sealant or ACP panel		RFJ/ QAQC/BM		Open- New Leak	N/A
13	8/8/2026	L13-(3-4)		Water seepage observed at wall & corners	Likely due to defective waterproofing at wall-to-floor interface and micro cracks on walls	1.For expedited rectification, inject PU foam to visible wall cracks, 2.Inspect exterior walls and seal all cracks or apply water proofing		Dev.Corp/ QAQC/BM		Open- New Leak	N/A
14	8/8/2026	L14-401		Water seepage observed at wall & corners	Cracks from past quake may be present on wall surface and wall connection.	1.For expedited rectification, inject PU foam to visible wall cracks, 2.Inspect exterior walls and seal all cracks or apply water proofing	Visible water seepage was treated through PU foam injection	Dev.Corp/ QAQC/BM	Aug. 18, 2026	continuous monitoring	N/A

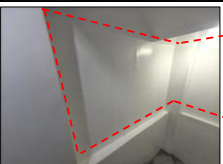
15	8/8/2026	L15-401		Water seepage observed at beam & wall corner	Cracks from past quake may be present on wall surface and wall connection.	1.For expedited rectification, inject PU foam to visible wall cracks, 2.Inspect exterior walls and seal all cracks or apply water proofing		Dev.Corp/ QAQC/BM		Open- New Leak	N/A
16	10/4/2025	L16-401		Traces of leaks on frames joints, blind rivets	Possible unseen Aluminum Panel crack. Inadequate adhesion or improper application of silicon sealant. Possible from upper floor due to the mullion frames are aligned with each other.			RFJ/ QAQC/BM	No leak detected during leak testing @ 10/13/2025 & 12/2/2025	Reopened	7/7/2026
17	10/4/2025	L17-402		Traces of leaks on frames joints, blind rivets	Possible unseen Aluminum Panel crack. Inadequate adhesion or improper application of silicon sealant. Possible from upper floor due to the mullion frames are aligned with each other.		ACP panels were dismantled, crack inspection performed, reinstalled after verification.	RFJ/ QAQC/BM 25 mins. Leak test using Water Pressure Spray	No leak detected during leak testing 11/19/2025	Reopened	8/10/2026
18	9/17/2025	L18-403		Water seepage observed at wall corner	Sealant failure at window frame suspected, with contributing factor of unsealed aluminum frame inside corners.		Silicone sealant was applied inside the window frame corners, and outside window frame sealant was repaired. 10/4/2025	RFJ/QAQC/BM No conducted leak testing to validate effectiveness of the rectification procedure	No leaks were observed following rainfall after the repair	Closed	N/A
19	11/11/2025	L19-(4-5)		Water seepage observed at wall-beam/column connection	Likely due to defective waterproofing at wall-to-floor interface		PU Foam was injected at the wall-col/beam connections 11/17/2025	RFJ/QAQC/BM No conducted leak testing to validate effectiveness of the rectification procedure	No leaks were observed following rainfall after the repair	Reopened	8/10/2026
20	11/11/2025	L20-407		Water seepage observed at wall corner	Sealant failure at window frame suspected, with contributing factor of unsealed aluminum frame inside corners.		Silicone sealant was applied in between the window frame corners, and outside window frame sealant was repaired. 11/14/2025	RFJ/QAQC/BM No conducted leak testing to validate effectiveness of the rectification procedure	No leaks were observed following rainfall after the repair	Reopened	8/10/2026
21	11/11/2025	L21-501		Traces of leaks on frames joints, blind rivets	Possible unseen Aluminum Panel crack. Inadequate adhesion or improper application of silicon sealant. Possible from unit 602 due to water entered at the opened window and dripped and seeped on the floor.		ACP panels were dismantled, crack inspection performed, reinstalled after verification.	RFJ/ QAQC/BM 25 mins. Leak test using Water Pressure Spray	No leak detected during leak testing 11/19/2025	Reopened	8/10/2026
22	9/17/2025	L22-502		Water seepage observed at wall corner	Sealant failure at window frame suspected, with contributing factor of unsealed aluminum frame inside corners.		Silicone sealant was applied in between the window frame corners, and outside window frame sealant was repaired. (10/4/2025)	RFJ/QAQC/BM No conducted leak testing to validate effectiveness of the rectification procedure	No leaks were observed following rainfall after the repair	Closed	N/A

23	11/11/2025	L23-503		Traces of leaks on corner frames & rivets	Possible sealant failure and cracks on ACP		ACP panels were dismantled, crack inspection performed, reinstalled after verification.	RFJ/ QAQC/BM 25 mins. Leak test using Water Pressure Spray	No leak detected during leak testing	Reopened	7/7/2026
24	9/17/2025	L24-504		Water seepage observed at wall surface	Sealant failure at window frame suspected, with contributing factor of unsealed aluminum frame inside corners.		Silicone sealant was applied inside window frame corners, and outside window frame sealant was removed and replaced. 10/4/2025	RFJ/QAQC/BM No conducted leak testing to validate effectiveness of the rectification procedure	No leaks were observed following rainfall after the repair	Closed	N/A
25	9/17/2025	L25-505		Water seepage observed at wall corner	Sealant failure at window frame suspected, with contributing factor of unsealed aluminum frame inside corners.		Silicone sealant was applied inside window frame corners, and outside window frame sealant was removed and replaced. 10/4/2025	RFJ/QAQC/BM No conducted leak testing to validate effectiveness of the rectification procedure	No leaks were observed following rainfall after the repair	Under monitoring	N/A
26	9/17/2025	L26-505		Water seepage observed at wall corner	Sealant failure at window frame suspected, with contributing factor of unsealed aluminum frame inside corners.		Silicone sealant was applied inside window frame corners, and outside window frame sealant was removed and replaced. 10/4/2025	RFJ/QAQC/BM No conducted leak testing to validate effectiveness of the rectification procedure	No leaks were observed following rainfall after the repair	Under monitoring	N/A
27	9/17/2025	L27-506		Water seepage observed at wall corner	Sealant failure at window frame suspected, with contributing factor of unsealed aluminum frame inside corners.		Silicone sealant was applied inside window frame corners, and outside window frame sealant was removed and replaced. 10/4/2025	RFJ/QAQC/BM No conducted leak testing to validate effectiveness of the rectification procedure	No leaks were observed following rainfall after the repair	Reopened	8/10/2026
28	9/17/2025	L28-506		Water seepage observed at wall corner	Sealant failure at window frame suspected, with contributing factor of unsealed aluminum frame inside corners.		Silicone sealant was applied inside window frame corners, and outside window frame sealant was removed and replaced. 10/4/2025	RFJ/QAQC/BM No conducted leak testing to validate effectiveness of the rectification procedure	No leaks were observed following rainfall after the repair	Reopened	8/10/2026
29	11/11/2025	L29-507		Water seepage observed at wall corner	Suspected sealant failure at window frame and at the drop wall connections, also possible wall cracks		Silicon sealant was reapplied on the aluminum frame perimeter including the connection of drywalls, concrete wall was applied with waterproofing.	RFJ/QAQC/BM No conducted leak testing to validate effectiveness of the rectification procedure	No leak detected during leak testing for 25 mins. 10/4/2025	Reopened	8/10/2026
30	8/10/2026	L30-507		Water seepage observed at wall-floor connection	Possible failure of the applied waterproofing at the wall-beam connections and possible cracks on wall-beam joints at exterior side	1.For expedited rectification, remove wall tiles and inject PU Foam on wall-floor connection or on visible cracks 2.Inspect exterior walls and seal all cracks or apply water proofing		Dev.Corp/ QAQC/BM		New Leak	N/A

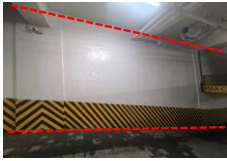
31	8/8/2026	L31-(5-6)		Water seepage observed at wall & corners	Likely due to defective waterproofing at wall-to-floor interface and micro cracks on walls	1.For expedited rectification, inject PU foam to visible wall cracks, 2.Inspect exterior walls and seal all cracks or apply water proofing		Dev.Corp/ QAQC/BM		New Leak	N/A
32	9/17/2025	L32-601		Traces of leaks on corner frames & rivets	Possible sealant failure and cracks on ACP		ACP panels were dismantled, crack inspection performed, reinstalled after verification.	RFJ/ QAQC/BM 25 mins. Leak test using Water Pressure Spray	No leak detected during leak testing @ 10/8/2025 & 11/17/2025	Reopened	7/7/2026
33	8/8/2026	L33-601		Water seepage observed at wall surface	Cracks from past quake may be present on wall surface and wall connection.	1.For expedited rectification, inject PU foam to visible wall cracks, 2.Inspect exterior walls and seal all cracks or apply water proofing	Visible water seepage was treated through PU foam injection	Dev.Corp/ QAQC/BM	Aug. 18, 2026	continuous monitoring	N/A
34	11/11/2025	L34-602		Traces of leaks on corner frames & rivets	Possible sealant failure and cracks on ACP		ACP panels were dismantled, crack inspection performed, reinstalled after verification.	RFJ/ QAQC/BM 25 mins. Leak test using Water Pressure Spray	No leak detected during leak testing 11/19/2025	Reopened	8/8/2026
35	8/6/2026	L35-602		Water seepage observed at wall-beam/column connection	Cracks from past quake may be present on wall surface and wall connection.	1.For expedited rectification, inject PU foam to visible wall cracks, 2.Inspect exterior walls and seal all cracks or apply water proofing		Dev.Corp/ QAQC/BM		Open- New Leak	N/A
36	8/6/2026	L36-602		Water seepage observed at wall-beam/column connection	Cracks from past quake may be present on wall surface and wall connection.	1.For expedited rectification, inject PU foam to visible wall cracks, 2.Inspect exterior walls and seal all cracks or apply water proofing		Dev.Corp/ QAQC/BM		Open- New Leak	N/A
37	8/10/2026	L37-605		Water seepage observed at wall corner	Likely due to defective corner sealant of window frames & possible exterior cracks is present due to past experienced quake	Inspect possible defective aluminum corner frame sealant and also rectify the visible wall cracks at the exterior side		Dev.Corp/ QAQC/BM		Open- New Leak	N/A
38	9/17/2025	L38-606		Water seepage observed at wall corner	Sealant failure at window frame suspected, with contributing factor of unsealed aluminum frame inside corners.		Silicone sealant was applied inside window frame corners, and outside window frame sealant was removed and replaced. 10/4/2025	RFJ/QAQC/BM No conducted leak testing to validate effectiveness of the rectification procedure	No leaks were observed following rainfall after the repair.	Closed	8/10/2026

39	11/11/2025	L39-6H		Water seepage observed at wall surface	Sealant failure at window frame suspected, with contributing factor of unsealed aluminum frame inside corners.		Exterior sealant was repaired and sealant was applied on every inside corner of frames 11/14/2025	RFJ/QAQC/BM No conducted leak testing to validate effectiveness of the rectification procedure	No leaks were observed following rainfall after the repair.	Reopened	8/10/2026
40	8/6/2026	L40-(6-7)		Water seepage observed at wall corner/ surface	Cracks from past quake may be present on wall surface and wall connection.	1.For expedited rectification, inject PU Foam on the visible wall crack and wall-column/beam connection, 2.Inspect exterior walls and seal all cracks or apply water proofing		Dev.Corp./QAQC/BM		Open- New Leak	N/A
41	11/11/2025	L41-7SCW		Traces of leaks on corner frames & rivets	Possible sealant failure and cracks on ACP		ACP panels were dismantled, crack inspection performed, reinstalled after verification.	RFJ/ QAQC/BM 25 mins. Leak test using Water Pressure Spray	No leak detected during leak testing 12/3/2025	Reopened	7/7/2026
42	9/17/2025	L42-7BCW		Traces of leaks on corner frames & rivets	Possible sealant failure and cracks on ACP		ACP panels were dismantled, crack inspection performed, reinstalled after verification.	RFJ/ QAQC/BM 25 mins. Leak test using Water Pressure Spray	No leak detected during leak testing @ 10/8/2025 & 11/19/2025	Reopened	8/6/2026
43	8/6/2026	L43-(7-8)		Water seepage observed at wall corner/ surface	Cracks from past quake may be present on wall surface and wall connection.	1.For expedited rectification, inject PU Foam on the visible wall crack and wall-column/beam connection, 2.Inspect exterior walls and seal all cracks or apply water proofing		Dev.Corp./QAQC/BM		Open- New Leak	N/A
44	8/6/2026	L44-7EE		Water seepage observed at wall -floor connection	Cracks from past quake may be present on wall surface and wall connection.	1.Conduct detailed inspection, 2.Inspect exterior walls and seal all cracks or apply water proofing		Dev.Corp./QAQC/BM		Open- New Leak	N/A
45	11/11/2025	L45-8 SCW		8th floor Small curtain wall: leak location from rivets (below window frame)	Possible sealant failure and window frame inside corner are not properly sealed		Awning windows are dismantled and all frame corners are applied with silicon sealant	RFJ/ QAQC/BM 25 mins. Leak test using Water Pressure Spray	No leak detected during leak testing 11/15/2025	Reopened	8/11/2026
46	9/17/2025	L46-8 BCW		Traces of leaks on corner frames & rivets	Possible sealant failure and cracks on ACP, also possible sealant failure applied on the signages		ACP panels were dismantled, crack inspection performed, reinstalled after verification. Also sealant was applied in some of the signages	RFJ/ QAQC/BM 25 mins. Leak test using Water Pressure Spray	No leak detected during leak testing @ 10/13/2025 & 11/29/2025	Reopened	8/6/2026

47	8/6/2026	L47-(8-RD)		Water seepage observed at wall -floor connection	Cracks from past quake may be present on wall surface and wall connection.	1.For expedited rectification, inject PU Foam on the visible wall crack and wall-column/beam connection, 2.Inspect exterior walls and seal all cracks or apply water proofing		Dev.Corp./QAQC/BM		Open- New Leak	N/A
48	9/17/2025	L48-RD		Water ingress at the installed side flashing	Possible due to poor sealant application; sealant no longer maintains adhesion, resulting in failure.		Sealant was reapplied on Roof Flashing. 10/17/2025	Dev.Corp./QAQC/BM No conducted leak testing to validate effectiveness of the rectification procedure	No leaks were observed following rainfall after the repair.	Reopened	8/10/2026
49	9/17/2025	L49-RD		Water ingress at the installed side flashing	Possible due to poor sealant application; sealant no longer maintains adhesion, resulting in failure.		Sealant was reapplied on Roof Flashing. 10/17/2025	Dev.Corp./QAQC/BM No conducted leak testing to validate effectiveness of the rectification procedure	No leaks were observed following rainfall after the repair.	Reopened	8/10/2026
50	9/17/2025	L50-8/RD		Water leakage was observed at the slab soffit	Due to crack at the concrete slab. Applied water proofing at the roof deck did not with stand the crack.	Rectify the identified leak in accordance with the supplier's recommended rectification procedures.	Ongoing Rectification - Applied Buildrite Confix to visible crack	Dev.Corp./QAQC/BM	Aug. 3, 2026 - No leaks observed	Under monitoring	N/A
51	9/17/2025	L51-(6-7 FE)		Water seepage observed at wall	Cracks from past quake may be present on wall surface or wall connections	1.For expedited rectification, inject PU Foam on the visible wall crack and wall-column/beam connection, 2.Inspect exterior walls and seal all cracks or apply water proofing		Dev.Corp./QAQC/BM		Open- New Leak	N/A
52	9/17/2025	L52-(7-8 FE)		Water seepage observed at wall	Cracks from past quake may be present on wall surface or wall connections	1.For expedited rectification, inject PU Foam on the visible wall crack and wall-column/beam connection, 2.Inspect exterior walls and seal all cracks or apply water proofing		Dev.Corp./QAQC/BM		Open- New Leak	N/A
53	8/11/2026	L53-2F WM		Water seepage observed at wall	Cracks from past quake may be present on wall surface and wall is directly in contact with soil	Inject epoxy/PU Foam into the identified/visible cracks		Dev.Corp./QAQC/BM		Open- New Leak	N/A
54	8/11/2026	L54-2F WM		Water seepage observed at wall	Cracks from past quake may be present on wall surface and wall is directly in contact with soil	Inject epoxy/PU Foam into the identified/visible cracks		Dev.Corp./QAQC/BM		Open- New Leak	N/A

55	8/11/2026	L55-2F MRF		Water seepage observed on the wall	Cracks from past quake may be present on wall surface and wall is directly in contact with soil	Inject epoxy/PU Foam into the identified/visible cracks		Dev.Corp./QAQC/BM		Open- New Leak	N/A
56	8/11/2026	L56-2F MS		Water seepage observed at wall to column termination	Cracks from past quake may be present on wall surface and wall is directly in contact with soil	Inject epoxy/PU Foam into the identified/visible cracks		Dev.Corp./QAQC/BM		Open- New Leak	N/A
57	8/11/2026	L57-2F EE		Water seepage observed at wall and beam	Cracks from past quake may be present on wall surface and wall is directly in contact with soil	Inject epoxy/PU Foam into the identified/visible cracks		Dev.Corp./QAQC/BM		Open- New Leak	N/A
58	8/11/2026	L58-2F EE		Water seepage observed at wall	Cracks from past quake may be present on wall surface and wall is directly in contact with soil	Inject epoxy/PU Foam into the identified/visible cracks		Dev.Corp./QAQC/BM		Open- New Leak	N/A
59	8/11/2026	L59-(G-2F FE)		Water seepage observed on the wall	Cracks from past quake may be present on wall surface and wall is directly in contact with soil	Inject epoxy/PU Foam into the identified/visible cracks		Dev.Corp./QAQC/BM		Open- New Leak	N/A
60	8/11/2026	L60-(G-2F FE)		Water seepage observed on the wall	Cracks from past quake may be present on wall surface and wall is directly in contact with soil	Inject epoxy/PU Foam into the identified/visible cracks		Dev.Corp./QAQC/BM		Open- New Leak	N/A
61	8/11/2026	L61-(1B-2B FE)		Water seepage observed on the wall	Cracks from past quake may be present on wall surface and wall is directly in contact with soil	Inject epoxy/PU Foam into the identified/visible cracks		Dev.Corp./QAQC/BM		Open- New Leak	N/A

62	8/11/2026	L62-(3B FE)		Water seepage observed at wall to slab termination	Cracks from past quake may be present on wall surface and wall is directly in contact with soil	Inject epoxy/PU Foam into the identified/visible cracks		Dev.Corp./QAQC/BM		Reopened	N/A
63	8/13/2026	L63-(3B MS)		Water seepage observed at 3rd basement main stair wall	Cracks from past quake may be present on wall surface and wall is directly in contact with soil	Inject epoxy/PU Foam into the identified/visible cracks	Application of injection packer. For continuation of PU injection	Dev.Corp./QAQC/BM		ONGOING	N/A
64	8/13/2026	L64-(3B)		Water seepage observed at wall - slab termination	Cracks from past quake may be present on wall surface and wall is directly in contact with soil	Inject epoxy/PU Foam into the identified/visible cracks	Application of injection packer. For continuation of PU injection	Dev.Corp./QAQC/BM		ONGOING	N/A
65	8/13/2026	L65-(3B)		Water seepage observed at wall - slab termination	Cracks from past quake may be present on wall surface and wall is directly in contact with soil	Inject epoxy/PU Foam into the identified/visible cracks		Dev.Corp./QAQC/BM		Reopened	N/A
66	8/13/2026	L66-(2B)		Water seepage observed at wall - slab termination	Cracks from past quake may be present on wall surface and wall is directly in contact with soil	Inject epoxy/PU Foam into the identified/visible cracks		Dev.Corp./QAQC/BM		Reopened	N/A
67	8/13/2026	L67-(2B)		Water seepage observed at wall - slab termination	Cracks from past quake may be present on wall surface and wall is directly in contact with soil	Inject epoxy/PU Foam into the identified/visible cracks		Dev.Corp./QAQC/BM		Reopened	N/A
68	8/13/2026	L68-(2B-3B RAMP)		Water seepage observed on the wall	Cracks from past quake may be present on wall surface and wall is directly in contact with soil	Inject epoxy/PU Foam into the identified/visible cracks		Dev.Corp./QAQC/BM		Reopened	N/A
69	8/13/2026	L69-(1B)		Water seepage observed at wall - slab termination	Cracks from past quake may be present on wall surface and wall is directly in contact with soil	Inject epoxy/PU Foam into the identified/visible cracks		Dev.Corp./QAQC/BM		Reopened	N/A

70	8/13/2026	L70- (1B-2B RAMP)		Water seepage observed on the wall	Cracks from past quake may be present on wall surface and wall is directly in contact with soil	Inject epoxy/PU Foam into the identified/vissible cracks		Dev.Corp./QAQC/BM		Reopened	N/A
----	-----------	-------------------	---	------------------------------------	---	--	--	-------------------	--	----------	-----

Prepared by:


Engr. Jemmer Guiao
 QAQC

Noted by:


Engr. Roan Paul B. Gallegos
 Building Maintenance

Reviewed by:

Engr. Virtron Bumal-o
 QAQC Manager

Approved by:

Engr. Fernando C. Laranang
 CEO - FCLDC