

6345 COLORADO BLVD

COMMERCE CITY CO 80022

PROPERTY TYPE
Commercial Office Building

YEAR BUILT

-

BUILDING AREA


5,593 SF

ROOF SQUARES

56

PARCEL ID

0182512101037

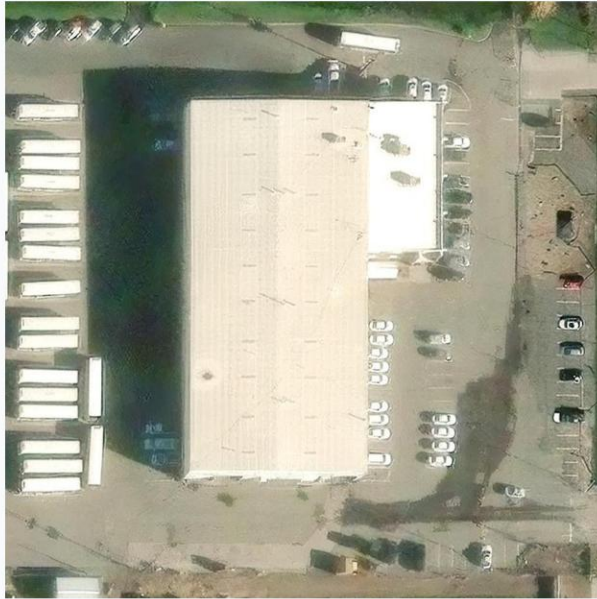

OVERALL ROOF CONDITION SCORE

54 /100
POOR

RISK LEVEL

HIGH



ROOF INFORMATION

ROOF TYPE	Mixed roof types
ROOF SYSTEM	Primary: TPO
VISIBLE CONCERNS	dark staining/color variation; possible ponding; many penetrations/units
ROOF AGE EST.	Likely mid-life to older low-slope roof based on discoloration, faint seam visibility, and localized weathering; exact age unknown from aerial imagery.
ROOF AREA	5,593 SF
ROOF PITCH	Low-slope / flat
CONFIDENCE	56%

SELECTED AERIAL IMAGE - ESRI WORLD IMAGERY AS OF 11/13/2025

ROOF CONDITION BREAKDOWN

Membrane Condition		58/100
Ponding		52/100
Flashing & Seals		50/100
Penetrations		48/100
Overall Maintenance		53/100

AERIAL ROOF OBSERVATIONS

1. Visible risk factors include dark staining or inconsistent roof color, possible ponding or drainage stress, high penetration or rooftop-unit density.
2. Main central roof field is a large smooth light membrane-like area with faint linear seam/lap patterns.
3. Right/east attached roof section is brighter white and visually distinct from the main field.
4. Localized dark blotches/discoloration are visible on the attached white section.
5. Multiple rooftop units, vents, and curbs are present, creating numerous flashing locations.

BUILDING CHARACTERISTICS

LAND AREA	1.16 acres
STORIES	-
CONSTRUCTION TYPE	-
TAX DISTRICT	-
LAND VALUE	-

REPORT SUMMARY

Esri World Imagery dated 11/13/2025 shows a mixed low-slope commercial roof at 6345 Colorado Blvd, Commerce City, CO. The dominant field appears to be a smooth light single-ply membrane, best fit TPO from aerial evidence, while the attached bright white section could be TPO, PVC, or a coated roof. Visible risk factors include dark staining or inconsistent roof color, possible ponding or drainage stress, high penetration or rooftop-unit density.

Recommendation:

Have a qualified commercial roof-coating contractor or membrane roofing contractor perform an onsite inspection, moisture testing where warranted, and confirmation of the roof system, flashing details, repairs, and warranty eligibility, then provide a reliable project-price proposal. Because the roof appears to be a restorable low-slope membrane system rather than asphalt shingles, evaluate whether a silicone roof restoration is feasible before considering overlay or replacement; a qualifying silicone system may reduce tear-off waste, cost, and disruption, create a seamless monolithic white reflective cool-roof surface, withstand ponding water when properly designed and installed, improve resistance to UV exposure and hail, and may qualify for a manufacturer warranty of up to 20 years. If onsite inspection finds widespread moisture, failed insulation, deck/structural deterioration, or an incompatible substrate, prioritize overlay or re,

ROOF REPAIR OPTIONS

Roof Replacement Cost Estimate

TOTAL PROJECT COST

\$172,055

\$26.75 / SF

COST SUMMARY

Replacement Subtotal	\$149,613
Contingency (15%)	\$22,442
Total Project Cost	\$172,055

Roof Overlay Cost Estimate

TOTAL PROJECT COST

\$63,061

\$10.25 / SF

COST SUMMARY

Overlay Subtotal	\$57,328
Contingency (10%)	\$5,733
Total Project Cost	\$63,061

Roof Coating Estimate

TOTAL PROJECT COST

\$19,576 - \$33,558

\$3.50 - \$6.00 / SF

WARRANTY TERM

10 Year Warranty	\$19,576 - \$22,372
15 Year Warranty	\$25,168 - \$27,965
20 Year Warranty	\$30,762 - \$33,558

BUDGETARY COST RANGE

Cost estimates are derived from publicly available information and proprietary commercial roofing analysis models and are intended for preliminary budgeting and planning purposes only. Roof-area measurements do not include the vertical surface area of parapet walls. They should not be considered a contractor quote, engineering assessment, or guarantee of actual project costs. Estimates do not include additional repairs or unforeseen conditions that may be identified during an on-site inspection.