

4444 N FOREST ST

DENVER CO 80216


PROPERTY TYPE
INDUSTRIAL-WAREHOUSE 398: WAREHOU...

YEAR BUILT
1979

BUILDING AREA
28,118 SF

ROOF SQUARES
281

PARCEL ID
0119106005000

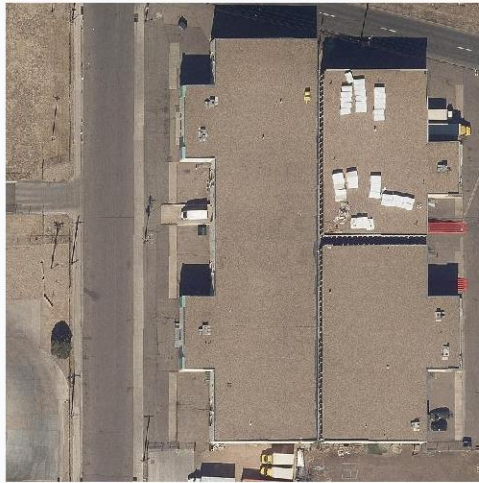

OVERALL ROOF CONDITION SCORE

55 /100
POOR

RISK LEVEL

HIGH



ROOF INFORMATION

ROOF TYPE	Low-slope commercial roof
ROOF SYSTEM	Primary: Primarily BUR/tar-and-gravel or modified bitumen, with possible coated sections on portions of the roof field; Secondary: Tar and gravel / BUR
VISIBLE CONCERNS	dark staining/color variation; possible ponding; many penetrations/units
ROOF AGE EST.	Likely original or near-original era roof based on 1979 building date, but visible imagery alone cannot confirm installation date or major replacements.
ROOF AREA	28,118 SF
ROOF PITCH	Low-slope / near-flat
CONFIDENCE	71%

SELECTED AERIAL IMAGE - DENVER GIS AS OF 03/11/2018 - 03/17/2018

ROOF CONDITION BREAKDOWN

Membrane Condition		54/100
Ponding		50/100
Flashing & Seals		48/100
Penetrations		46/100
Overall Maintenance		52/100

AERIAL ROOF OBSERVATIONS

1. Low-slope commercial warehouse roof with multiple connected roof fields.
2. Roof surface is generally intact from aerial view but not uniformly clean; several darkened patches and tonal variations are visible.
3. Several penetrations/vents/roof-mounted elements are present, especially on the right-side roof field, which raises flashing and seal risk.
4. Some areas near roof edges and field transitions appear darker and possibly moisture-affected, though aerial imagery cannot confirm wet insulation.
5. No obvious major open breaches or severe widespread collapse are visible in the provided image.

BUILDING CHARACTERISTICS

LAND AREA	2.15 acres
STORIES	-
CONSTRUCTION TYPE	398: WAREHOUSE
TAX DISTRICT	DENV
LAND VALUE	\$1,402,700

REPORT SUMMARY

Aerial imagery of this 1979 industrial warehouse shows a low-slope roof that appears serviceable but only fair overall, with moderate risk driven by visible dark staining/discoloration, possible localized ponding or drainage-related moisture, and multiple penetrations that increase flashing and leak potential. The roof surface looks broadly intact, but the mottled appearance suggests recurring maintenance or water-management concerns on an older roof field. Because the 3

Recommendation:

Have a qualified commercial roofing contractor perform an onsite inspection with moisture testing where warranted, confirm the exact roof system and repair history, and evaluate flashing, seams, drainage, and any suspect stained areas. If the roof is otherwise structurally sound and the substrate is compatible, consider whether a silicone roof restoration is feasible before a more costly overlay or replacement; a properly designed silicone system can reduce tear-off waste, cost, and disruption, create a seamless white reflective surface, improve UV and hail resistance, withstand ponding water when correctly installed, and may qualify for a manufacturer warranty of up to 20 years. If moisture damage, failed insulation, deck issues, or incompatible materials are found, pursue overlay or full replacement evaluation instead.

ROOF REPAIR OPTIONS

Roof Replacement Cost Estimate

TOTAL PROJECT COST	COST SUMMARY
\$824,560	Replacement Subtotal \$717,009
\$25.50 / SF	Contingency (15%) \$107,551
	Total Project Cost \$824,560

Roof Overlay Cost Estimate

TOTAL PROJECT COST	COST SUMMARY
\$317,030	Overlay Subtotal \$288,210
\$10.25 / SF	Contingency (10%) \$28,821
	Total Project Cost \$317,030

Roof Coating Estimate

TOTAL PROJECT COST	WARRANTY TERM	BUDGETARY COST RANGE
\$98,413 - \$168,708	10 Year Warranty	\$98,413 - \$112,472
\$3.50 - \$6.00 / SF	15 Year Warranty	\$126,531 - \$140,590
	20 Year Warranty	\$154,649 - \$168,708

Cost estimates are derived from publicly available information and proprietary commercial roofing analysis models and are intended for preliminary budgeting and planning purposes only. Roof-area measurements do not include the vertical surface area of parapet walls. They should not be considered a contractor quote, engineering assessment, or guarantee of actual project costs. Estimates do not include additional repairs or unforeseen conditions that may be identified during an on-site inspection.