


Trainings ▾

Inspect for Reuse

⚠ CAUTION ⚠

The engine intake air must be filtered to prevent dirt and debris from entering the engine. If intake air piping is damaged or loose, unfiltered air can enter the engine and cause premature wear.

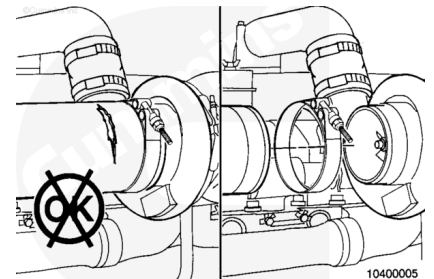

Note : The QSK19 mechanically actuated injection engine is shown in the procedure. While the QSK19 electronically actuated injection engine is different, the basic procedure remains the same.

Inspect the system for damaged or loose intake piping.


Replace damaged pipes and tighten loose clamps.

Torque Value: 8 n•m [71 in-lb]

Note : Stall speed is not full power.

Operate the engine at rated rpm and load.

Listen for a high pitch noise from the turbocharger.

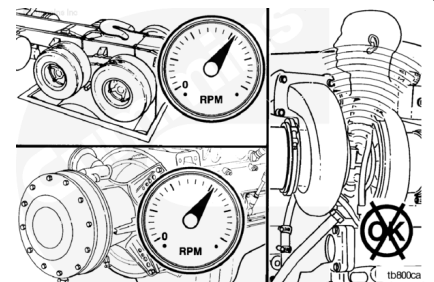


This type of noise can be caused by an air leak from the following:

Turbocharger-To-Aftercooler Air Supply Hose.

Inspect the hose for damage. Tighten the hose clamps. Refer to Procedure 010-019 in Section 10.

(/qs3/pubsys2/xml/en/procedures/20/20-010-019-tr.html)

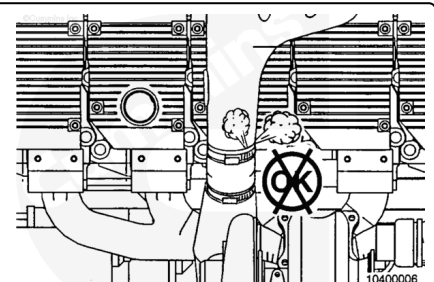

This type of noise can be caused by the turbocharger to charge-air-cooler connection.

Inspect the charge air cooler hoses and clamps. Tighten the clamps.


Torque Value: 8 n•m [71 in-lb]

Refer to Procedure 010-027 in Section 10.

(/qs3/pubsys2/xml/en/procedures/20/20-010-027.html)

Air Crossover-To-Aftercooler Connection Leak.

Replace the air crossover gasket. Refer to Procedure 010-019 in Section 10. (/qs3/pubsys2/xml/en/procedures/20/20-010-019-tr.html)

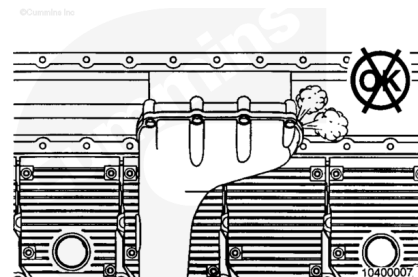


Turbocharger-To-Exhaust Manifold Gasket Leak.

Replace the gasket. Refer to Procedure 010-033 in Section 10. (/qs3/pubsys2/xml/en/procedures/20/20-010-033-tr.html)

Refer to Procedure 010-037 in Section 10.

(/qs3/pubsys2/xml/en/procedures/20/20-010-037-tr.html)

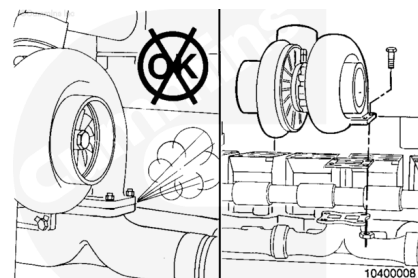

Turbine Housing-To-Bearing Housing Sealing Surface Leak

Tighten capscrews.


Torque Value: 20 n•m [177 in-lb]

If an air leak is still present, replace the turbocharger. Refer to Procedure 010-033 in Section 10.

(/qs3/pubsys2/xml/en/procedures/20/20-010-033-tr.html)

Refer to Procedure 010-037 in Section 10.

(/qs3/pubsys2/xml/en/procedures/20/20-010-037-tr.html)

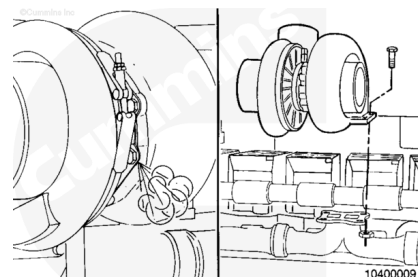

Compressor Housing Sealing Surface Air Leak

Tighten the V-band clamp.

Torque Value: 8 n•m [71 in-lb]

If an air leak is still present, remove and replace the turbocharger. Refer to Procedure 010-033 in Section 10.

(/qs3/pubsys2/xml/en/procedures/20/20-010-033-tr.html)

Refer to Procedure 010-037 in Section 10.

(/qs3/pubsys2/xml/en/procedures/20/20-010-037-tr.html)

