


Trainings ▾


Maintenance Check

Every 48,000 km [30,000 mi], 1000 hours, or 1 year, whichever occurs first, inspect the automatic belt tensioner.


With the engine turned off, check that neither the top nor bottom tensioner arm stop is touching the cast boss on the tensioner body. If either of the stops is touching a boss, the alternator belt **must** be replaced. Check to make sure the correct belt part number is being used if either condition exists.

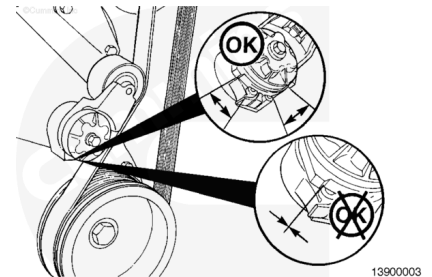


Check the tensioner pulley and body for cracks. If any cracks are noticed, the tensioner **must** be replaced. Refer to a Cummins Authorized Repair Facility. Check the tensioner for dirt buildup. If this condition exists, the tensioner **must** be removed and steam-cleaned.

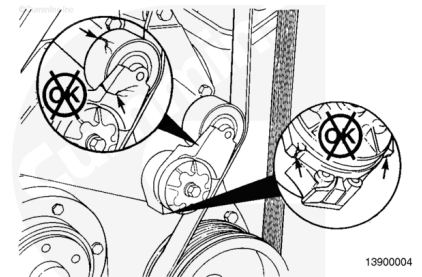

Check that the bottom tensioner arm stop is in contact with the bottom tensioner arm stop boss on the tensioner body. If these two are **not** touching, the tensioner **must** be replaced.

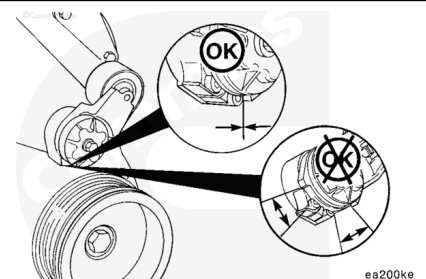

Inspect the tensioner for evidence of the pivoting tensioner arm contacting the stationary circular base. If there is evidence of these two areas touching, the pivot tube bushing has failed and the tensioner **must** be replaced.

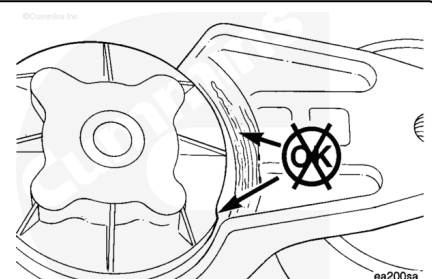


A worn tensioner that has play in it or a belt that “walks” off its pulley possibly indicates pulley misalignment.

Note : Maximum pulley misalignment is 3 degrees.

This measurement can be taken with a straightedge and an inclinometer.

Install the belt.

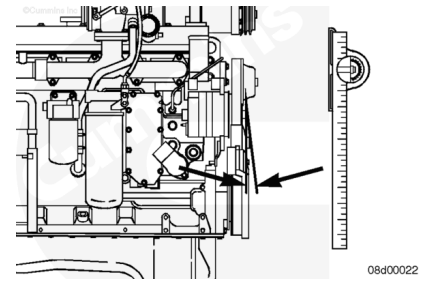

Last Modified: 14-Feb-2005
