


Trainings ▾

Inspect

⚠ CAUTION ⚠

The silicon fluid in the vibration damper will become solid after extended service and will make the damper inoperative. An inoperative vibration damper can cause major engine or drivetrain malfunction.

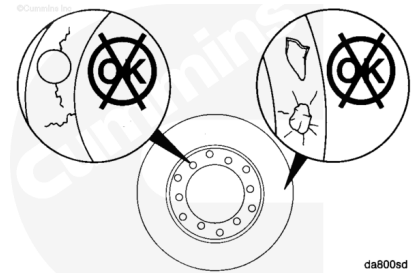

Check the vibration damper for evidence of fluid loss, dents, and wobble. Inspect the vibration damper thickness for any deformation or raising of the damper cover plate.

If any of these conditions are identified, contact a Cummins® Authorized Repair Location to replace the vibration damper.

Note : Vibration damper must be replaced after 24,000 hours in service.