


Fault Code: 1386

Intake Manifold 2 Pressure Sensor Circuit - Voltage Below Normal or Shorted to Low Source



Overview

Codes	Reason	Effect
Fault Code: 1386 PID(P): SPN: 1128 FMI: 4/4 Lamp: Maintenance SRT:	Low signal voltage detected at the intake manifold 2 pressure sensor circuit.	Possible reduced engine performance.

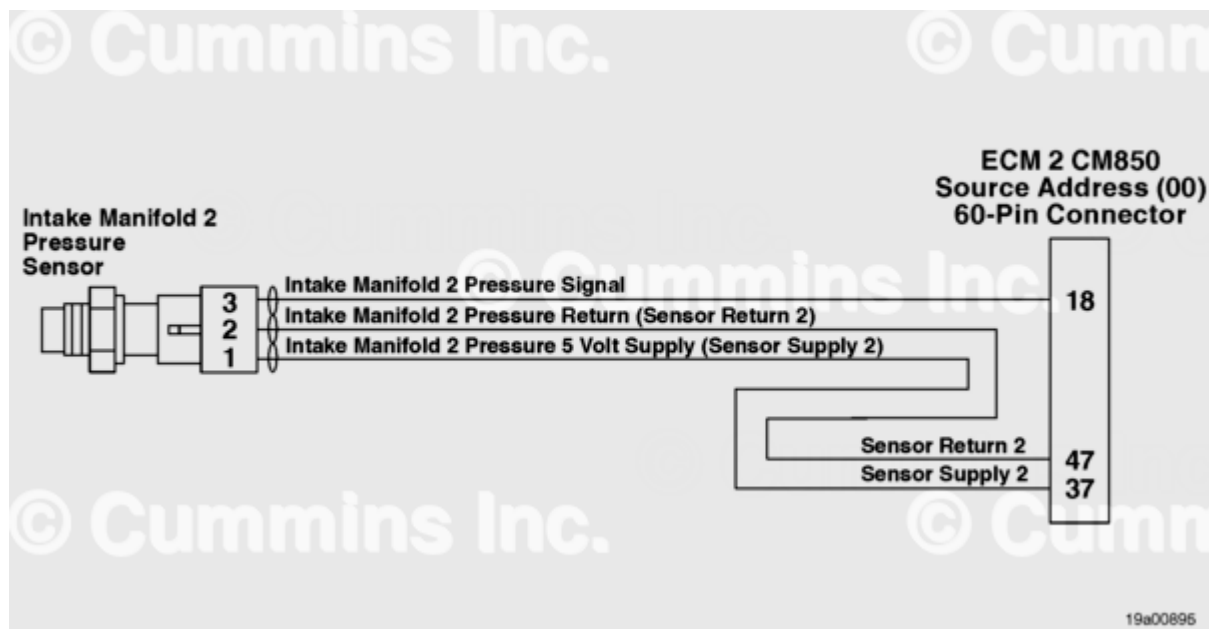

Intake Manifold 2 Pressure Sensor Circuit.

Circuit Description

The intake manifold pressure sensor is a variable resistance sensor used by the ECM to monitor the intake manifold pressure. The intake manifold pressure sensor has three circuits: 5 volt supply, return and signal circuits. The signal circuit voltage indicates the charged air pressure in the intake manifold.

Component Location

The intake manifold 2 pressure sensor is located in the left bank intake manifold.

Conditions For Running The Diagnostics

This diagnostic runs continuously when the generator set controller is active or when the engine is running.

Conditions For Setting The Fault Codes

The Engine Control Module (ECM) detected the intake manifold 2 pressure sensor signal voltage is out of range low.

Action Taken When The Fault Code Is Active

- The generator set controller displays a warning fault immediately when the diagnostics runs and fails.
- Intake manifold 1 pressure sensor is used for intake manifold pressure reading.

Conditions For Clearing The Fault Code

- To validate the repair, start the engine and let it run for 1 minute at no load.
- The generator set controller will turn off the warning indicator immediately after the user presses reset.
- The "Reset All Faults" command in the recommended Cummins® electronic service tool or equivalent can be used to clear active faults.

Shoptalk

There are multiple ECMs for the engine models included in this manual. Each ECM has an individual source address that displays when Cummins® electronic service tool or equivalent is connected. When troubleshooting a fault code, use the source address displayed in Cummins® electronic service tool or equivalent to determine which ECM and circuit is affected.

Possible causes of this fault code include:

- Malfunctioning intake manifold 2 pressure sensor.
- Malfunctioning or damaged engine wiring harness.

Refer to Troubleshooting Fault Code 1386 . (</qs3/pubsys2/xml/en/procedures/60/60-t05-1386.html>)

Last Modified: 28-Sep-2020