


Fault Code: 1891

Engine Oil Change Interval - Condition Exists

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 1891 PID(P): S115 SPN: 1378 FMI: 11/31 Lamp: Amber SRT:	Engine conditions are preventing engine oil burn valve operation.	Engine oil burn valve solenoid unable to inject oil.

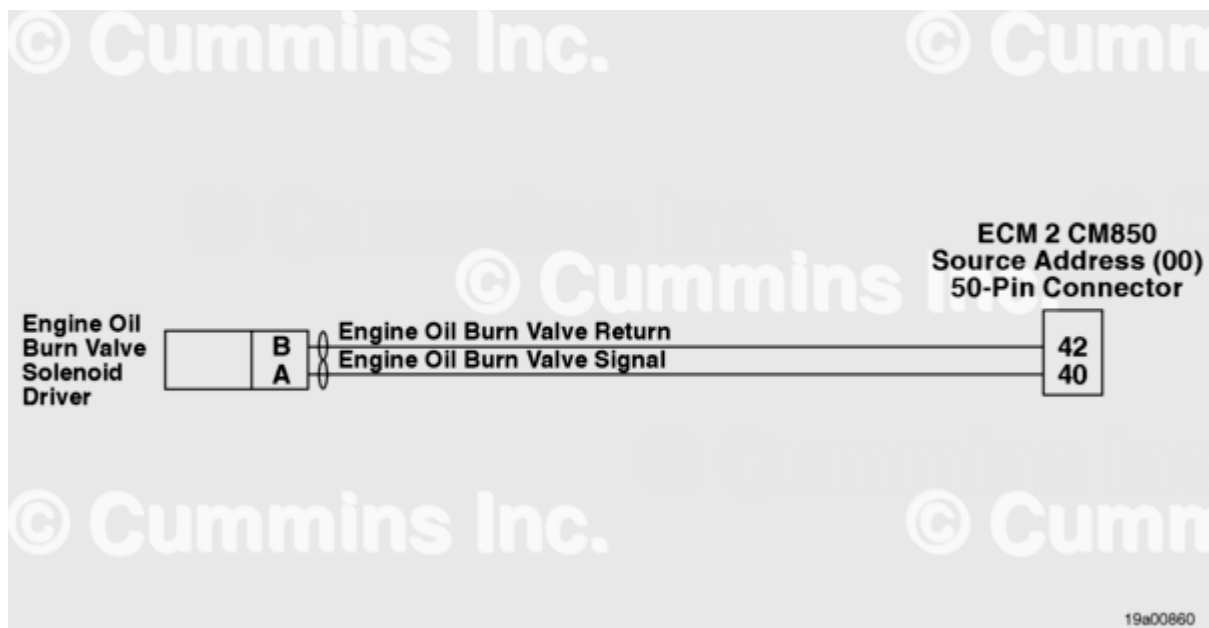

Engine Oil Burn Valve Solenoid Driver Circuit.

Circuit Description

The engine oil burn valve solenoid driver controls the flow of oil in the oil control valve during the burn cycle.

Component Location

The engine oil burn valve solenoid is located in the top of the engine oil burn valve. The location of the burn valve is OEM dependent.

Conditions For Running The Diagnostics

This diagnostic runs continuously when the engine is running.

Conditions For Setting The Fault Codes

The Engine Control Module (ECM) detected the engine oil burn valve system has been unable to operate for an extended period of time due to engine conditions.

Action Taken When The Fault Code Is Active

- The generator set controller displays a warning fault immediately when the diagnostics runs and fails.

Conditions For Clearing The Fault Code

- To validate the repair, perform a keycycle, start the engine and perform the Centinel™ Operational Test using the recommended Cummins® electronic service tool or equivalent.
- The generator set controller will turn off the warning indicator immediately after the user presses reset.
- The “Reset All Faults” command in the recommended Cummins® electronic service tool or equivalent can be used to clear active faults.

Shoptalk

When the engine oil burn valve solenoid tries to inject oil and can not, it generates a miss count. When these counts reach a predefined level, the fault code becomes active. If an oil make up tank is **not** used, it is recommended to change the engine oil at the next maintenance interval.

Possible causes of this fault code include:

- Incorrect engine oil pressure
- Incorrect engine coolant temperature
- low lubrication oil level
- A faulty engine oil burn valve
- Malfunctioning or damaged engine wiring harness.
- Malfunctioning or damaged OEM wiring harness.

Refer to Troubleshooting Fault Code 1891 . (</qs3/pubsys2/xml/en/procedures/60/60-t05-1891.html>)

Last Modified: 28-Sep-2020
