


Fault Code: 1979

Generator Speed/Load Governing Bias Circuit - Voltage Below Normal or Shorted to Low Source

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 1979 PID(P): SPN: 3938 FMI: 4/4 Lamp: Amber SRT:	Generator Speed/Load Governing Bias Circuit has detected voltage below normal or shorted to low source.	Engine will not synchronize with the grid, if connected.

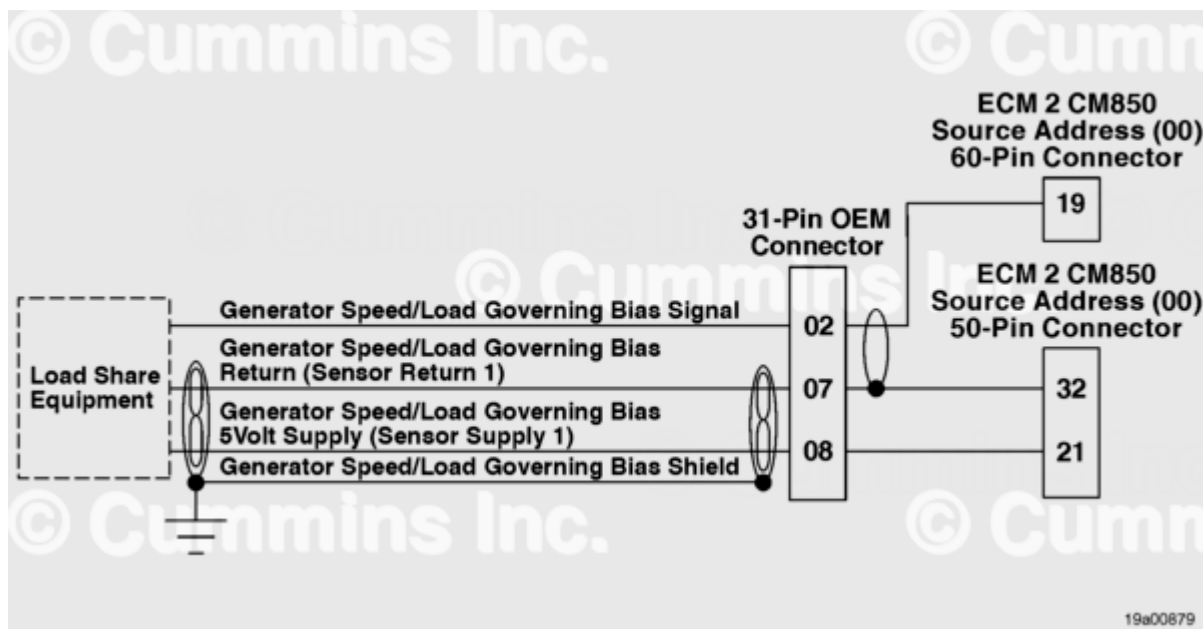

Generator Speed/Load Governing Bias Circuit.

Circuit Description

The generator speed/load governing bias circuit controls the engine speed in order to match a required grid frequency and phase.

Component Location

The generator speed/load governing bias control is located in the generator set controller on the generator set.

Conditions For Running The Diagnostics

This diagnostic runs continuously when the generator set controller is active or when the engine is running.

Conditions For Setting The Fault Codes

The Engine Control Module (ECM) detected generator speed/load governing bias signal is out of range low.

Action Taken When The Fault Code Is Active

- The generator set controller displays a warning fault immediately when the diagnostics runs and fails.

Conditions For Clearing The Fault Code

- To validate the repair, start the engine and let it run for 1 minute at no load.
- The generator set controller will turn off the warning indicator immediately after the user presses reset.
- The "Reset All Faults" command in the recommended Cummins® electronic service tool or equivalent can be used to clear active faults.

Shoptalk

Possible causes of this fault code include:

- Malfunctioning or damaged engine wiring harness.

Refer to Troubleshooting Fault Code 1979 . (</qs3/pubsys2/xml/en/procedures/60/60-t05-1979.html>)