


Fault Code: 352

Sensor Supply 1 Circuit - Voltage Below Normal or Shorted to Low Source

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 352 PID(P): S212 SPN: 3509 FMI: 4/4 Lamp: Amber SRT:	Low voltage detected at the sensor supply 1 circuit.	Possible reduced engine performance, shutdown or loss of engine protection.

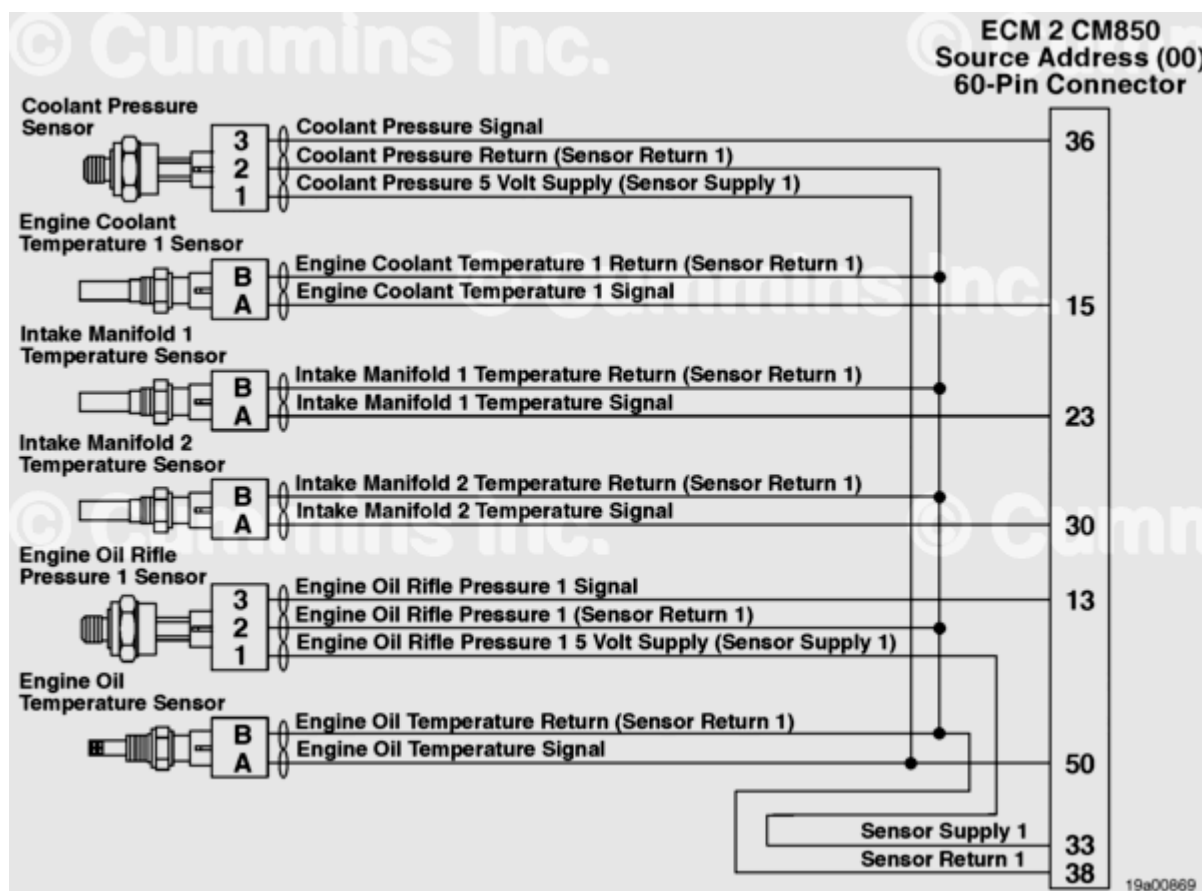

Sensor Supply 1 Circuit.

Circuit Description

The sensor supply 1 circuit of the engine control module (ECM) provides a 5 volts supply to various sensors on the engine wiring harness.

Component Location

The sensor supply 1 circuit is located in the engine wiring harness.

Conditions For Running The Diagnostics

This diagnostic runs continuously when the generator set controller is active or when the engine is running.

Conditions For Setting The Fault Codes

The Engine Control Module (ECM) detected the sensor supply 1 signal voltage was out of range low.

Action Taken When The Fault Code Is Active

- The generator set controller displays a warning fault immediately when the diagnostics runs and fails.
- A default value is used for all of the sensors on the sensor supply 1 circuit.

Conditions For Clearing The Fault Code

- To validate the repair, start the engine and let it run for 1 minute at no load.
- The generator set controller will turn off the warning indicator immediately after the user presses reset.
- The "Reset All Faults" command in the recommended Cummins® electronic service tool or equivalent can be used to clear active faults.

Shoptalk

There are multiple ECMs for the engine models included in this manual. Each ECM has an individual source address that displays when Cummins® electronic service tool or equivalent is connected. When troubleshooting a fault code, use the source address displayed in Cummins® electronic service tool or equivalent to determine which ECM and circuit is affected.

Possible causes of this fault code include:

- Malfunctioning or damaged engine wiring harness.
- Damaged or loose connections.

- Malfunctioning sensor

Refer to Troubleshooting Fault Code 352 . (</qs3/pubsys2/xml/en/procedures/60/60-t05-352.html>)

Last Modified: 28-Sep-2020
