


Fault Code: 426

J1939 Network #1 - Data Erratic, Intermittent, or Incorrect

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 426 PID(P): S231 SPN: 639 FMI: 2/2 Lamp: None SRT:	Communication between the engine control module (ECM) and another device on the J1939 datalink has been lost.	None on performance.

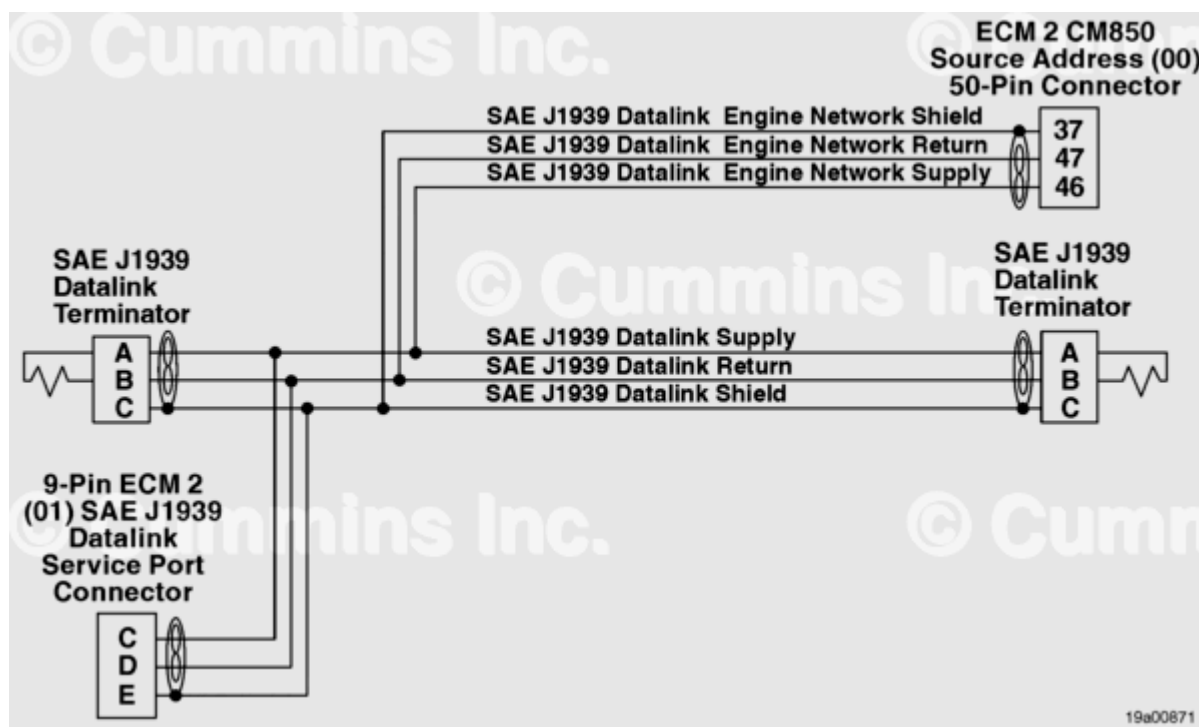

J1939 Datalink Circuit

Circuit Description

The ECM identified another device on the J1939 datalink network has stopped communicating on the network. The devices on the J1939 datalink network include: ECMs', and the Generator Interface Module. The harness for the J1939 datalink network has a shielded twisted pair of wires that connect each of the network devices and termination resistor.

Component Location

The location of the J1939 datalink wiring may vary depending on OEM.

Conditions For Running The Diagnostics

This diagnostic runs continuously when the generator set controller is active.

Conditions For Setting The Fault Codes

The Engine Control Module (ECM) detected an open or short circuit condition in the J1939 datalink wiring harness.

Action Taken When The Fault Code Is Active

- The generator set controller displays the fault immediately when the diagnostics runs and fails.
- The multiplexed device will **not** operate.

Conditions For Clearing The Fault Code

- To validate the repair, start the engine and let it run for 1 minute at no load.
- The generator set controller will turn off the fault code immediately after the user presses reset.
- The “Reset All Faults” command in the recommended Cummins® electronic service tool or equivalent can be used to clear active faults.

Shoptalk

Possible causes of this fault code include:

- Malfunctioning or damaged J1939 datalink wiring harness.
- Malfunctioning or damaged OEM wiring harness.
- Communication failure between J1939 devices

Refer to Troubleshooting Fault Code 426 . (</qs3/pubsys2/xml/en/procedures/60/60-t05-426.html>)