


Fault Code: 115

Engine Position Sensor Circuit

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 115 PID(P): P190 SPN: 190 FMI: 2/2 Lamp: Red SRT:	No engine speed signal detected at both engine position sensor circuits.	Engine will shut down and will not start.

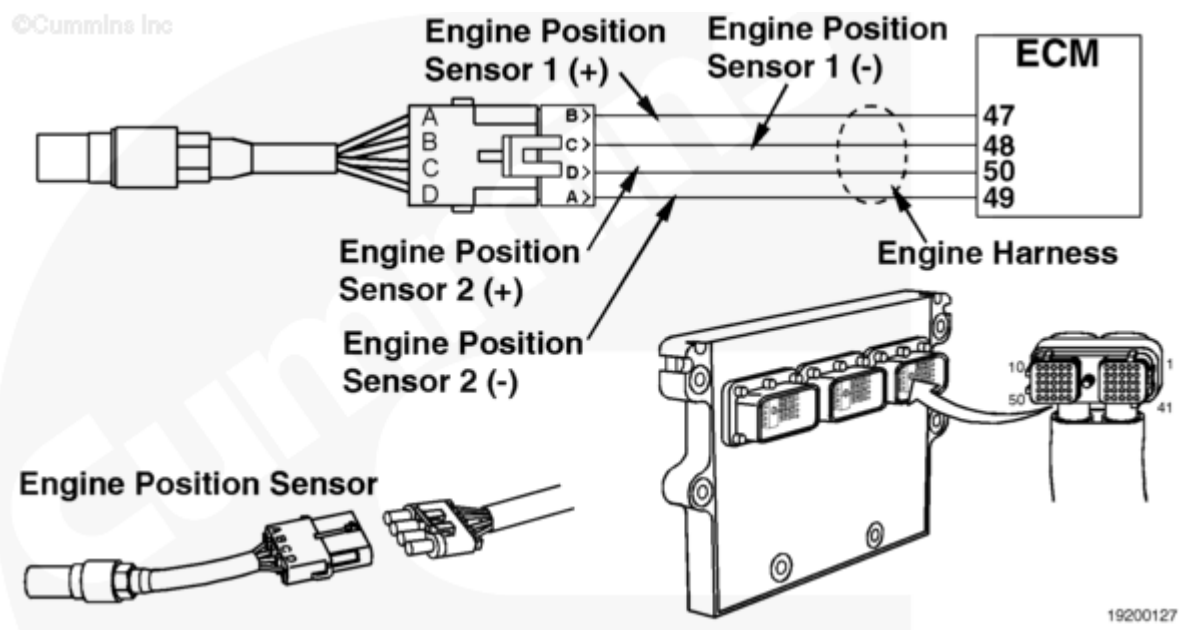

Engine Position Sensor Circuit

Circuit Description

The engine position sensor monitors the engine position and the engine speed, then passes this information to the electronic control module (ECM) through the sensor harness.

Component Location

The engine position sensor is located above the accessory drive.

Shoptalk

- If the fault occurs **only** at a certain engine temperature, check the engine position sensor circuit while the engine is at that particular temperature.
- Check the camshaft end play to make sure that the camshaft gear is **not** moving too far away from the end of the engine position sensor.
- Check for moisture in the sensor harness connector at the ECM.
- Possible causes of this fault code include a damaged engine position sensor, short circuit, or an open circuit.

Refer to Troubleshooting Fault Code t05-115 (</qs3/pubsys2/xml/en/procedures/82/82-t05-115.html>)

Last Modified: 02-Sep-2010
