


# Fault Code: 122

## Intake Manifold Pressure Sensor Circuit

 Printable Version

### Overview

| Codes                                                                               | Reason                                                                | Effect                                |
|-------------------------------------------------------------------------------------|-----------------------------------------------------------------------|---------------------------------------|
| Fault Code: 122<br><br>PID(P): P102<br>SPN: 102<br>FMI: 3/3<br>Lamp: Yellow<br>SRT: | High voltage detected at the intake manifold pressure sensor circuit. | Derate in power output of the engine. |

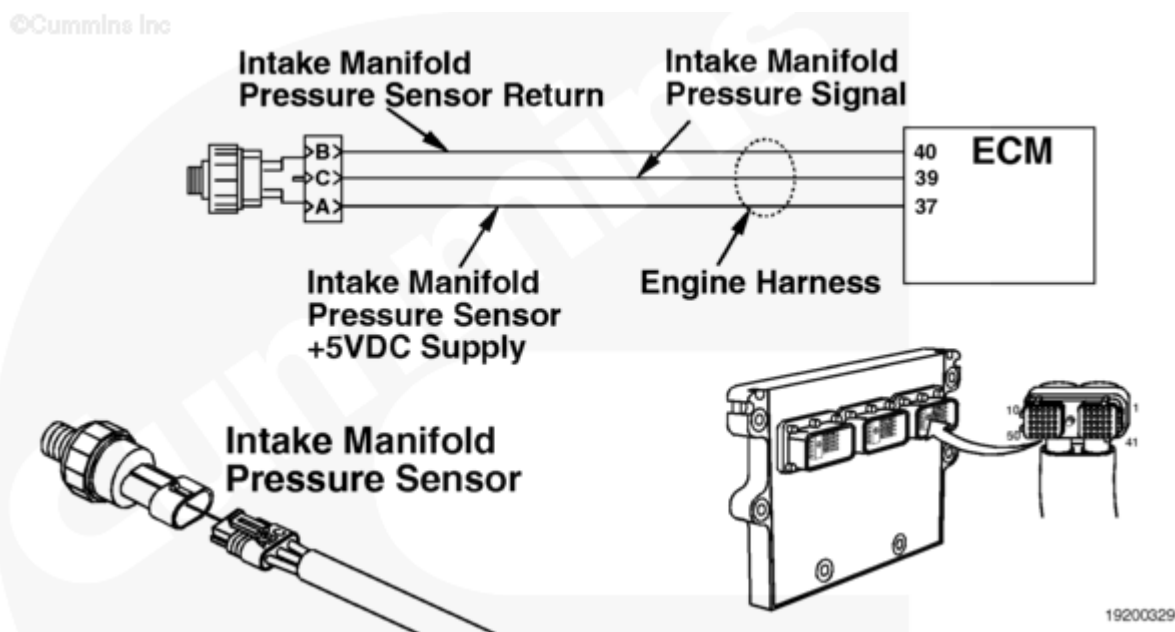

Intake Manifold Pressure Sensor Circuit

### Circuit Description

The intake manifold pressure sensor monitors intake manifold pressure and passes information to the electronic control module (ECM) through the engine harness. If the intake manifold pressure becomes too high, it will cause a derate condition.

### Component Location

The intake manifold pressure sensor is located in the air intake manifold toward the front of the engine.

## Shoptalk

- Determine if engine is being overfueled.
- Confirm that the correct intake manifold pressure sensor part number is being used.
- Confirm that the correct turbocharger is being used.
- If it is suspected that cold intake air is the cause of the high intake manifold pressure, test the engine with warm intake air.
- Inspect the intake manifold pressure sensor circuit for signs of tampering. Remove any extra wires from the circuit.

Refer to Troubleshooting Fault Code t05-122 (</qs3/pubsys2/xml/en/procedures/82/82-t05-122.html>)

---

**Last Modified: 02-Sep-2010**

---