


Fault Code: 154

Intake Manifold Temperature Sensor Circuit

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 154 PID(P): P105 SPN: 105 FMI: 4/4 Lamp: Yellow SRT:	Low voltage detected at the intake manifold temperature sensor circuit.	Possible white smoke. Fan will stay on if controlled by the electronic control module (ECM). No engine protection for intake manifold temperature.

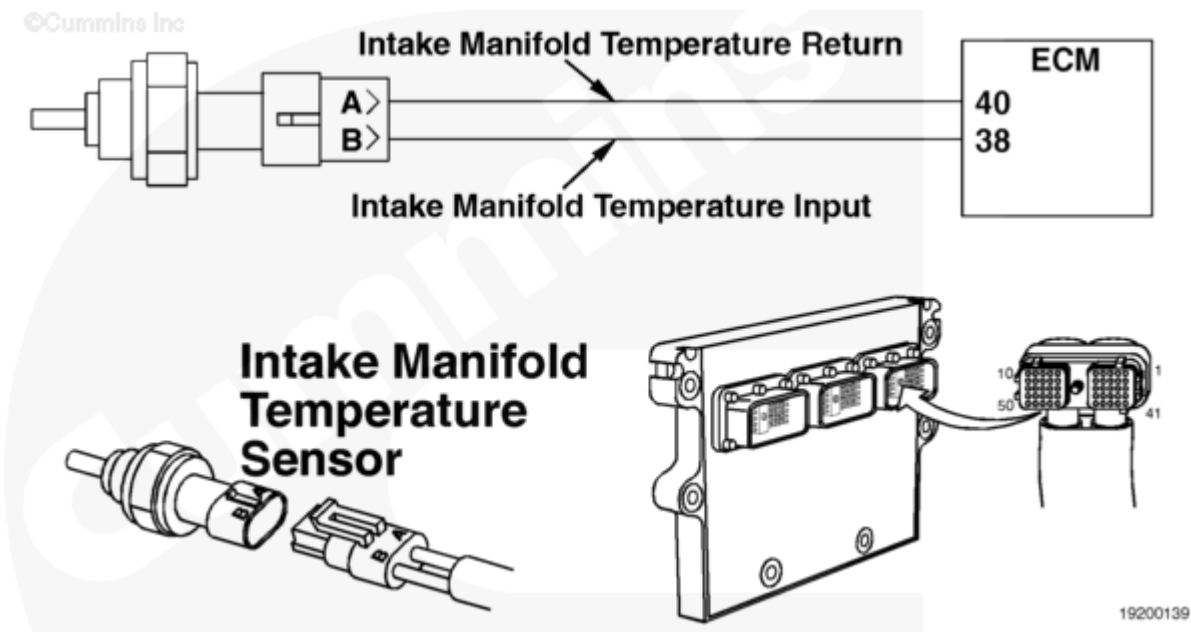

Intake Manifold Temperature Sensor Circuit

Circuit Description

The intake manifold temperature sensor monitors the temperature of the engine intake air for the ECM. The ECM uses the intake manifold temperature signal for the engine protection system, timing, and fueling control.

Component Location

The intake manifold temperature sensor is located on the top half of the intake manifold, at the front.

Shoptalk

The resistance of the sensor varies with the temperature. Compare your reading to this table:

Temperature (°C)	Temperature [°F]	Resistance (ohms)
0	32	30k to 36k
25	77	9k to 11k
50	122	3k to 4k
75	167	1350 to 1500
100	212	600 to 675

Refer to Troubleshooting Fault Code t05-154 (</qs3/pubsys2/xml/en/procedures/82/82-t05-154.html>)

Last Modified: 02-Sep-2010
