


Fault Code: 286

J1939 Datalink Multiplexing

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 286 PID(P): S231 SPN: 639 FMI: 13/13 Lamp: Yellow SRT:	The ECM expected information from a multiplexed device but only received a portion of the necessary information.	At least one multiplexed device will not operate properly.

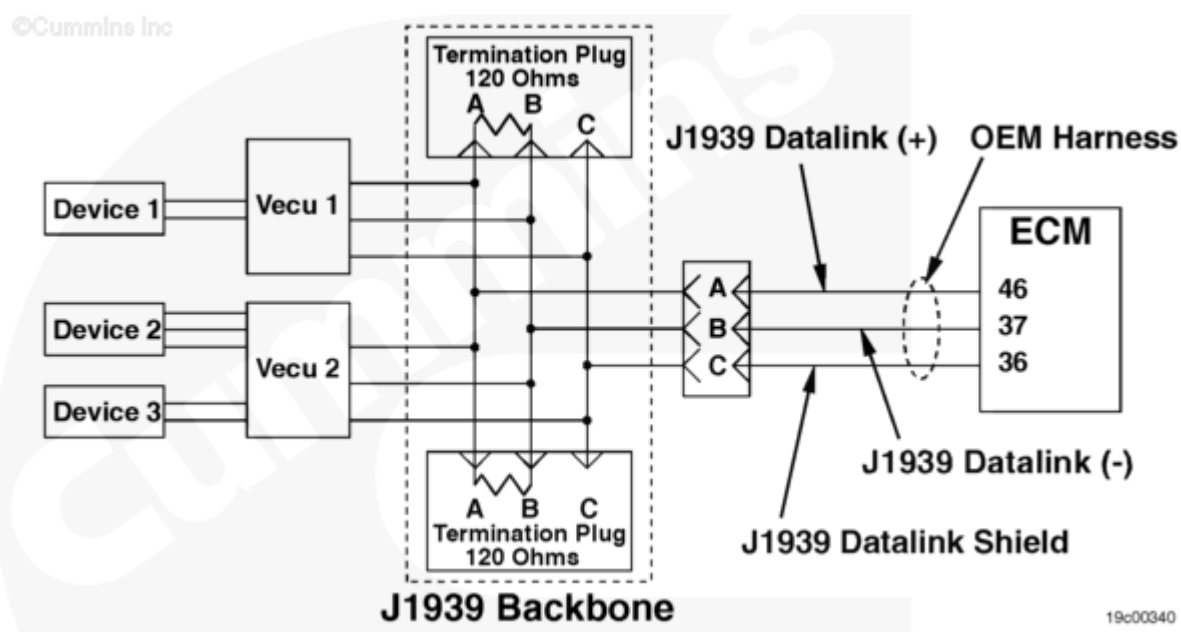

J1939 Datalink Multiplexing Circuit

Circuit Description

Inputs such as throttle pedals, switches, and sensors can be communicated to the ECM over the J1939 datalink. Messages sent from the vehicle electronic control units (VECU) are received by the ECM and used for controlling the engine. Both the ECM and VECU **must** be properly configured so that each device's information is transmitted by the VECU and received by the ECM.

Component Location

The ECM is located on the intake side of the engine, near the front. The J1939 datalink wiring and VECU(s) vary by OEM options.

Shoptalk

This fault occurs when the ECM is set up to receive information from several multiplexed switches from VECU(s) and **only** gets some of the switches. It indicates the ECM is set up to receive too many switches or the VECU(s) is set up to transmit too few switches.

Refer to Troubleshooting Fault Code t05-286 (</qs3/pubsys2/xml/en/procedures/82/82-t05-286.html>)

Last Modified: 02-Sep-2010
