


Fault Code: 386

Sensor Voltage Supply

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 386 PID(P): S232 SPN: 620 FMI: 3 Lamp: Yellow SRT:	High voltage detected on the internal electronic control module (ECM) supply wire to the sensors.	Engine is derated to no-air setting.

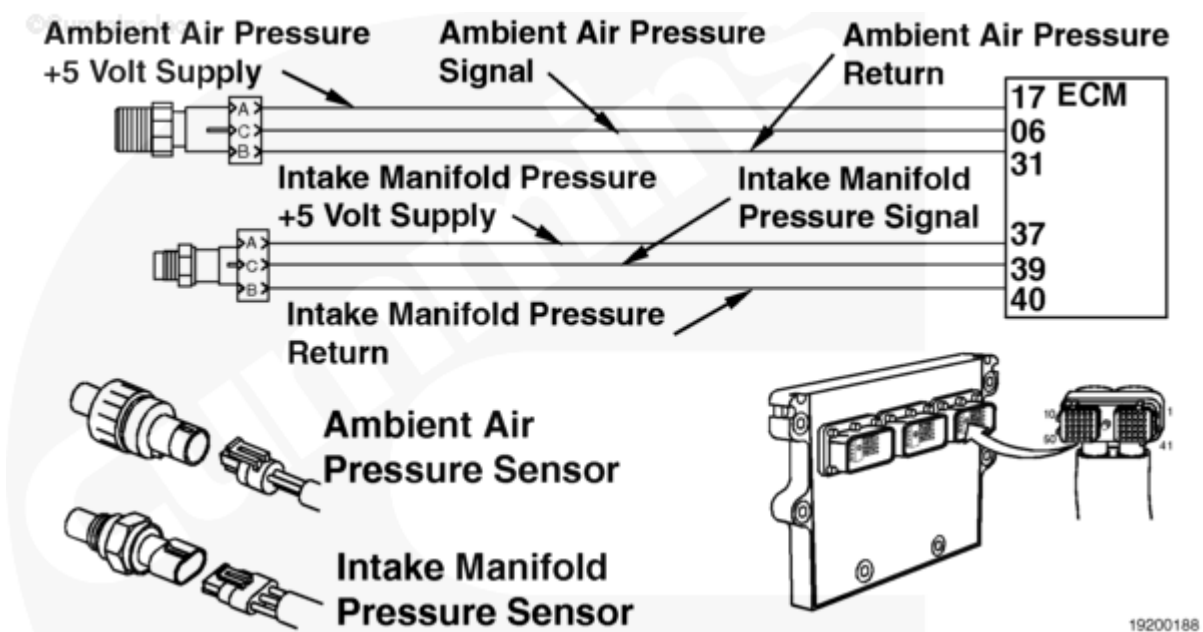

Sensor Voltage Supply Circuit

Circuit Description

The ECM supplies each of these sensors with +5 VDC. If the supply wire to any sensor is damaged, the sensor will **not** work correctly.

Component Location

There are two components involved in the sensor voltage supply: The intake manifold pressure sensor and the ambient air pressure sensor. The ambient air pressure sensor is located to the left of the ECM when looking at the side of the engine opposite the intake manifold. The intake manifold pressure sensor is located on the topside of the intake manifold toward the front of the engine.

Shoptalk

High voltage on the sensor +5-VDC supply wire will be caused by a short to battery of the supply wire or a short between an actuator wire and the supply wire.

Refer to Troubleshooting Fault Code t05-386 (</qs3/pubsys2/xml/en/procedures/82/82-t05-386.html>)

Last Modified: 02-Sep-2010
