


Fault Code: 387

Throttle Voltage Supply

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 387 PID(P): P221 SPN: 1043 FMI: 3/3 Lamp: Yellow SRT:	High voltage detected on the ECM voltage supply line to the throttle(s) (VTP supply).	Engine will only idle.

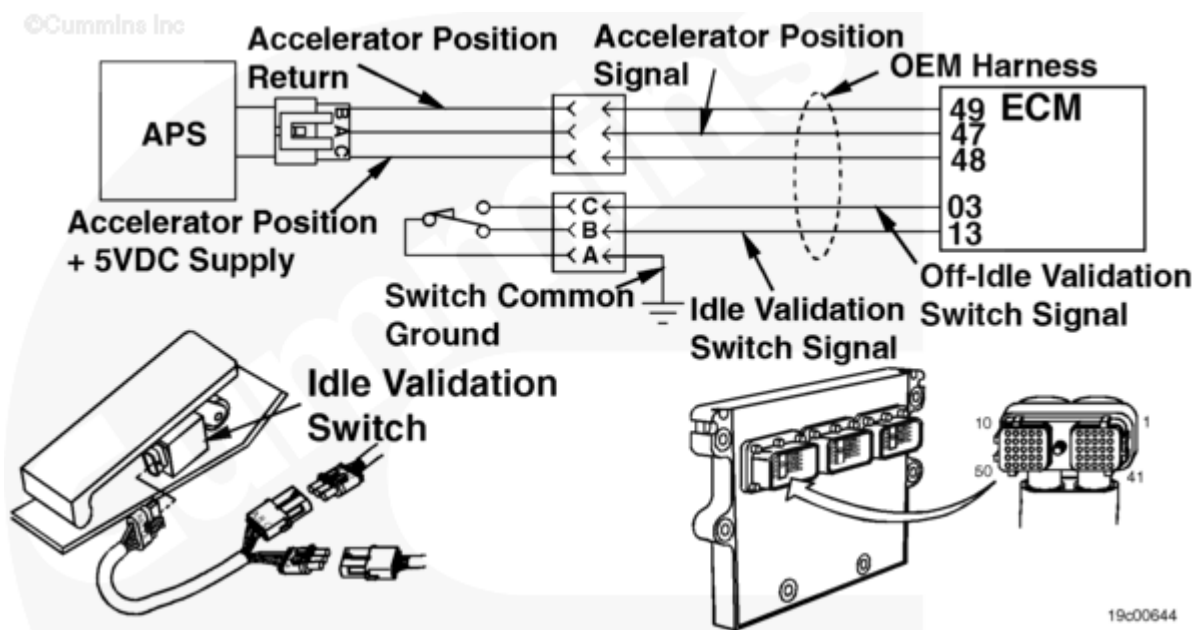

Throttle Sensor Supply Voltage Circuit

Circuit Description

The ECM supplies the throttle and remote throttle with +5 VDC. If the supply line to the throttles is damaged, the throttle will **not** work correctly.

Component Location

The throttle pedal is located in the cab. Refer to the OEM troubleshooting and repair manual for the location of the remote throttle.

Shoptalk

High voltage on the + 5-VDC supply line will be caused by a short circuit to battery of the supply line or a short circuit between an actuator and the supply line.

Refer to Troubleshooting Fault Code t05-387 (</qs3/pubsys2/xml/en/procedures/82/82-t05-387.html>)

Last Modified: 02-Sep-2010
