


## Fault Code: 392

### Engine Brake Supply Circuit

 Printable Version

## Overview

| Codes                                                                               | Reason                                                                                                                                                                  | Effect                                      |
|-------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------------------------------------|
| Fault Code: 392<br><br>PID(P): S080<br>SPN: 1073<br>FMI: 11<br>Lamp: Yellow<br>SRT: | Less than 6 VDC detected at engine brake circuit 2 when on indicates an excessive current draw from the electronic control module (ECM) or a faulty ECM output circuit. | Engine brake 2 can <b>not</b> be activated. |

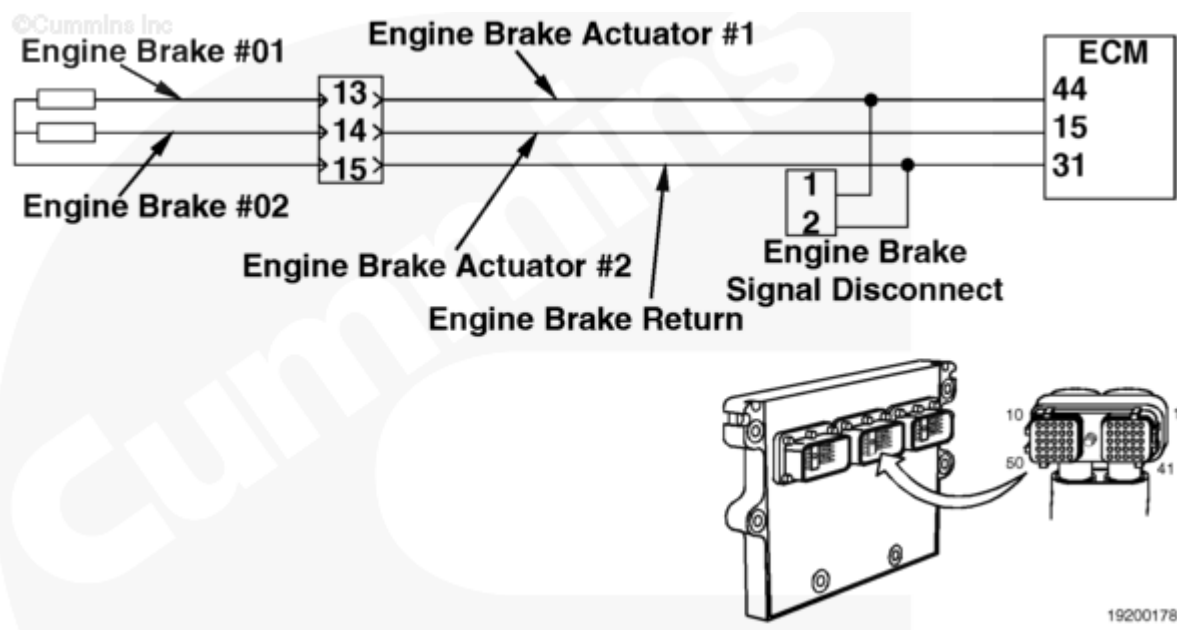

Engine Brake Relay Supply Circuit

## Circuit Description

The ECM enables the engine brake by sending a signal directly to the engine brakes. The ECM will **only** enable the engine brakes under certain operating conditions.

## Component Location

Refer to an OEM diagram for the location of the engine brake.

## Shoptalk

A possible cause for this fault code is an ECM engine brake driver 2 short to ground.

Refer to Troubleshooting Fault Code t05-392 (</qs3/pubsys2/xml/en/procedures/82/82-t05-392.html>)

---

**Last Modified: 02-Sep-2010**

---