


## Fault Code: 428

### Water-In-Fuel (WIF) Sensor Circuit

 Printable Version

#### Overview

| Codes                                                                              | Reason                                                       | Effect               |
|------------------------------------------------------------------------------------|--------------------------------------------------------------|----------------------|
| Fault Code: 428<br><br>PID(P): P097<br>SPN: 97<br>FMI: 3/3<br>Lamp: Yellow<br>SRT: | High voltage detected at water-in-fuel (WIF) sensor circuit. | None on performance. |

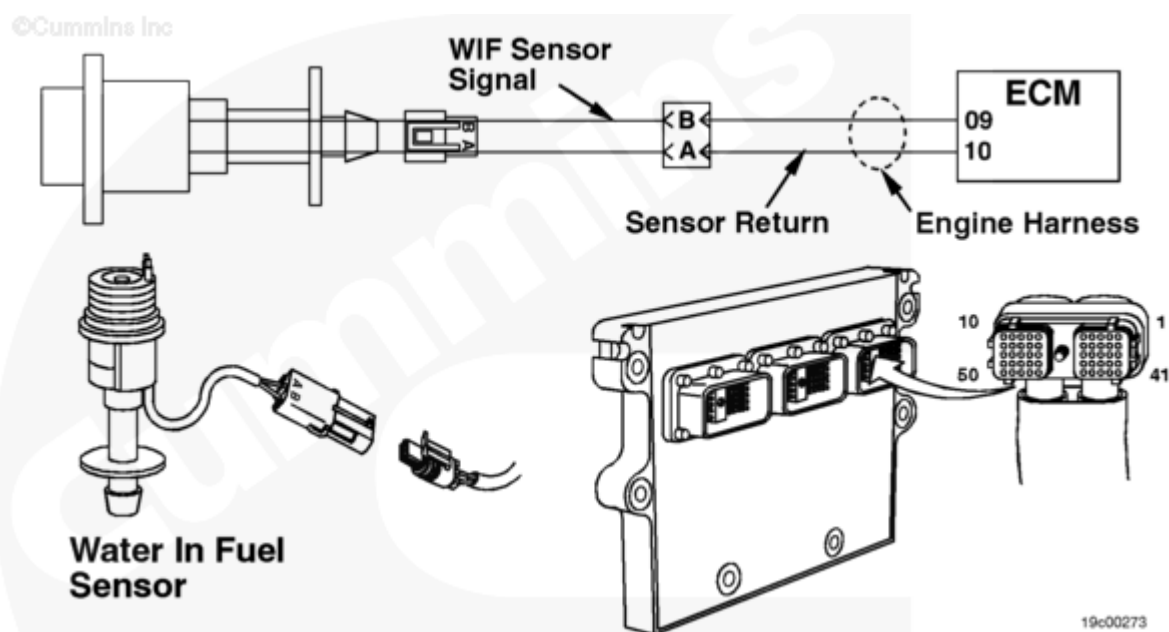

WIF Sensor Circuit

#### Circuit Description

The WIF sensor is attached to the fuel filter. The WIF sensor sends a signal to the electronic control module (ECM) when a set volume of water has accumulated in the fuel filter. The WIF circuit contain two wires: A return ground (pin 10) and a signal wire (pin 9).

#### Component Location

The WIF sensor is installed in the fuel filter and is located on the side of the head, approximately midengine.

## Shoptalk

Possible causes for this fault code include: Short circuit to a + 5-VDC supply wire.

Refer to Troubleshooting Fault Code t05-428 (</qs3/pubsys2/xml/en/procedures/82/82-t05-428.html>)

---

**Last Modified: 02-Sep-2010**

---