


Fault Code: 443

Throttle Voltage Supply



Overview

Codes	Reason	Effect
Fault Code: 443 PID(P): S221 SPN: 1043 FMI: 4/4 Lamp: Yellow SRT:	Low voltage detected on the electronic control module (ECM) voltage supply line to the throttle(s).	Engine will only idle.

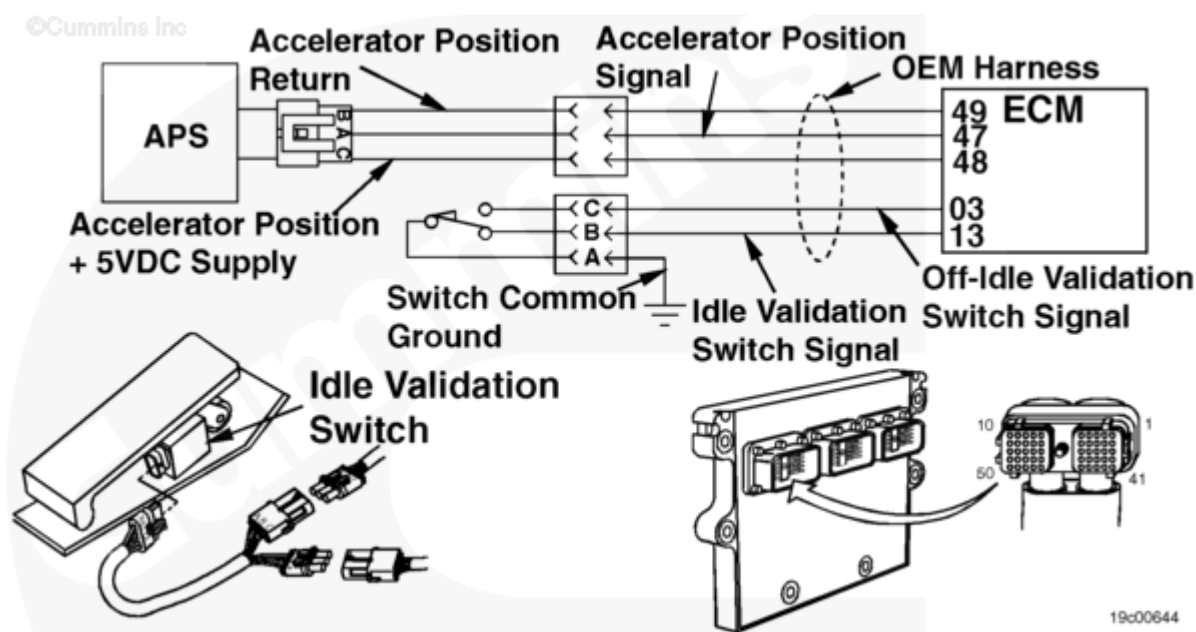

Throttle Position Supply Voltage Circuit

Circuit Description

The ECM supplies the accelerator and the remote throttle with +5 VDC. If the supply line to the accelerators is damaged, the accelerators will **not** work correctly.

Component Location

Accelerator pedal is located in the cab. Refer to the OEM manual for remote throttle location.

Shoptalk

Low voltage on the +5-VDC supply line will be caused by a short circuit to ground in a supply line, a short circuit between a supply line or a return line, a failed accelerator, or a failed ECM power supply.

Refer to Troubleshooting Fault Code t05-443 (</qs3/pubsys2/xml/en/procedures/82/82-t05-443.html>)

Last Modified: 02-Sep-2010
