


Fault Code: 476

Electronic Air Compressor Governor Circuit

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 476 PID(P): S089 SPN: 1351 FMI: 3/3 Lamp: Yellow SRT:	High voltage or an open circuit detected at the electronic air compressor governor actuator circuit.	Air compressor runs continuously or not at all.

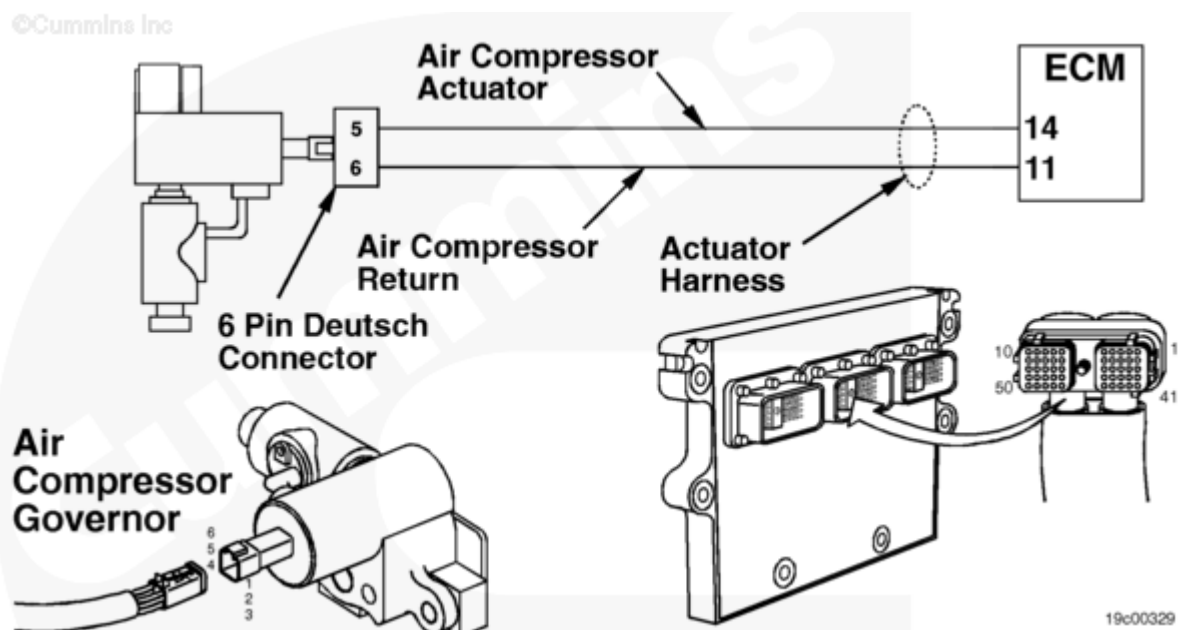

Electronic Air Compressor Governor Circuit

Circuit Description

The electronic air compressor governor is a device used by the electronic control module (ECM) to control the output of the air compressor.

Component Location

The air compressor governor actuator is located on top of the air compressor.

Shoptalk

High voltage can be caused by a short circuit to battery or a short circuit to another wire in the harness.

Voltage is required at the electronic air compressor governor to turn the compressor off. No voltage turns the compressor on.

Refer to Troubleshooting Fault Code t05-476 (</qs3/pubsys2/xml/en/procedures/82/82-t05-476.html>)

Last Modified: 02-Sep-2010
