


Fault Code: 113

Sleeve Actuator Circuit

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 113 PID(P): S020 SPN: 635 FMI: 3 Lamp: Yellow SRT:	More than 6.2 amps detected at timing sleeve actuator circuit pin 6 of the engine harness.	No action by the electronic control module (ECM) is taken. The engine can have low-power outputs, loud combustion noise, and produce black smoke.

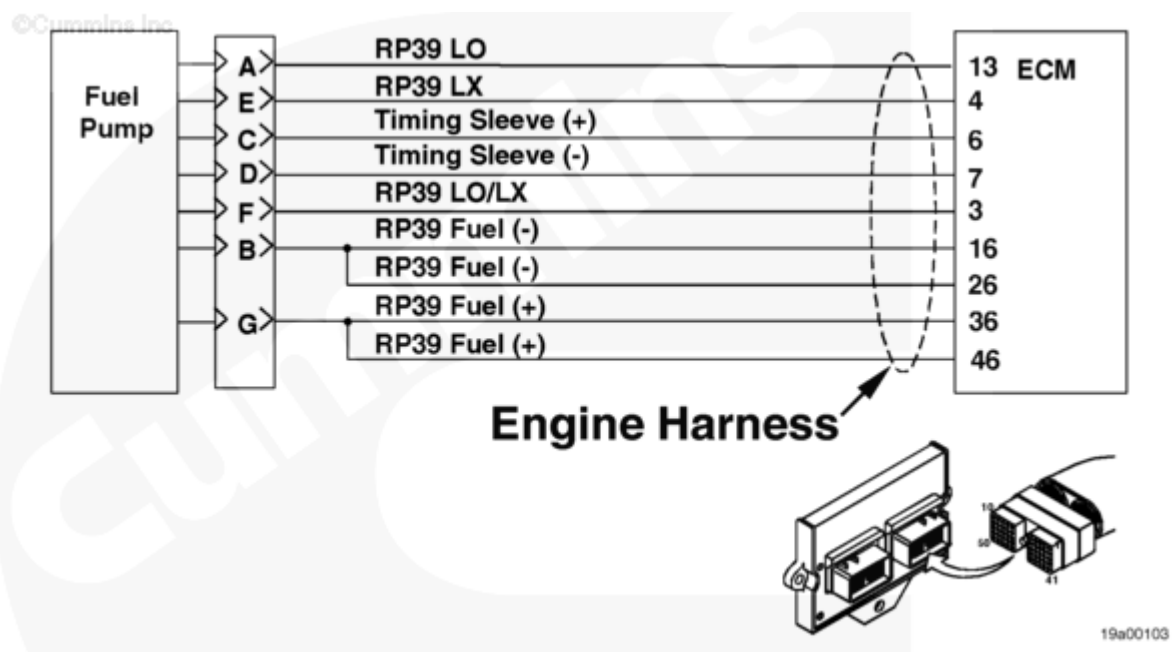

Sleeve Actuator Circuit

Circuit Description

The sleeve actuator circuit is used to control the start of injection through pin 6 of the engine harness. The ECM monitors the current on pin 6 and expects to see the amperage vary between 1.0 and 6.2 amps during normal engine operation. Amperage above 6.2 amps on pin 6 will trip Fault Code 113.

Component Location

The sleeve actuator circuit is an integral part of the RP39 fuel pump.

Shoptalk

This fault can be caused by an internal ECM problem or an alternate power source. There are no repairs possible for the module in the field.

Refer to Troubleshooting Fault Code t05-113 (</qs3/pubsys2/xml/en/procedures/87/87-t05-113.html>)

Last Modified: 29-Jul-2010
