


Fault Code: 114

Sleeve Actuator Circuit

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 114 PID(P): S020 SPN: 635 FMI: 4 Lamp: Yellow SRT:	Less than 1.0 amp is detected at the sleeve actuator circuit pin 6 of the engine harness.	No action by the electronic control module (ECM) is taken. Engine emits white smoke and loses power.

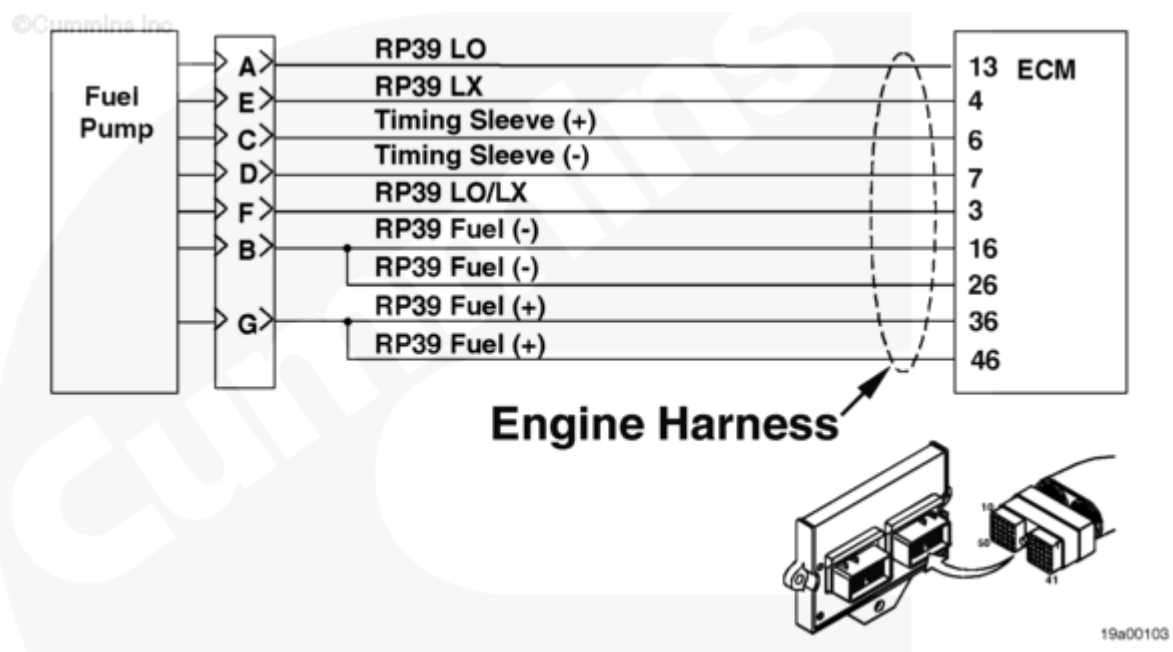

Sleeve Actuator Circuit

Circuit Description

The sleeve actuator circuit is used to control the start of injection through pin 6 of the engine harness. The ECM monitors the current on pin 6 and expects to see the amperage vary between 1.0 and 6.2 amps during normal engine operation. Amperage below 1.0 amp on pin 6 will trip Fault Code 114.

Component Location

The sleeve actuator circuit is an integral part of the RP39 fuel pump.

Shoptalk

This fault can be caused by an internal ECM problem or a open circuit in the wiring. There are no repairs possible for the module in the field.

Refer to Troubleshooting Fault Code t05-114 (</qs3/pubsys2/xml/en/procedures/87/87-t05-114.html>)

Last Modified: 29-Jul-2010
