


Fault Code: 123

Intake Manifold Pressure Sensor Circuit

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 123 PID(P): P102 SPN: 102 FMI: 4 Lamp: Yellow SRT:	Less than 0.33 VDC detected at the intake manifold air pressure sensor signal pin 45 of the engine harness.	Engine power derate to no-air setting.

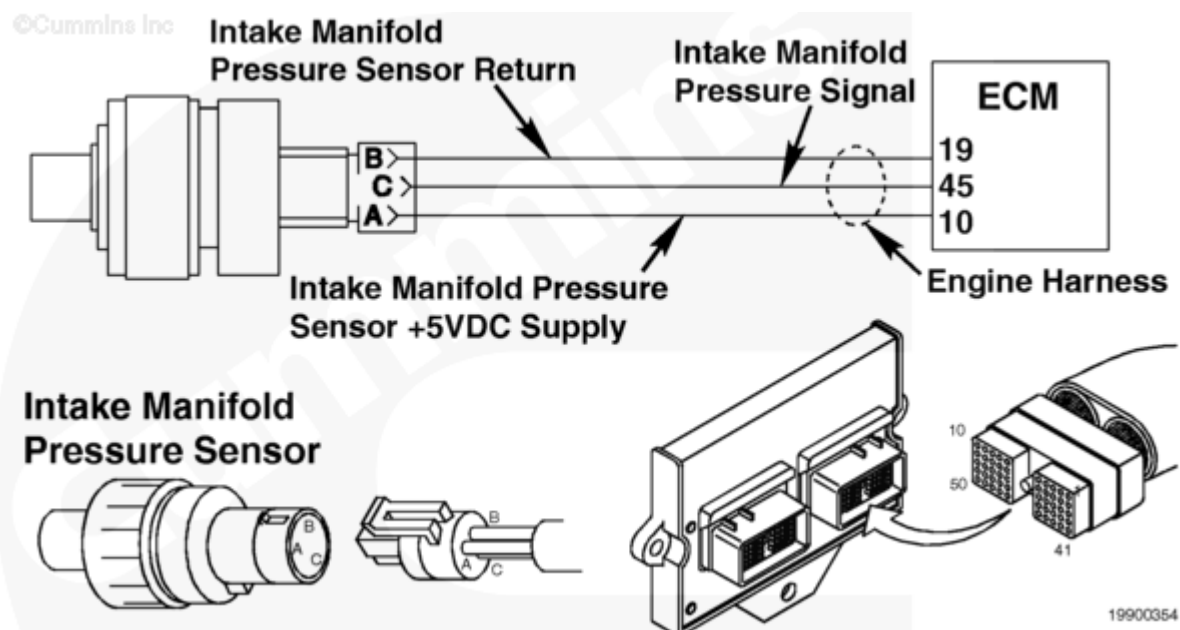

Intake Manifold Pressure Sensor Circuit

Circuit Description

The intake manifold pressure sensor monitors boost pressure and passes information to the electronic control module (ECM) through pin 45 of the engine harness.

The ECM monitors the voltage on pin 45 and expects to see the voltage vary between 0.5 and 4.5 VDC during normal engine operation.

Voltage below 0.33 VDC on pin 45 will result in Fault Code 123.

Component Location

Two intake manifold pressure sensors are found on the QST30 industrial engine, one on each side. They are located either in the intake manifold or in front of each ECM.

Shoptalk

- The intake manifold pressure sensor measures gauge pressure. Confirm that the sensor is reading properly by comparing the reading seen in the ECM with a reading taken with a mechanical gauge. The sensor should read -1.5 to +1.5 in Hg using INSITE™, with the keyswitch turned to the ON position, but the engine **not** running.
- Check for high restriction in the intake air manifold due to clogged air filters or a shutdown device in the manifold (if the vehicle is equipped with one). Do **not** remove this device. If the engine is operated in a flammable atmosphere, the device is an essential safety feature.
- Make sure the turbocharger is working correctly. Check for a positive intake manifold pressure.

Refer to Troubleshooting Fault Code t05-123 (/qs3/pubsys2/xml/en/procedures/87/87-t05-123.html)