


Fault Code: 131

Accelerator Position Sensor

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 131 PID(P): P091 SPN: 091 FMI: 3 Lamp: Red SRT:	Excessive voltage detected at the accelerator position signal pin 30 of the OEM interface harness.	Calibration-dependent power and speed derate.

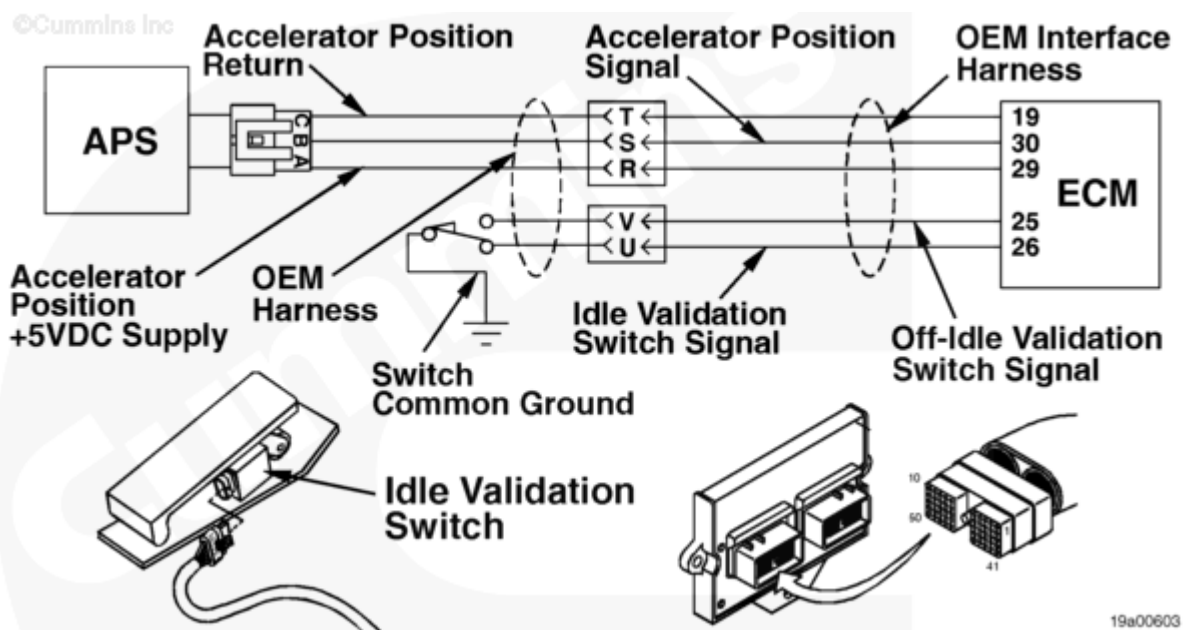

Accelerator Position Sensor

Circuit Description

The accelerator pedal provides the driver's accelerator command to the electronic control module (ECM) through the OEM harness and the OEM interface harness. The ECM uses this signal to determine the fueling command for the RP39 fuel pump rack.

Component Location

The accelerator pedal location varies with each OEM. Refer to the OEM troubleshooting and repair manual.

Shoptalk

The accelerator position sensor is a potentiometer. The resistance specifications of the accelerator position sensor are as follow:

- Between supply and return = 2000 to 3000 ohms
- Between supply and signal: Released = 1500 to 3000 ohms, Depressed = 200 to 1500 ohms.

Note: If the accelerator or accelerator position sensor is changed, or after a calibration download, cycle the accelerator pedal (turn keyswitch ON) through its complete travel three times. This procedure calibrates the new accelerator with the ECM.

Refer to Troubleshooting Fault Code t05-131 (</qs3/pubsys2/xml/en/procedures/87/87-t05-131.html>)

Last Modified: 29-Jul-2010
