


## Fault Code: 134

### Remote Accelerator Position Sensor (Remote Accelerator)

 Printable Version

#### Overview

| Codes                                                                          | Reason                                                                                                                                 | Effect                                        |
|--------------------------------------------------------------------------------|----------------------------------------------------------------------------------------------------------------------------------------|-----------------------------------------------|
| Fault Code: 134<br><br>PID(P): P029<br>SPN: 029<br>FMI: 4<br>Lamp: Red<br>SRT: | Low voltage detected at the remote accelerator position signal pin 9 of the original equipment manufacturer's (OEM) interface harness. | Calibration-dependent power and speed derate. |

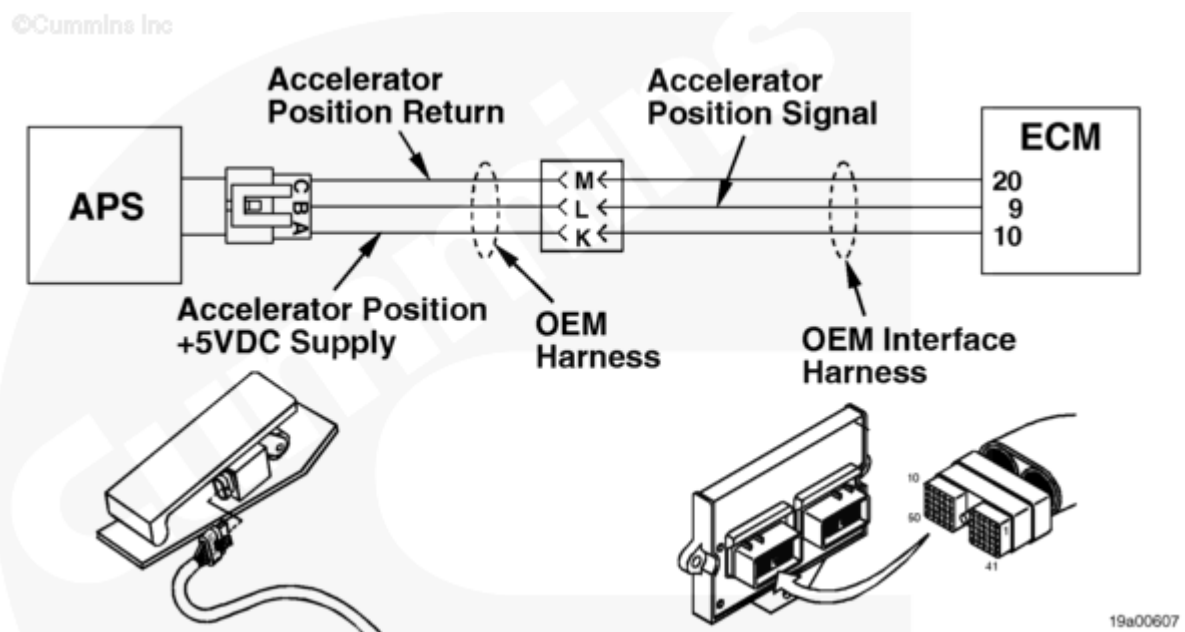

Remote Accelerator Position Sensor

#### Circuit Description

The remote accelerator pedal provides a second accelerator command to the electronic control module (ECM) through the OEM harness and the OEM interface harness. The ECM uses this signal in place of the primary accelerator to determine the fueling command for the RP39 fuel pump rack.

## Component Location

The remote accelerator pedal location varies with each OEM. Refer to the OEM manual.

## Shoptalk

The remote accelerator is used in place of the primary accelerator when the operator signals the ECM by grounding pin 45 on the OEM harness. The accelerator position sensor is a potentiometer. The resistance specifications of the accelerator position sensor are as follow:

- Between supply and return = 2000 to 3000 ohms
- Between supply and signal: Released = 1500 to 3000 ohms, Depressed = 200 to 1500 ohms.

Note: If the accelerator or accelerator position sensor is changed, or after a calibration download, cycle the accelerator pedal (turn keyswitch ON) through its complete travel three times. This procedure calibrates the new accelerator with the ECM.

Refer to Troubleshooting Fault Code t05-134 (</qs3/pubsys2/xml/en/procedures/87/87-t05-134.html>)

---

**Last Modified: 29-Jul-2010**

---