


## Oil Pressure Sensor Circuit



## Overview

| Codes                                                                             | Reason                                                                                               | Effect                                             |
|-----------------------------------------------------------------------------------|------------------------------------------------------------------------------------------------------|----------------------------------------------------|
| Fault Code: 135<br><br>PID(P): P100<br>SPN: 100<br>FMI: 3<br>Lamp: Yellow<br>SRT: | More than 4.88 VDC<br>detected at the oil pressure<br>sensor signal pin 33 of the<br>engine harness. | Engine protection for oil<br>pressure is disabled. |

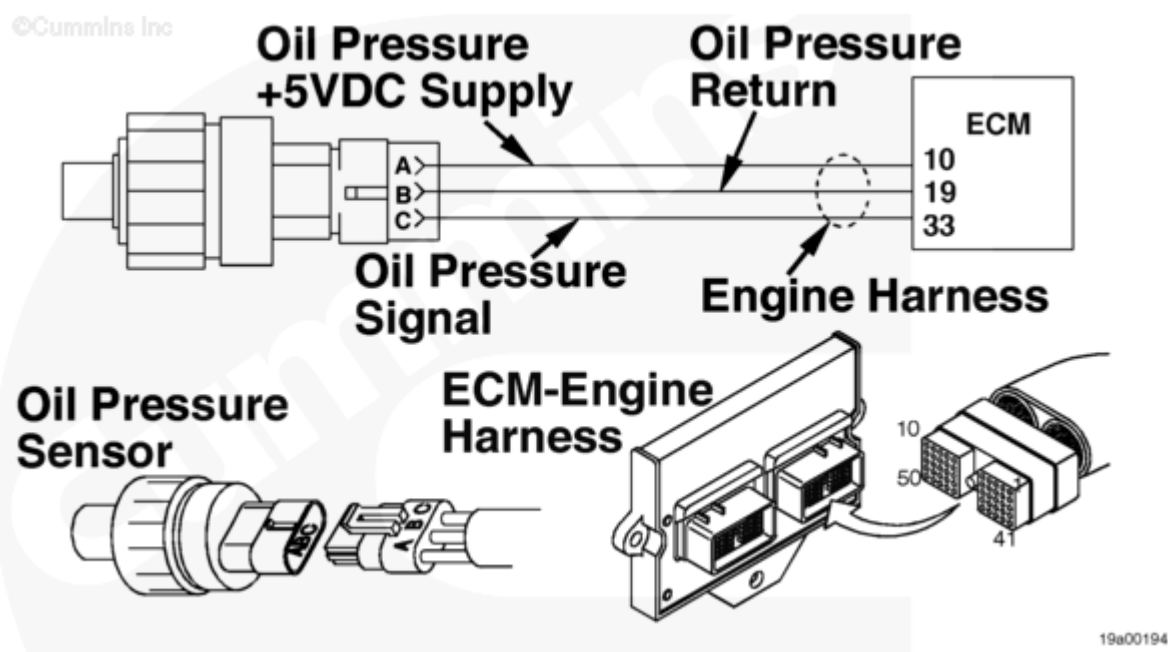

## Oil Pressure Sensor Circuit

## Circuit Description

The oil pressure sensor monitors oil pressure and passes information to the electronic control module (ECM) through pin 33 of the engine harness.

The ECM monitors the voltage on pin 33 and expects to see the voltage vary between 0.5 and 4.5 VDC during normal engine operation.

Voltage above 4.88 VDC on pin 33 will trip Fault Code 135 and can be caused by short circuits in the supply, signal or return wires, an open in the return wire, or a failed sensor.

## Component Location

The oil pressure sensor is located on the left side of the engine block to the rear of the fuel pump.

## Shoptalk

- Does the fault occur **only** in cold weather? If so, allow the oil to warm up and see if the fault goes inactive.
- If Fault Code 143 or 415 is **not** present, the problem is **not** base engine related.

Refer to Troubleshooting Fault Code t05-135 (</qs3/pubsys2/xml/en/procedures/87/87-t05-135.html>)