


Fault Code: 147

Frequency Accelerator Circuit

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 147 PID(P): P091 SPN: 091 FMI: 8 Lamp: Red SRT:	An excessively low frequency has been detected at frequency accelerator signal pin 14 of the engine harness.	Calibration-dependent power and speed derate.

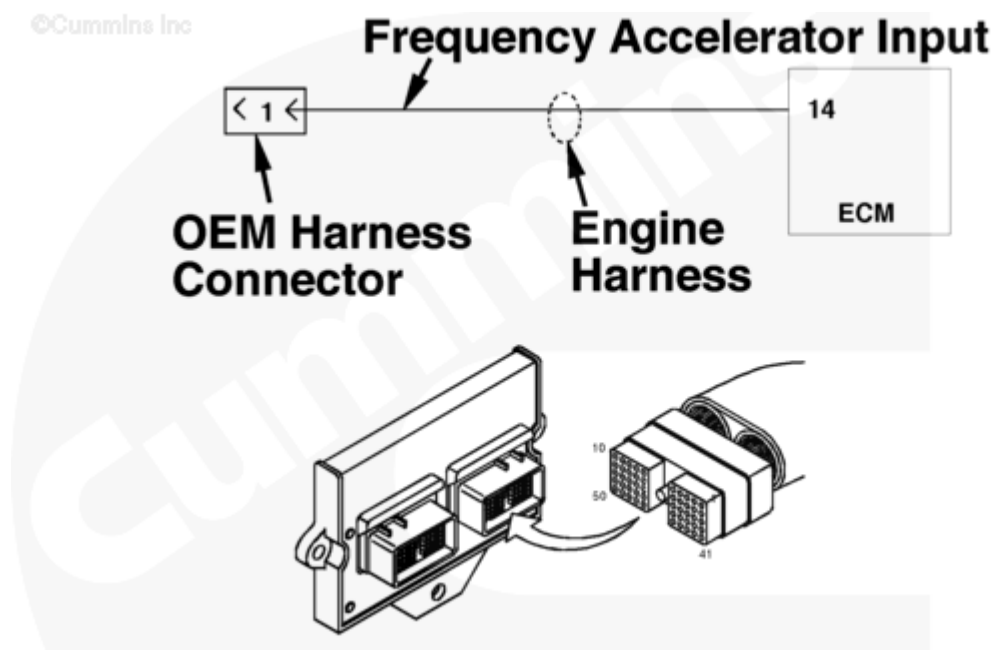

Frequency Accelerator Circuit

Circuit Description

The accelerator pedal provides the driver's accelerator command to the electronic control module (ECM) through the OEM harness and the OEM interface harness. The ECM uses this signal to determine the fueling command for the rack position actuator.

Component Location

The accelerator pedal location varies with each OEM. Refer to the OEM manual.

Shoptalk

The frequency accelerator can be used either in conjunction with a voltage accelerator or by itself. The QST30 industrial left-bank engine harness contains a small triangular connector that contains a diode and resistor, Part Number 3659399, which is located about 1 foot from the left-bank ECM. The purpose of this component is for applications that use a frequency accelerator. This component is used in all QST30 industrial left-bank engine harnesses, whether or **not** the application uses a frequency accelerator.

The frequency accelerator supply signal is generated by the same OEM device, and that signal is sent to the accelerator and/or ECM on pin 14 of the engine harness. Troubleshoot the frequency signal supply device to be sure that the signal is being supplied correctly to the accelerator/ECM.

Refer to Troubleshooting Fault Code t05-147 (</qs3/pubsys2/xml/en/procedures/87/87-t05-147.html>)

Last Modified: 29-Jul-2010
