

Fault Code: 184


Primary/Secondary Electronic Control Modules (ECM) Identification Error

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 184 PID(P): S233 SPN: 609 FMI: 2 Lamp: Red SRT:	Primary and/or secondary ECM identification error.	Module identification at power-up will fail; both modules will run as secondary ECMs. Possible loss of performance.

©Cummins Inc

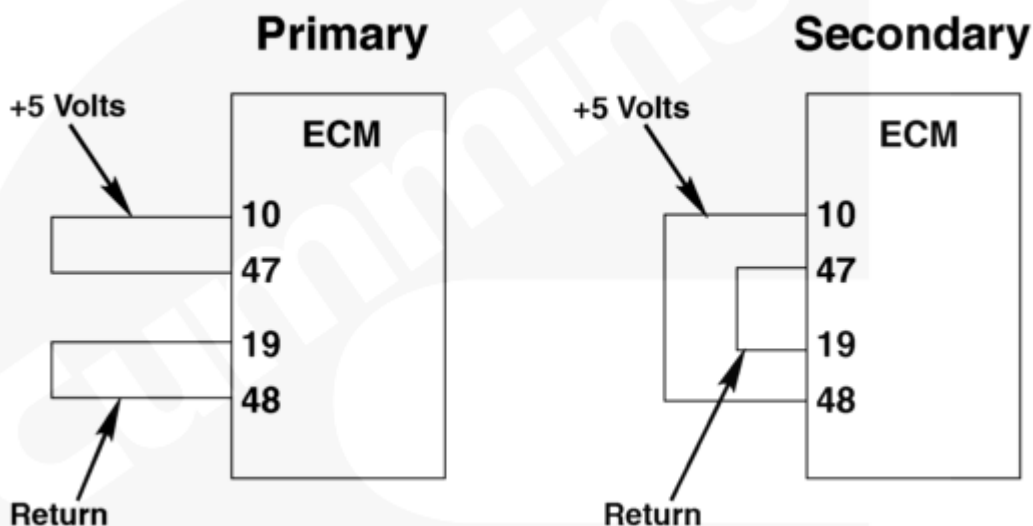

19a00382

Primary/Secondary ECM Identification Error

Circuit Description

The QST30 control system utilizes two ECMs, one primary and one secondary.

Component Location

One ECM is located on both sides of the engine in front of the fuel pumps.

Shoptalk

Identification between primary and secondary modules is done at key-on through the harness. Pins 47 and 48 of the engine harness for each bank provide the determination of primary or secondary. Reference the following table for primary/secondary identification:

ECM Identification	VDC at Pin 47	VDC at Pin 48
Primary	+5 VDC	0 VDC
Secondary	0 VDC	+5 VDC

Refer to Troubleshooting Fault Code t05-184 (</qs3/pubsys2/xml/en/procedures/87/87-t05-184.html>)

Last Modified: 29-Jul-2010
