


Fault Code: 234

Engine Overspeed

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 234 PID(P): P190 SPN: 190 FMI: 0 Lamp: Red SRT:	Engine speed signal on pin 17 and/or pin 9 of the engine harness indicated engine speed is greater than the calibrated value (2650 rpm).	The EHAB (fuel shutoff valve) is de-energized (closed). The EHAB (fuel shutoff valve) is reenergized (opened) when engine speed falls below the calibrated value (2130 rpm).

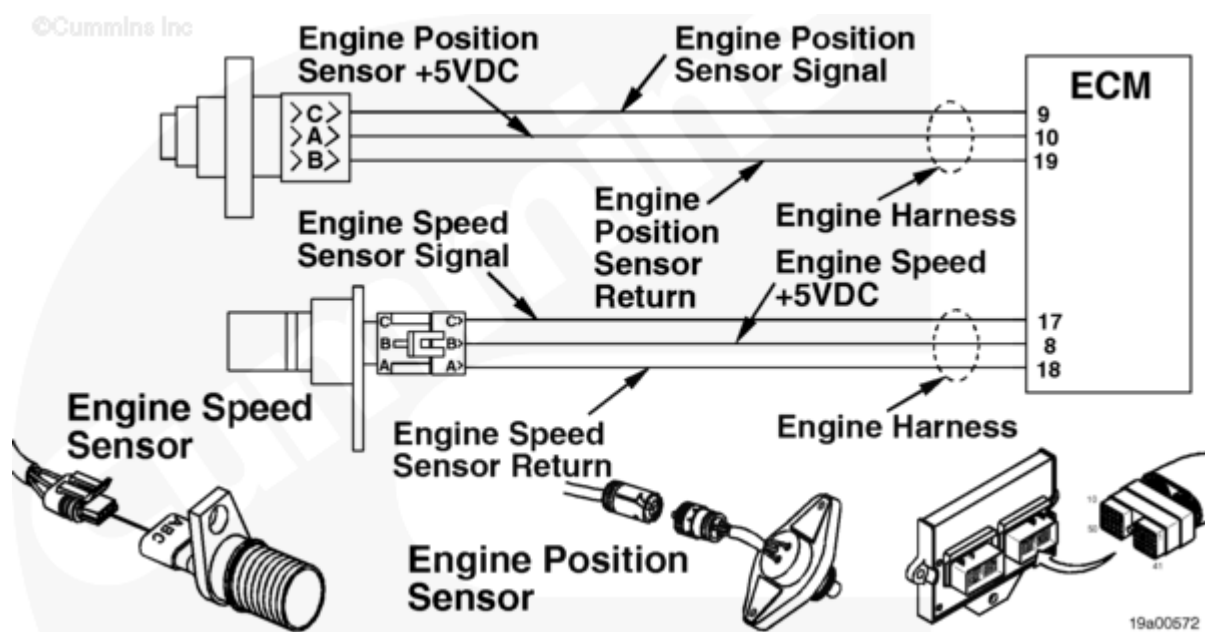

Engine Speed Sensor Circuit

Circuit Description

The engine speed sensor monitors the engine position and the engine speed and passes this information to the electronic control module (ECM) through the engine harness.

Component Location

The engine speed sensor and the engine position sensor are located in the flywheel housing.

Shoptalk

- Inspect the intake manifold for sources of flammable vapors. Check the turbocharger seals to verify that there are no oil leaks.
- Inspect the engine speed sensor for signs of damage or tampering.

Refer to Troubleshooting Fault Code t05-234 (</qs3/pubsys2/xml/en/procedures/87/87-t05-234.html>)

Last Modified: 29-Jul-2010
