


Fault Code: 235

Engine Coolant Level - Engine Protection

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 235 PID(P): P111 SPN: 111 FMI: 1 Lamp: Engine Protection SRT:	Low coolant level has been detected. Voltage signal on the coolant level signal pin 37 of the engine harness indicates low radiator coolant level on the vehicle.	Calibration-dependent progressive power and speed derate and engine shutdown with increasing time after alert.

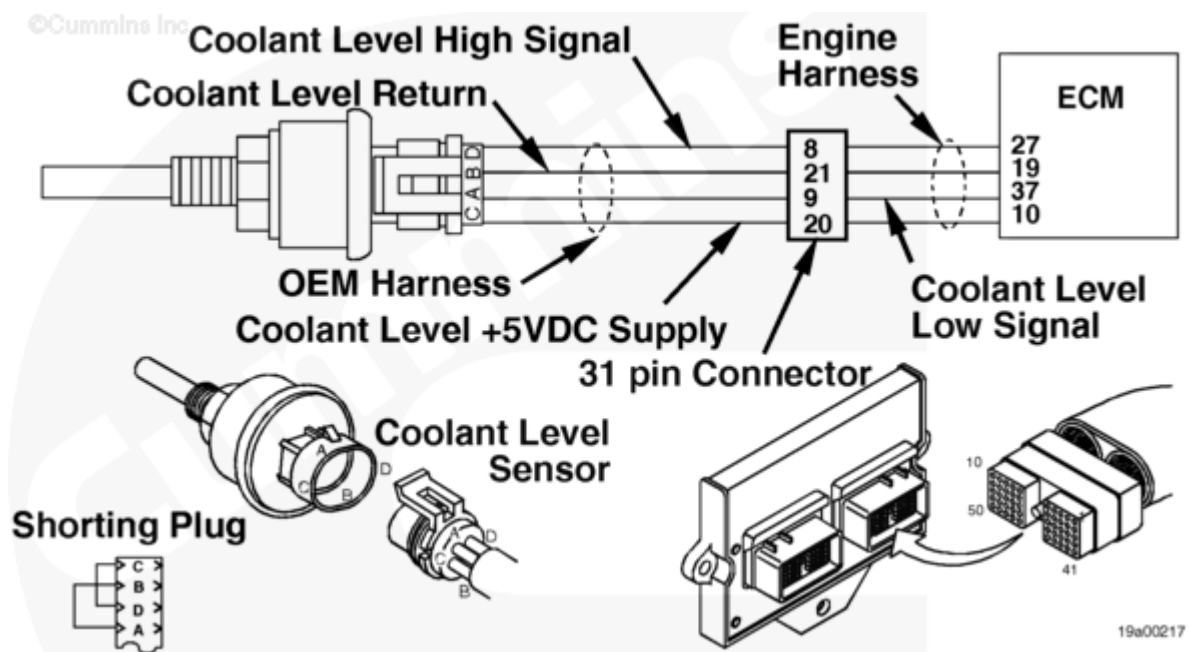

Coolant Level Sensor Circuit

Circuit Description

The coolant level sensor monitors the coolant level within the coolant system and passes information to the electronic control module (ECM) through the engine harness.

Component Location

The coolant level sensor is located in the radiator top tank or surge tank.

Shoptalk

This is an OEM-supplied component and will vary in sensor location.

- When the coolant level drops below a certain level, a power derate, speed derate, or shutdown will be activated.
- If a shorting plug is used in the coolant level circuit, verify that it is wired correctly.
- Inspect the wiring harness between the 4-pin Weather-Pack connector and the coolant level sensor for damage.
- Make sure the coolant level sensor is located in the middle of the tank rather than off to one side where the coolant level can change when the vehicle turns a corner.

Note: The number of fault lamps could be reduced to two for certain OEMs. The engine protection and stop lamps are wired together as a red lamp. The warning lamp remains a yellow lamp.

Refer to Troubleshooting Fault Code t05-235 (</qs3/pubsys2/xml/en/procedures/87/87-t05-235.html>)