


Fault Code: 423

Sleeve Actuator Circuit

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 423 PID(P): 156 SPN: 156 FMI: 2 Lamp: Yellow SRT:	Unable to achieve the requested pump timing. This fault can be caused by incorrect static pump timing, clogged fuel filters or inlet screen, a stuck timing sleeve, air in the fuel lines, or calibration errors.	No action is taken by the electronic control module. Power output can be low and engine can produce white or black smoke.

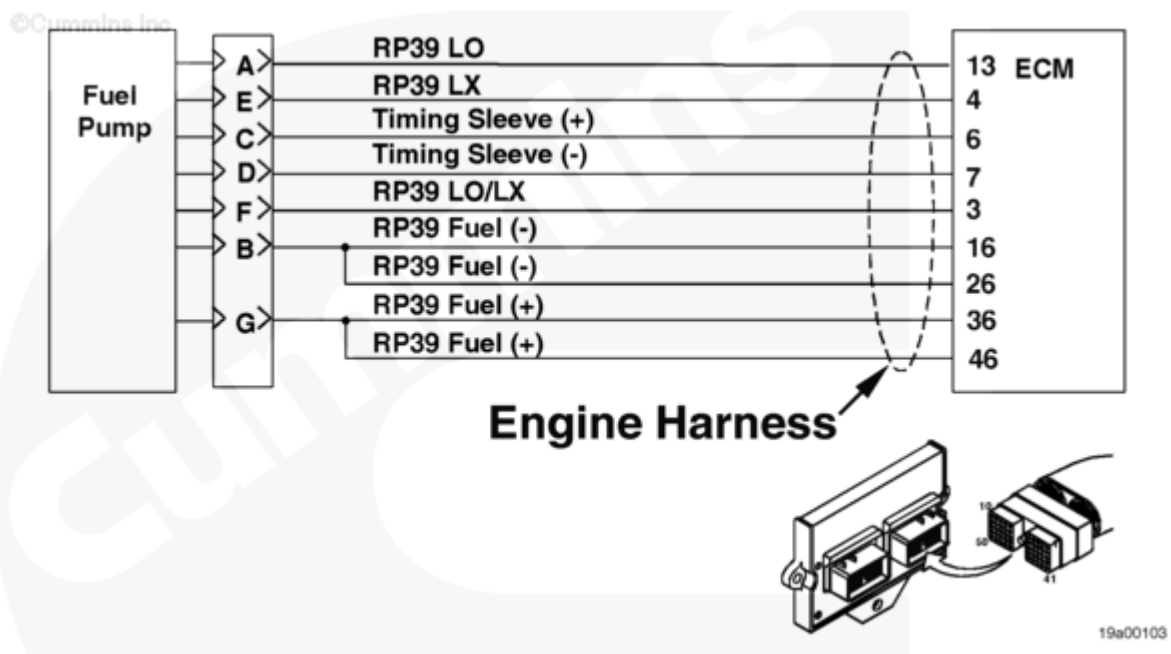

Sleeve Actuator Circuit

Circuit Description

The sleeve actuator circuit is used to control the start of injection through pin 6 of the engine harness. The electronic control module monitors the current on pin 6 and expects the amperage to vary between 1.0 and 6.2 amperes during normal engine operation.

Component Location

The sleeve actuator circuit is an integral part of the RP39 fuel pump.

Shoptalk

Increasing the current supplied to the sleeve actuator circuit increases the timing advancement of injection.

A stuck timing sleeve can be the result of fuel contamination.

High fuel inlet restriction and/or low fuel level may cause a low power condition.

Refer to Troubleshooting Fault Code t05-423 (</qs3/pubsys2/xml/en/procedures/87/87-t05-423.html>)

Last Modified: 29-Jul-2010
