


Fault Code: 442

Unswitched Battery Supply Circuit

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 442 PID(P): P168 SPN: 168 FMI: 0 Lamp: Yellow SRT:	More than 35.0-VDC battery voltage detected at the electronic control module (ECM).	ECM damage will occur.

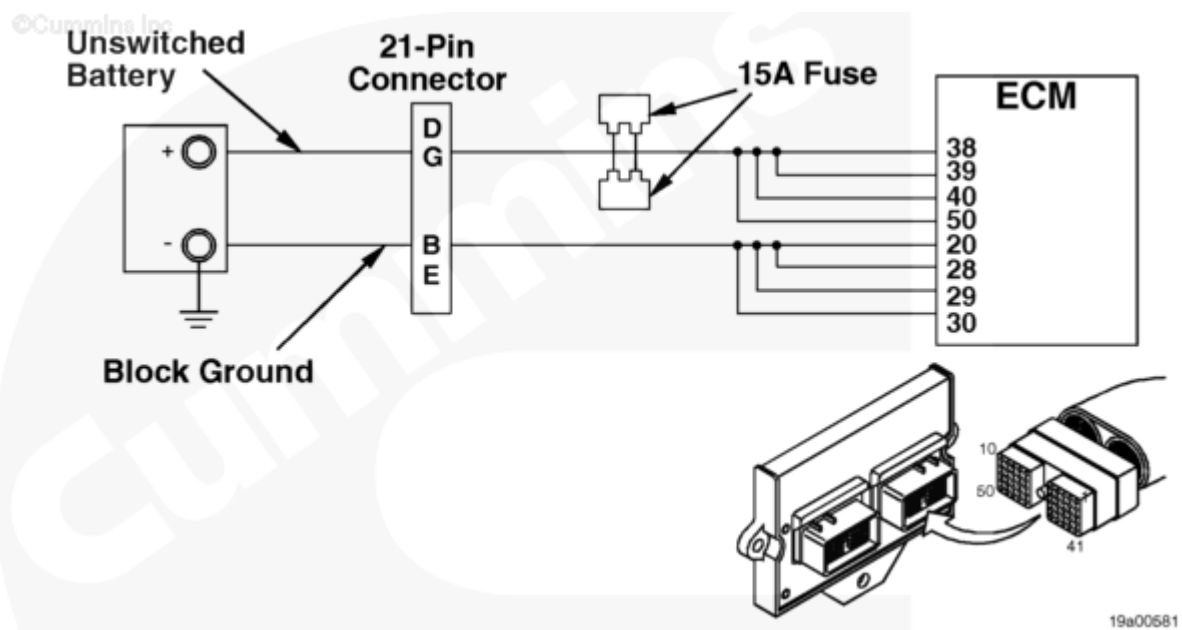

Unswitched Battery Supply Circuit

Circuit Description

The ECM receives unswitched battery voltage through the OEM harness and engine harness. There is an in-line 15-amp fuse in the unswitched battery wire of the OEM interface harness to protect the ECM. The battery return wires in the engine harness are connected to the engine block ground.

Component Location

The location of the battery will vary with the OEM. Refer to the OEM manual for the battery location.

Shoptalk

This fault is usually caused by improper wiring of the battery circuit.

Refer to Troubleshooting Fault Code t05-442 (</qs3/pubsys2/xml/en/procedures/87/87-t05-442.html>)

Last Modified: 29-Jul-2010
