


Fault Code: 524

Alternate Droop Switch Circuit

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 524 PID(P): P113 SPN: 113 FMI: 2 Lamp: Yellow SRT:	Electronic control module (ECM) has detected an invalid droop selection switch on pin 22 of the engine harness, indicating the value is out of range.	Droop selection is disabled. Droop setting defaults to switch position 1 (or normal) preprogrammed droop governor values.

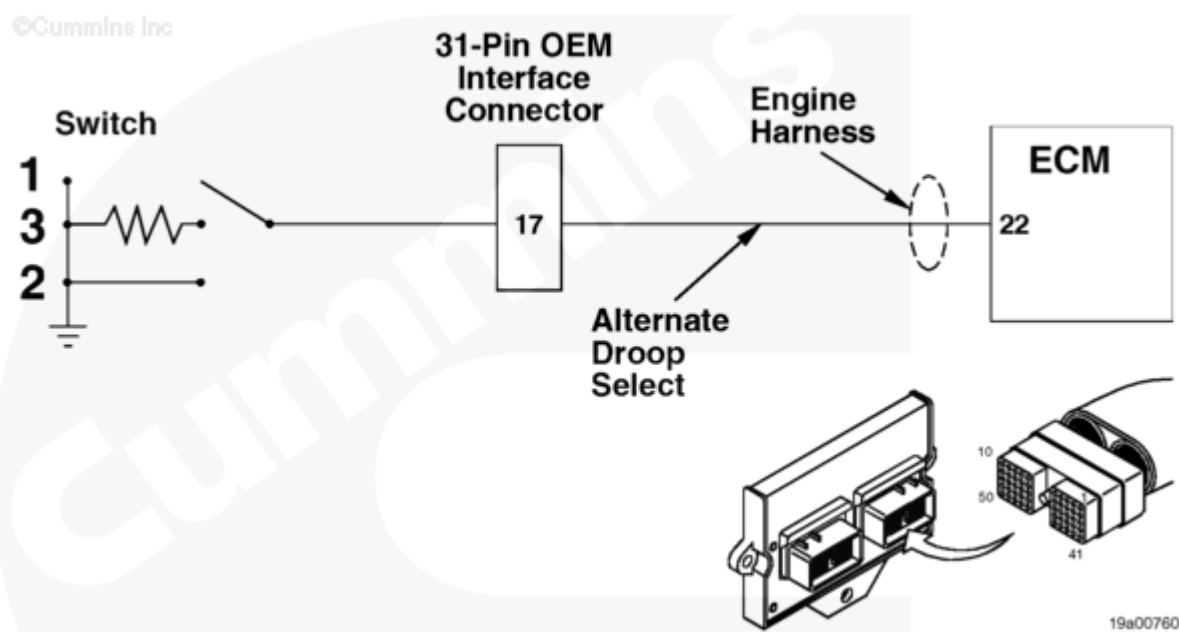

Alternate Droop Switch Circuit

Circuit Description

The alternate droop switch circuit allows the operator to select from three preprogrammed droop values using a tristate switch.

Component Location

The location of the alternate droop switch circuit varies with each OEM and equipment model. Refer to the OEM manual.

Shoptalk

The switch should be monitored for proper operation on INSITE™. If the switch is changing state correctly on the service tool, then the problem is **not** in the switch circuit. The switch has three states:

- Position 1 - open
- Position 2 - closed
- Position 3 - 1500-ohm resistance.

Refer to Troubleshooting Fault Code t05-524 (</qs3/pubsys2/xml/en/procedures/87/87-t05-524.html>)

Last Modified: 29-Jul-2010
