

Fault Code: 529

Solenoid B Error

 Printable Version

Overview


Codes	Reason	Effect
Fault Code: 529 PID(P): S051 SPN: P02 FMI: 703 Lamp: Yellow SRT:	Less than 17 VDC detected at solenoid B supply pin 21 of the engine harness.	No action is taken by the electronic control module (ECM).

©Cummins Inc


21-Pin OEM
Connector



Solenoid B

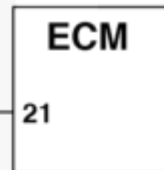

Engine
Harness

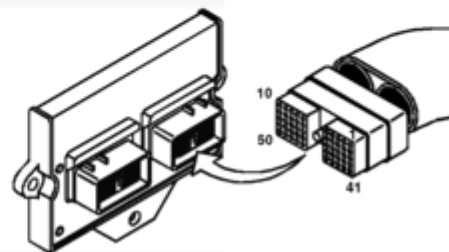

19a00673

Solenoid B Circuit

Circuit Description

The solenoid driver will control engine and vehicle functions by closing or opening a switched solenoid output, based on 11 selected engine parameters. The solenoid output will control functions such as a fan clutch, an intake grid heater, an air cleaner restriction indicator, or an oil filter differential pressure indicator.

Component Location

The solenoid driver is an OEM device, and the location of the solenoid is dependent upon the OEM.

Refer to Troubleshooting Fault Code t05-529 (</qs3/pubsys2/xml/en/procedures/87/87-t05-529.html>)

Last Modified: 29-Jul-2010
