


Fault Code: 773

Right Bank Needle Lift Sensor Reading Is Not Being Detected or Is Out of Range.

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 773 PID(P): S118 SPN: FMI: 11 Lamp: None SRT:	Right Bank Needle Lift Sensor Reading Is Not Being Detected or Is Out of Range.	No action is taken by the engine control module. Power output can be low and engine can produce white smoke.

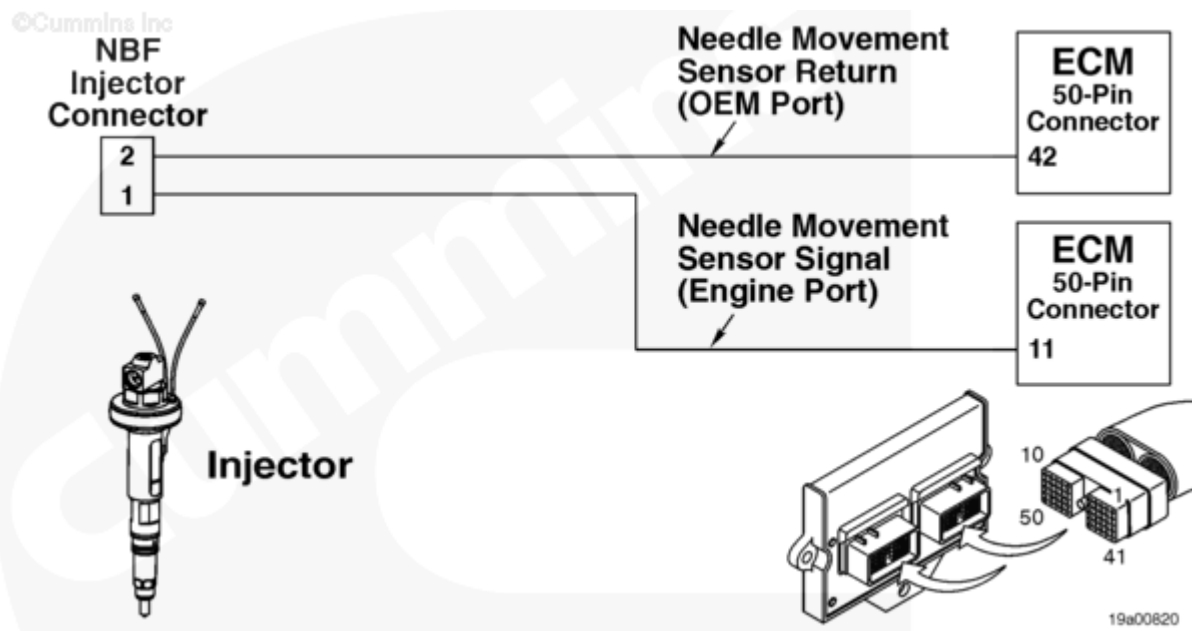

Right Bank Needle Lift Sensor

Circuit Description

The needle lift sensor is used to sense the start of injection. The engine control module (ECM) monitors the pulses from the sensor to determine when injection occurs in the cycle. The ECM monitors the pulses on pin 11.

Component Location

The needle lift sensor is an integral part of the NBF injectors (number 1 left bank and number 1 right bank injector).

Shoptalk

A common cause of a damaged needle lift sensor is a loose connection.

The fault code will **not** become active at engine speeds less than 800 rpm.

If the engine is showing either Fault Code 772 or 773 (but **not** both), then exchange the needle lift injectors from left bank Number 1 with right bank number 1 and see if the fault code follows the damaged injector.

Calibration revisions older than July 2011 will display an amber warning lamp.

Refer to Troubleshooting Fault Code t05-773. (</qs3/pubsys2/xml/en/procedures/87/87-t05-773.html>)

Last Modified: 30-Apr-2012
