

Fault Code: 111


Centinel™ Control Module Error

 Printable Version


Overview

Codes	Reason	Effect
Fault Code: 111 PID(P): SPN: FMI: Lamp: None SRT:	Centinel™ Control Module Error. An error occurred during the diagnostic test of the Centinel™ control module internal hardware.	The Centinel™ system will not operate properly.

©Cummins Inc

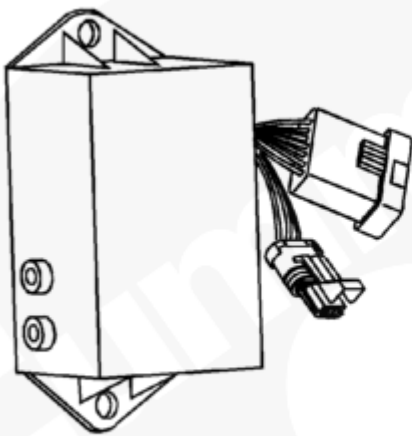

HD

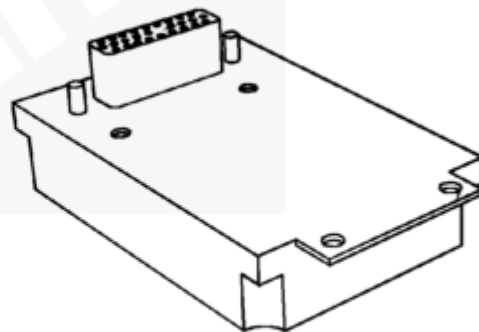

HHP

05800058

Circuit Description

The Centinel™ control module is a computer that is responsible for Centinel™ system control and diagnostics.

Component Location

Heavy-duty: The Centinel™ control module is located on the Centinel™ system make-up oil tank.

High-horsepower: The Centinel™ control module is located on the Centinel™ system oil control valve mounting bracket.

Shoptalk

This fault code can be caused **only** by an internal Centinel™ control module problem. **Only** on high-horsepower should you try to clear a fault code with use of the service plug. Repairs are **not** possible for the Centinel™ control module.

Warnings and Cautions

⚠ CAUTION ⚠

To avoid damaging a new Centinel™ control module, all other active fault codes must be investigated prior to replacing the Centinel™ control module.

Troubleshooting Summary

STEPS		SPECIFICATIONS
STEP 1.	Check the fault codes.	
	STEP 1A. Read the fault codes.	Fault Code 111 inactive
	STEP 1B. Check the fault codes.	Complete

STEP 1. Check the fault codes. (This step is for high-horsepower only. For heavy-duty, continue to Step 1B.)

STEP 1A. Read the fault codes.

Conditions :

- High-horsepower **only**
- Connect all components.
- Turn the keyswitch OFF.

Action	Specification/Repair	Next Step
--------	----------------------	-----------

Read the fault codes using diagnostic lamp.	Fault Code 111 inactive	Complete
	High-horsepower only : Clear the fault codes with the service plug. Refer to Procedure 209-001 (/qs3/pubsys2/xml/en/procedures/96/96-209-001.html).	1B

STEP 1B. Check the fault codes.

Conditions :

- Turn the keyswitch ON.

Action	Specification/Repair	Next Step
Read the fault code.	Fault Code 111 inactive	Complete
	Replace the Centinel™ control module Refer to Procedure 019-130 (/qs3/pubsys2/xml/en/procedures/96/96-019-130-tr.html).	Complete