


Trainings ▾


Resistance Check

Check the Original Equipment Manufacturer harness ground connection for loose, corroded, or broken connections.

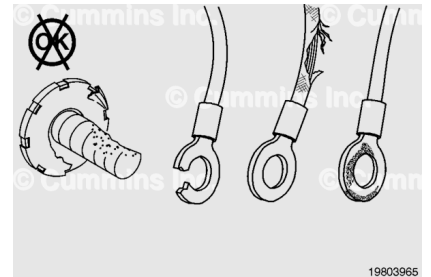

⚠ CAUTION ⚠

The leads must fit tightly in the connector without expanding the pins in the connector otherwise the connector will be damaged.

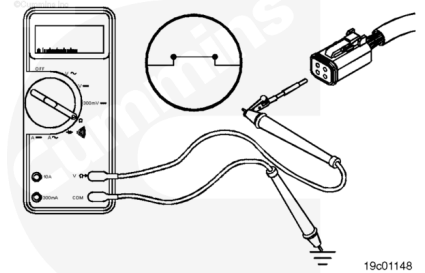

Measure the resistance between the battery supply negative (-) pin of the Original Equipment Manufacturer harness control module connector(s) and engine block ground or chassis ground for each control module. Reference the wiring diagram for connector pin identification. The resistance **must** be 10 ohms or less.

If the resistance value is **not** correct, check the batteries, cables, and cable connections.

Repair or replace the parts as required.

