


Trainings ▾

Connector Replacement

Measure 152 mm [6 inches] back from the face of the connector.

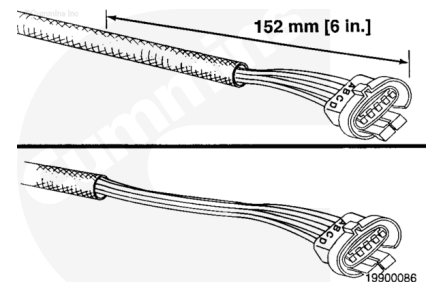


Before cutting the wires, measure and tag the four wires.

Cut wire "A" 114 mm [4.5 inches] from the face of the connector.


Cut wire "B" 102 mm [4 inches] from the face of the connector.

Cut wire "C" 89 mm [3.5 inches] from the face of the connector.

Cut wire "D" 76 mm [3 inches] from the face of the connector.

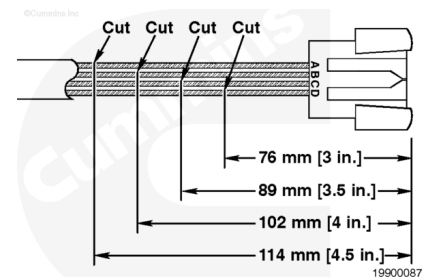


Remove 6 mm [1/4 inch] of insulation from all four wires.

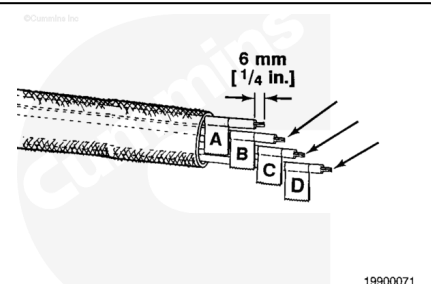


Install the terminal repair wires onto the bare wires and use wire crimping tool, Part No. 3822930, to crimp them together.

Use a heat gun, Part No. 3823860, or an open flame to heat the shrink tubing. The tubing will shrink and make the connection water resistant.

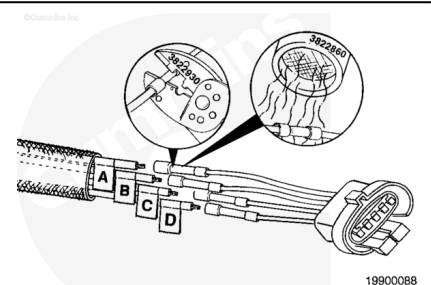

Wrap the wires with tape, for added protection, to complete the repair.

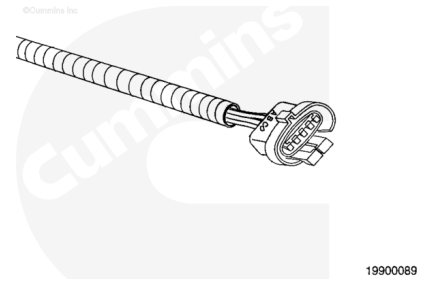

Last Modified: 10-Jul-2002
