


Fault Code: 117

Timing Pressure Sensor Circuit

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 117 PID(P): P156 SPN: 156 FMI: 4 Lamp: Red SRT: 00-347	Less than 0.15 VDC detected at timing pressure sensor signal pin 33 of the engine harness.	Depending on the calibration, the engine will shut down or speed-derate, or no action by the ECM is taken.

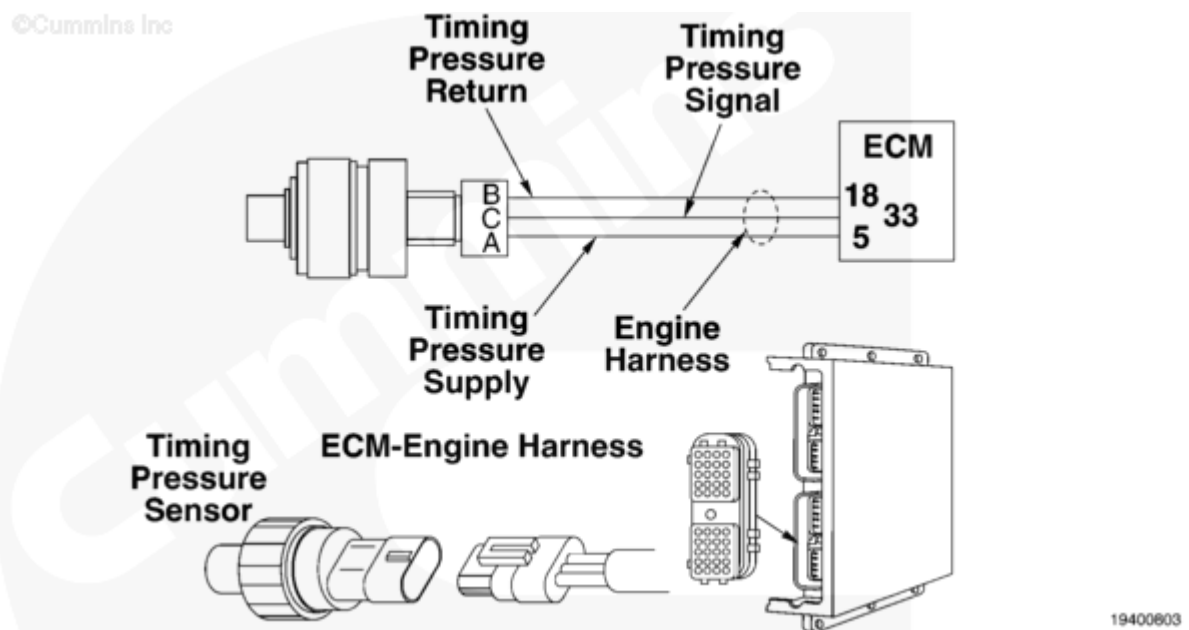

Timing Pressure Sensor Circuit

Circuit Description

The timing pressure sensor provides the timing pressure sensor signal to the ECM through the engine harness. The ECM uses the timing pressure sensor signal to monitor the timing fuel pressure going to the injector's timing chamber from the control valve body.

Component Location

The timing pressure sensor is located on the upper right side of the control valve body.

Shoptalk

Possible causes of this fault code include:

- Malfunctioning or damaged timing pressure sensor
- Malfunctioning or damaged engine wiring harness

Refer to Troubleshooting Fault Code t05-117 (</qs3/pubsys2/xml/en/procedures/19/19-t05-117.html>)

Last Modified: 28-May-2026
