


Fault Code: 123

Intake Manifold Pressure Sensor Circuit

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 123 PID(P): P102 SPN: 102 FMI: 4 Lamp: None SRT: 00-349	Less than 0.33-VDC detected at the intake manifold air pressure sensor signal pin 35 of the engine harness.	Engine power derate to no-air setting.

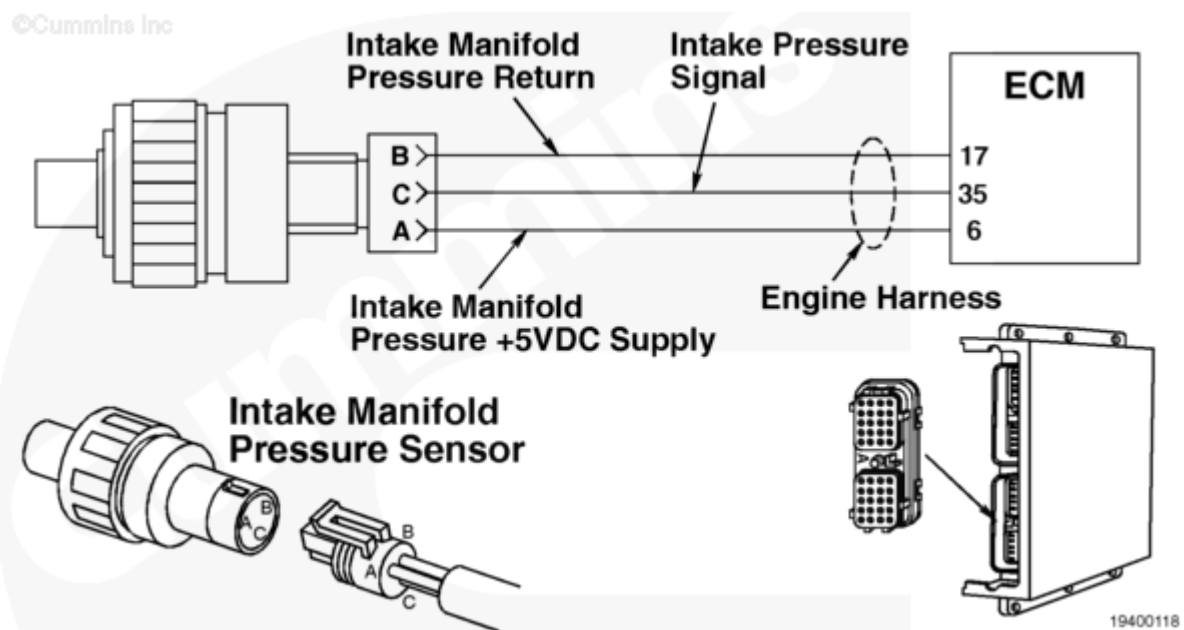

Intake Manifold Pressure Sensor Circuit

Circuit Description

The intake manifold pressure sensor monitors boost pressure and passes information to the ECM through pin 35 of the engine harness. The ECM monitors the voltage on pin 35 and expects to see the voltage vary between 0.5 and 4.5-VDC during normal engine operation. Voltage below 0.33-VDC on pin 35 can be caused by shorts in the supply, signal, or return wires, an open circuit in the supply or signal wires, low supply voltage from the ECM, or a failed sensor.

Component Location

The intake manifold pressure sensor is located on the middle lower edge of the air intake manifold.

Shoptalk

Possible causes of this fault code include:

- Malfunctioning or damaged intake manifold pressure sensor
- Malfunctioning or damaged engine wiring harness

Refer to Troubleshooting Fault Code t05-123 (</qs3/pubsys2/xml/en/procedures/19/19-t05-123.html>)

Last Modified: 28-May-2026
